


SIEMENS

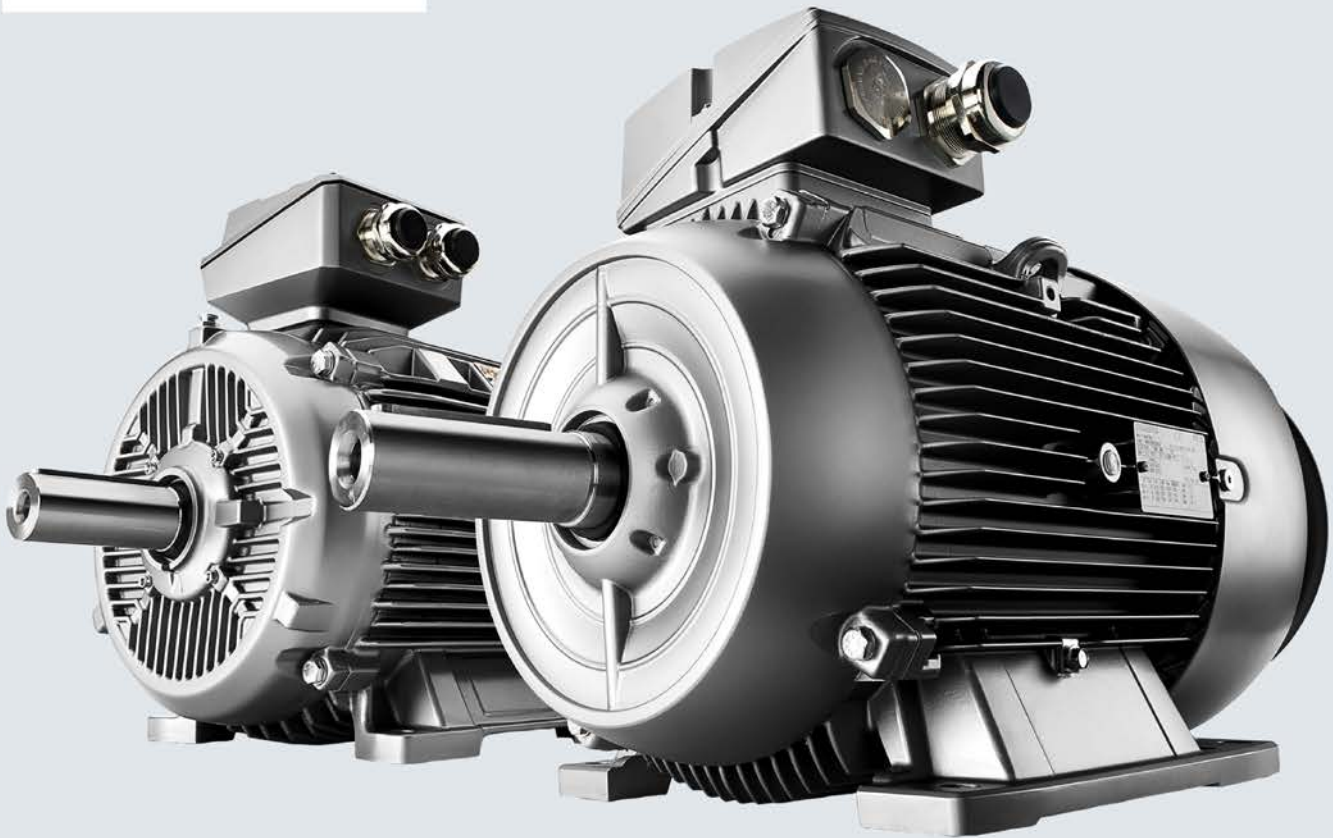

For use in Zone 1 (IEC/EN 60079-10-1)

CE<sup>0158</sup> II 2G Ex e II . T. Gb

CE<sup>0158</sup> II 2G Ex eb II . T. Gb

For use in Zone 2 (IEC/EN 60079-10-1)

CE II 3G Ex nA II . T. Gc

CE II 3G Ex ec II . T. Gc

For use in Zone 21 (IEC/EN 60079-10-2)

CE<sup>0158</sup> II 2D Ex tb IIIC T... °C Db

Optional: For use in Zone 22 (IEC / EN 60079-10-2)

CE II 3D Ex tc IIIB T... °C Dc

Operating Instructions

## Low-voltage motors

### SIMOTICS XP

1LA5/6/7/9, 1LG4/6, 1MA6/7, 1MB..1/2/3/4  
Shaft heights 63 ... 355

Edition

06/2018

[www.siemens.com/drives](http://www.siemens.com/drives)



# SIEMENS

## SIMOTICS XP

Low-voltage motors  
1LA5/6/7/9, 1LG4/6, 1MA6/7,  
1MB..1/2/3/4/5 - SH 63 ... 355

Operating Instructions

<u>Introduction</u>	<b>1</b>
<u>Safety information</u>	<b>2</b>
<u>Description</u>	<b>3</b>
<u>Preparing for use</u>	<b>4</b>
<u>Assembly</u>	<b>5</b>
<u>Electrical connection</u>	<b>6</b>
<u>Commissioning</u>	<b>7</b>
<u>Operation</u>	<b>8</b>
<u>Maintenance</u>	<b>9</b>
<u>Spare parts</u>	<b>10</b>
<u>Disposal</u>	<b>11</b>
<u>Service and support</u>	<b>A</b>
<u>Technical data</u>	<b>B</b>
<u>Quality documents</u>	<b>C</b>

For use in Zone 1 (IEC/EN 60079-10-1)  
For use in Zone 2 (IEC/EN 60079-10-1)  
For use in Zone 21 (IEC/EN 60079-10-2)  
Optional:  
For use in Zone 22 (IEC / EN 60079-10-2)




06/2018

A5E44455710A

## Legal information

### Warning notice system

This manual contains notices you have to observe in order to ensure your personal safety, as well as to prevent damage to property. The notices referring to your personal safety are highlighted in the manual by a safety alert symbol, notices referring only to property damage have no safety alert symbol. These notices shown below are graded according to the degree of danger.

 <b>DANGER</b>
indicates that death or severe personal injury <b>will</b> result if proper precautions are not taken.
 <b>WARNING</b>
indicates that death or severe personal injury <b>may</b> result if proper precautions are not taken.
 <b>CAUTION</b>
indicates that minor personal injury can result if proper precautions are not taken.
<b>NOTICE</b>
indicates that property damage can result if proper precautions are not taken.


If more than one degree of danger is present, the warning notice representing the highest degree of danger will be used. A notice warning of injury to persons with a safety alert symbol may also include a warning relating to property damage.

### Qualified Personnel

The product/system described in this documentation may be operated only by **personnel qualified** for the specific task in accordance with the relevant documentation, in particular its warning notices and safety instructions. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when working with these products/systems.

### Proper use of Siemens products

Note the following:

 <b>WARNING</b>
Siemens products may only be used for the applications described in the catalog and in the relevant technical documentation. If products and components from other manufacturers are used, these must be recommended or approved by Siemens. Proper transport, storage, installation, assembly, commissioning, operation and maintenance are required to ensure that the products operate safely and without any problems. The permissible ambient conditions must be complied with. The information in the relevant documentation must be observed.

### Trademarks

All names identified by ® are registered trademarks of Siemens AG. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

### Disclaimer of Liability

We have reviewed the contents of this publication to ensure consistency with the hardware and software described. Since variance cannot be precluded entirely, we cannot guarantee full consistency. However, the information in this publication is reviewed regularly and any necessary corrections are included in subsequent editions.

# Table of contents

<b>1</b>	<b>Introduction.....</b>	<b>9</b>
1.1	About these instructions.....	9
1.2	Compiling personal documents .....	9
<b>2</b>	<b>Safety information .....</b>	<b>11</b>
2.1	Information for those responsible for the plant or system.....	11
2.2	The 5 safety rules .....	12
2.3	Qualified personnel .....	12
2.4	Safe handling .....	12
2.5	Use in hazardous areas .....	14
2.6	Electrostatic sensitive devices .....	15
2.7	Electromagnetic compatibility .....	16
2.8	Interference immunity .....	16
2.9	Influence on the line power supply through a strongly irregular torque.....	17
2.10	Interference voltages when operating the converter .....	17
2.11	Special designs and construction versions.....	17
2.12	Special conditions for explosion-proof machines .....	17
<b>3</b>	<b>Description.....</b>	<b>19</b>
3.1	Area of application .....	19
3.2	Rating plates .....	21
3.3	Installation .....	22
3.3.1	Regulations .....	23
3.3.2	Cooling and ventilation.....	24
3.3.2.1	Machines with a fan .....	24
3.3.2.2	Machines without a fan (optional).....	24
3.3.3	Bearings .....	25
3.3.4	Balancing .....	25
3.3.5	Types of construction/method of installation .....	26
3.3.6	Degree of protection .....	27
3.3.7	Environmental conditions.....	28
3.3.8	Optional built-on and built-in accessories .....	28
3.3.9	Class .....	29
3.3.9.1	Zone 1, type of protection increased safety Ex "e" or "eb" .....	29
3.3.9.2	Zone 2, type of protection increased safety Ex "ec" or Non sparking "nA" .....	30
3.3.9.3	Zone 21 with type of protection Ex tb IIIC Db (equipment dust explosion protection provided by the enclosure "t") .....	31
3.3.9.4	Zone 22 with type of protection Ex tc IIIB Dc (equipment dust explosion protection provided by the enclosure "t") .....	32

3.3.10	Terminal box .....	32
3.3.11	Paint finish.....	32
<b>4</b>	<b>Preparing for use .....</b>	<b>33</b>
4.1	Safety-related aspects to consider when configuring the plant .....	33
4.2	Observing the operating mode.....	33
4.3	Machines without final paint coating .....	33
4.4	Delivery .....	34
4.5	Transport and storage.....	34
4.5.1	Storage.....	36
4.5.2	Securing the rotor.....	38
4.5.3	Commissioning after storage .....	40
4.5.3.1	Insulation resistance and polarization index .....	40
4.5.3.2	Lubricating the rolling bearings .....	40
4.5.3.3	Regreasing rolling bearings after storage periods of up to two years .....	40
4.5.3.4	Releasing the rotor shipping brace before commissioning .....	40
4.6	Ensure adequate cooling .....	41
4.7	Thermal protection .....	43
4.8	Interlock circuit for anti-condensation heating .....	44
4.9	Noise emission.....	44
4.10	Voltage and frequency fluctuations during line operation.....	45
4.11	Rotational speed limit values .....	45
4.12	System-inherent frequencies .....	46
4.13	Electromagnetic compatibility .....	46
4.14	Converter operation .....	47
4.14.1	Parameterizing the converter.....	47
4.14.2	Converter input voltage.....	47
4.14.3	Reducing bearing currents for converter operation .....	48
4.14.4	Insulated bearings when operated with a converter .....	49
4.14.5	Tandem operation.....	50
4.14.6	Speed limits for converter operation .....	50
<b>5</b>	<b>Assembly.....</b>	<b>51</b>
5.1	Preparing for installation .....	51
5.1.1	Requirements for installation .....	51
5.1.2	Insulation resistance .....	52
5.1.2.1	Insulation resistance and polarization index .....	52
5.1.2.2	Testing the insulation resistance and polarization index .....	53
5.2	Mounting and installed the machine .....	55
5.2.1	Preparing the assembly area .....	55
5.2.2	Balancing .....	56
5.2.2.1	Mounting and withdrawing output transmission elements .....	57
5.2.3	Machines with type of construction IM B15, IM B9, IM V8 and IM V9 .....	58
5.2.4	Foot mounting .....	58
5.3	Alignment and fastening .....	59

5.3.1	Repainting/touching up the paint finish of explosion-protected machines.....	59
5.3.2	Measures for alignment and mounting .....	60
5.3.3	Flatness of the supporting surfaces for conventional motors .....	60
5.3.4	Machine frame mounting feet (special design) .....	61
5.4	Installing the machine .....	61
5.4.1	Preconditions for smooth, vibration-free operation .....	61
5.4.2	Aligning the machine to the driven machine and mounting .....	61
5.4.2.1	Selecting bolts.....	61
5.4.2.2	Horizontal types of construction with mounting feet .....	61
5.4.2.3	Horizontal types of construction with flange .....	62
5.4.2.4	Vertical types of construction with flange.....	62
5.4.3	Removing the rotor shipping brace .....	63
5.4.4	Recommended alignment accuracy .....	63
5.4.5	Mounting the output elements .....	64
5.4.6	Axial and radial forces.....	66
<b>6</b>	<b>Electrical connection .....</b>	<b>67</b>
6.1	Preparation .....	67
6.1.1	Selecting cables.....	67
6.2	Connecting the machine .....	68
6.2.1	Terminal box .....	70
6.2.1.1	Terminal marking .....	70
6.2.1.2	Circuit diagram inside the terminal box cover.....	71
6.2.1.3	Direction of rotation.....	71
6.2.1.4	Knockout openings .....	71
6.2.1.5	Cable entry .....	72
6.2.1.6	Protruding connection cables .....	73
6.2.1.7	Connecting protruding cables .....	73
6.2.1.8	Connection with/without cable lugs.....	74
6.2.1.9	Thread sizes in the terminal box.....	74
6.2.1.10	Minimum air clearances.....	75
6.2.1.11	Internal equipotential bonding.....	75
6.2.2	Cable glands .....	75
6.2.2.1	Mounting position of sheet metal nuts in screw-type connections .....	76
6.3	Tightening torques .....	76
6.3.1	Cable entries, sealing plugs and thread adapters .....	77
6.4	Connecting the grounding conductor.....	77
6.4.1	Minimum surface area of grounding conductor .....	77
6.4.2	Grounding connection type.....	78
6.5	Connecting the temperature sensor/anti-condensation heater .....	79
6.5.1	Connecting optional integrated devices and equipment.....	79
6.6	Conductor connection .....	80
6.6.1	Connecting conductors .....	81
6.6.2	Cable ends with wire end sleeves .....	83
6.6.3	Connecting aluminum conductors .....	83
6.7	Connecting the converter.....	84
6.8	Final checks .....	86

<b>7</b>	<b>Commissioning .....</b>	<b>87</b>
7.1	Measures before commissioning .....	87
7.1.1	Insulation resistance and polarization index .....	89
7.1.2	Testing the insulation resistance and polarization index .....	90
7.1.3	Testing the cooling of the machine .....	92
7.1.4	Commissioning an external fan.....	93
7.1.5	Further documents.....	93
7.2	Setpoint values for monitoring the bearing temperature.....	94
7.3	Switching on.....	94
7.3.1	Test run.....	95
<b>8</b>	<b>Operation.....</b>	<b>97</b>
8.1	Safety instructions for operation .....	97
8.1.1	Safety instructions relating to ventilation and cooling .....	102
8.1.2	Bridging insulated bearings.....	103
8.1.3	Switching on with the anti-condensation heating active .....	103
8.2	Switching on the machine .....	104
8.3	Switching off the external fan.....	104
8.4	Switching on again after an emergency switching-off.....	104
8.5	Stoppages .....	104
8.5.1	Avoidance of damage to rolling bearings during stoppages .....	106
8.5.2	Decommissioning the machine .....	106
8.5.3	Re-commissioning the machine.....	106
8.6	faults.....	107
8.6.1	Inspections in the event of faults.....	107
8.6.2	Electrical faults .....	107
8.6.3	Mechanical faults .....	108
8.6.4	Rolling bearing faults .....	109
8.6.5	Faults at the external fan .....	109
8.7	Deactivating .....	109
<b>9</b>	<b>Maintenance.....</b>	<b>111</b>
9.1	Preparation and notes.....	111
9.1.1	North American market (optional) .....	111
9.1.2	Customs union Eurasia (optional).....	112
9.2	Inspection and maintenance .....	112
9.2.1	Safety instructions for inspection and maintenance .....	112
9.2.2	Explosion hazard due to increased surface temperature .....	113
9.2.3	Static charging when cleaning .....	114
9.2.4	Inspections in the event of faults.....	114
9.2.5	First inspection .....	115
9.2.6	General inspection .....	115
9.2.7	Assessing the rolling bearings .....	116
9.2.8	Mechanical explosion protection for rolling bearings .....	116
9.2.9	Maintenance intervals .....	117
9.2.10	Re-greasing.....	118
9.2.11	Cleaning .....	119



9.2.12	Risk of explosion due to damaged seals .....	119
9.2.13	Drain condensate .....	120
9.2.14	Insulation resistance and polarization index .....	120
9.2.15	Maintaining the external fan (forced ventilation) .....	121
9.2.16	Repainting .....	122
9.2.16.1	Paint finish resistant to sea air .....	122
9.2.16.2	Touch up any damaged paintwork .....	122
9.3	Corrective maintenance .....	124
9.3.1	Extended motor marking .....	124
9.3.2	Anti-condensation heating .....	125
9.3.3	Sealing measures .....	126
9.3.4	Rolling bearings .....	127
9.3.4.1	Replacing bearings in explosion-proof machines .....	128
9.3.4.2	Bearing bushes .....	128
9.3.4.3	Fitting bearings .....	129
9.3.4.4	Insulated roller bearings .....	130
9.3.5	Mounting dimension "x" .....	131
9.3.6	Fan .....	131
9.3.6.1	Metal fan disassembly .....	132
9.3.6.2	Mounting fans .....	132
9.3.7	Cable entries, sealing plugs and thread adapters .....	132
9.3.8	Terminal boxes, end shields, grounding conductors, sheet metal fan covers .....	133
9.3.9	Terminal board and grounding .....	133
9.3.10	Screw lock washers .....	133
9.3.11	Links .....	133
9.3.12	Reassembly: Miscellaneous information .....	134
9.3.13	Optional add-on units .....	134
9.3.14	O-ring seal .....	134
<b>10</b>	<b>Spare parts .....</b>	<b>135</b>
10.1	Parts order .....	135
10.2	Data matrix code on the machine .....	135
10.3	Ordering data .....	135
10.4	Purchasing commercially available spare parts .....	136
10.5	Ordering spare parts via the Internet .....	136
10.6	Roller bearings .....	136
10.7	Anti-condensation heating .....	137
10.8	Parts groups definition .....	137
10.9	Ordering example .....	138
10.10	Machine parts .....	139
10.10.1	Part lists .....	139
10.11	Standardized parts .....	141
10.12	Exploded drawings .....	142
10.12.1	1LA,1MA shaft heights 63 ... 90L, 1MB shaft heights 63 ... 71 .....	142
10.12.2	1LA,1MA shaft heights 100 ... 160 .....	143
10.12.3	1LA5180 ... 225 .....	144

10.12.4	1MA6180 ... 200.....	145
10.12.5	Terminal boxes 1MA6180 ... 200.....	146
10.12.6	1MB1 SH80 ... 160 aluminum.....	147
10.12.7	1MB1 shaft heights 71 ... 90 cast iron.....	148
10.12.8	1MB1 shaft heights 100 ... 200 cast iron.....	149
10.12.9	1MB1 shaft heights 225 ... 315 cast iron.....	150
10.12.10	1MB5 shaft height. 315 cast iron.....	151
10.12.11	1MB5 terminal box shaft height 315 cast iron.....	152
10.12.12	1MB5 shaft height. 355 cast iron.....	153
10.12.13	1MB5 terminal box shaft height 355 cast iron.....	154
10.12.14	1LG4/6 SH180 ... 315.....	155
10.12.15	Terminal box gk330, gt320, gk430, gt420.....	156
10.12.16	Terminal box gk431, gt421, gt520, gt540.....	157
10.12.17	Terminal box 1LG4/6, 1MB1, gt620, gt640, gt791.....	158
<b>11</b>	<b>Disposal.....</b>	<b>159</b>
11.1	Introduction.....	159
11.2	RoHS - restricting the use of certain hazardous substances.....	159
11.3	Country-specific legislation.....	159
11.4	Preparing for disassembly.....	160
11.5	Dismantling the machine.....	160
11.6	Disposal of components.....	160
<b>A</b>	<b>Service and support.....</b>	<b>163</b>
A.1	Siemens Industry Online Support.....	163
A.2	Further documents.....	163
<b>B</b>	<b>Technical data.....</b>	<b>165</b>
B.1	Tightening torques.....	165
B.1.1	Tightening torques for screw and bolt connections.....	165
B.1.2	Stud-type bushings.....	166
B.1.3	Terminal boxes, end shields, grounding conductors, sheet metal fan covers.....	166
B.1.3.1	Terminal board and grounding.....	166
B.1.4	Additional connecting terminals for monitoring equipment and anti-condensation heating.....	166
<b>C</b>	<b>Quality documents.....</b>	<b>167</b>
C.1	Quality documents SIMOTICS in SIOS.....	167
	<b>Index.....</b>	<b>169</b>

# Introduction

## 1.1 About these instructions

These instructions describe the machine and explain how to handle it, from initial delivery to final disposal of the equipment. Keep these instructions for later use.

Read these operating instructions before you handle the machine and follow the instructions to become familiar with its design and operating principles and thus ensure safe, problem-free machine operation and long service life.

Please contact the service center (Page 163) if you have any suggestions on how to improve this document.

### Text format features

The warning notice system is explained on the rear of the inside front. Carefully comply with all of the safety-relevant information in these instructions and attached to the product itself.

In addition, you will find the following text format features in these instructions:

1. Handling instructions are always formatted as a numbered list. Always perform the steps in the order given.
- Lists are formatted as bulleted lists.
    - Lists on the second level are hyphenated.

---

#### Note

The note provides you with additional information about the product itself, handling the product - and the relevant documentation.

---

## 1.2 Compiling personal documents

On the Internet pages in Industry Online Support you have the possibility of compiling personal documents using the function Documentation (<https://support.industry.siemens.com/My/ww/en/documentation>)

Using the "Documentation" function, from Product Support manuals, you can compile your own "Documentation". However, you can also include other Product Support content such as FAQs or characteristics in the documentation that you compile.

In the "Documentation" function, you have the option of creating your own compiled documents in your own structure and managing them. You can delete or shift individual chapters or topics. Further, using the note function you can import your own content. The compiled "documentation" can be exported as PDF, for example.

*1.2 Compiling personal documents*

Using the "Documentation" function, you can efficiently compile your own plant or system documentation. The "Documentation" compiled in a specific language can also be automatically exported in one of the other available languages.

The full functionality is only available for registered users.

## Safety information

### 2.1 Information for those responsible for the plant or system

This electric machine has been designed and built in accordance with the specifications contained in Directive 2014/35/EU ("Low-Voltage Directive") and is intended for use in industrial plants. Please observe the country-specific regulations when using the electric machine outside the European Community. Follow the local and industry-specific safety and setup regulations.

The persons responsible for the plant must ensure the following:

- Planning and configuration work and all work carried out on and with the machine is only to be done by qualified personnel.
- The operating instructions must always be available for all work.
- The technical data as well as the specifications relating to the permissible installation, connection, ambient and operating conditions are taken into account at all times.
- The specific setup and safety regulations as well as regulations on the use of personal protective equipment are observed.

---

#### Note

Use the services and support provided by the local service center (Page 163) for planning, installation, commissioning and service work.

---

You will find safety instructions in the individual sections of this document. Follow the safety instructions for your own safety, to protect other people and to avoid damage to property.

Observe the following safety instructions for all activities on and with the machine.

### Explosion Protection Directive

This machine has been designed, built and tested in accordance with Directive 2014/34/EU ("Explosion Protection Directive") and is intended for use in industrial plants with a potentially explosive atmosphere. Commissioning the machine in hazardous zones is absolutely prohibited until conformance with these guidelines has been proven based on the appropriate certificate. If the machine is commissioned prior to determining the conformance, then explosion protection is not ensured. An explosion can occur. This can result in death, serious injury or material damage.

Please observe the country-specific regulations when using the machine outside the European Community.

## 2.2 The 5 safety rules

For your own personal safety and to prevent material damage when carrying out any work, always observe the safety-relevant instructions and the following five safety rules according to EN 50110-1 "Working in a voltage-free state". Apply the five safety rules in the sequence stated before starting work.

### 5 safety rules

1. Disconnect the system.  
Also disconnect the auxiliary circuits, for example, anti-condensation heating.
2. Secure against reconnection.
3. Verify absence of operating voltage.
4. Ground and short-circuit.
5. Provide protection against adjacent live parts.

To energize the system, apply the measures in reverse order.

## 2.3 Qualified personnel

All work at the machine must be carried out by qualified personnel only. For the purpose of this documentation, qualified personnel is taken to mean people who fulfill the following requirements:

- Through appropriate training and experience, they are able to recognize and avoid risks and potential dangers in their particular field of activity.
- They have been instructed to carry out work on the machine by the appropriate person responsible.

## 2.4 Safe handling

Workplace safety depends on the attentiveness, care, and common sense of the personnel who install, operate, and maintain the machine. In addition to the safety measures cited, as a matter of principle, the use of caution is necessary when you are near the machine. Always pay attention to your safety.

Also observe the following to prevent accidents:

- General safety regulations applicable in the country where the machine is deployed.
- Manufacturer-specific and application-specific regulations
- Special agreements made with the operator
- Separate safety instructions supplied with the machine
- Safety symbols and instructions on the machine and its packaging

### **Danger as a result of stationary parts under voltage (live parts)**

Live parts represent a hazard. Touch protection against active (live) parts is no longer guaranteed if covers are removed. The minimum clearance and creepage distances may be violated when coming close to live parts. Touching or coming close to them can result in death, serious injury or material damage.

- Ensure that all live parts are suitably covered.
- Switch off and disconnect the machine first if you want to remove covers. Observe the "5 safety rules" (Page 12).

### **Risk of injury due to rotating parts**

Rotating parts are dangerous. Touch protection against rotating parts is no longer guaranteed if covers are removed. Touching rotating parts can result in death, serious injury or material damage.

- Ensure that all rotating parts are reliably covered.
- Switch off and disconnect the machine first if you want to remove covers. Observe the "5 safety rules" (Page 12).
- Only remove covers when the rotating parts have come to a complete standstill.

### **Risk of burns due to hot surfaces**

Individual machine parts can become hot in operation. Burns can result when coming into contact with these parts.

- Never touch machine parts during operation.
- Allow the machine to cool before starting work on the machine.
- Check the temperature of parts before touching them. If required, wear suitable protective equipment.

### **Health hazard due to chemical substances**

Chemical substances required for the setup, operation and maintenance of machines can present a health risk.

- Observe the product information provided by the manufacturer.

### **Flammable substances hazard**

Chemical substances required for the setup, operation and maintenance of machines may be flammable. These substances can ignite if handled incorrectly. They can cause burns and property damage.

- Observe the product information provided by the manufacturer.

### **See also**

Inspection and maintenance (Page 112)

## Noise emissions

During operation, the machine's noise emission levels can exceed those permitted at the workplace, which can cause hearing damage.

- Ensure that nobody is in the area of increased noise emissions during machine operation.
- Take steps to reduce noise so that the machine can be operated safely within your system. The following measures may help to reduce noise.
  - Covers
  - Noise insulation
  - Hearing protection measures

 **CAUTION**

**Hearing damage when operating three-phase motors**

If the permissible sound pressure level is exceeded, hearing damage can occur when operating three-phase motors at their rated power.

Observe the maximum permissible sound pressure level according to the ISO 1680 standard. The maximum permissible sound pressure level is 70 dB (A).

## Interference to electronic devices caused by electrical power equipment

Electrical power equipment generate electric fields during operation. Potentially lethal malfunctions can occur in medical implants, e.g. pacemakers, in the vicinity of electrical power equipment. Data may be lost on magnetic or electronic data carriers.

- It is forbidden for people with pacemakers to enter the vicinity of the machine.
- Protect the personnel working in the plant by taking appropriate measures, such as erecting identifying markings, safety barriers and warning signs and giving safety talks.
- Observe the nationally applicable health and safety regulations.
- Do not carry any magnetic or electronic data media.

## 2.5 Use in hazardous areas

Electrical systems in hazardous zones must be assembled, installed, and operated by the applicable responsible persons in accordance with the applicable rules and regulations.

---

### Note

The basic requirements relating to electrical systems and their operation in hazardous areas are described, for instance, in EU Directive 1999/92/EC as well as in IEC / EN 60079-14.

---



## Ignition hazards

The assessment of operating risks and local operating conditions and the necessary monitoring methods must be clarified and made binding by the system operator in consultation with the responsible supervisory authority. The required measures must be adhered to at all times. The machine manufacturer cannot provide any generally applicable recommendations. Please observe the information in these operating instructions.

---

### Note

The basic requirements relating to the assessment of ignition hazards arising from electrical equipment and their operation in hazardous zones are specified in the 2014/34/EU and 1999/92/EC directives as well as in the IEC/EN 60079 series of standards.

---

If a third-party certification is available for the machine, then carefully comply with the technical data defined in it and any special conditions.

The certificate must be available before commissioning.


## 2.6 Electrostatic sensitive devices

### Material damage due to electrostatic discharge

Electronic modules contain components that can be destroyed by electrostatic discharge. These components can be damaged or destroyed if they are not handled correctly. To protect equipment against damage, follow the instructions given below.

- Only touch electronic modules if you absolutely have to work on them.
- The body of the person concerned must have been electrostatically discharged and grounded immediately before any electronic modules are touched.
- Electronic modules should not be brought into contact with electrically insulating materials, such as:
  - Plastic film
  - Plastic parts
  - Insulating table supports
  - Clothing made of synthetic fibers
- Always place electrostatic sensitive devices on conductive bases.
- Always pack, store and transport electronic modules or components in conductive packaging, such as:
  - Metallized plastic or metal containers
  - Conductive foam material
  - Domestic aluminum foil

The necessary ESD protective measures for electrostatic sensitive devices are illustrated once again in the following drawings:

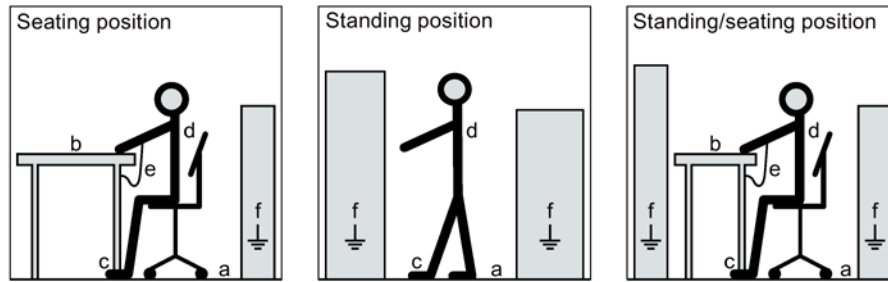

a = conductive floor surface

b = ESD table

c = ESD shoes

d = ESD overall

e = ESD wristband

f = cabinet ground connection

### Risk of explosion due to electrostatic discharge

Electrostatic discharge poses a potential ignition source. Dangerous electrostatic charges can occur, for example as a result of mechanical friction, flowing air that contains particles - or persons that are not appropriately grounded, e.g. when carrying out maintenance or cleaning work.

In an explosive atmosphere, there is a risk of an explosion. This can result in death, serious injury or material damage.

- Avoid carrying out work specified above on non-metallic parts, e.g. foam rubber for noise dampeners/attenuators.
- Please comply with ESD protective measures.

## 2.7 Electromagnetic compatibility

### Electromagnetic compatibility

This machine is designed in accordance with IEC/EN 60034, and when used as prescribed it satisfies the requirements of European Directive 2014/30/EU on Electromagnetic Compatibility.

## 2.8 Interference immunity

By selecting suitable signal cables and evaluation units, ensure that the interference immunity of the machine is not diminished.

## 2.9 Influence on the line power supply through a strongly irregular torque

A strongly irregular torque, for example with the drive of a reciprocating motor, forces a non-sinusoidal motor current. The emerging harmonics can have an impermissible influence on the line power supply via the connection lines.

## 2.10 Interference voltages when operating the converter

### Interference voltages when operating the converter

When a converter is in operation, the emitted interference varies in strength depending on the converter (manufacturer, type, interference suppression measures undertaken). On machines with integrated sensors (e.g. PTC thermistors), interference voltages caused by the converter may occur on the sensor lead. This can cause faults which can result in eventual or immediate death, serious injury or material damage.

- Comply with the EMC information provided by the manufacturer of the converter. This is how you prevent the limit values stipulated by IEC/EN 61000-6-3 for the drive system (consisting of the machine and converter) from being exceeded.
- You must put appropriate EMC measures in place.

## 2.11 Special designs and construction versions

---

### Note

Before carry out any work on the machine, determine the machine version.

If there are any deviations or uncertainty, contact the manufacturer, specifying the type designation and serial number (see the rating plate), or contact the Service Center (Page 163).

---

## 2.12 Special conditions for explosion-proof machines

Special conditions for the safe use of explosion-protected machines with X marking (excerpt from EC or EU prototype test certificate, Point 17).

### Zone 21 - DMT 01 ATEX E 014X

It is not permissible that the motors are operated with excessively thick deposits of dust. When mounting motors with the free shaft extension facing upwards, foreign bodies must be prevented from falling into ventilation openings by taking the appropriate measures. For motors with permanently attached connecting cable. The free cable ends must be connected corresponding to the valid installation regulations.

2.12 Special conditions for explosion-proof machines

If the three-phase motor is cooled using an external fan, then it must be carefully ensured that the motor can only be operated with the cooling switched on.

When commissioning, it must be carefully ensured that when fed from a converter, no inadmissibly high overvoltages occur at the motor terminals. The clearances and creepage distances in the terminal box do not permit overvoltages as a result of converter operation with a periodic peak value of more than:

- 1500 V for rated voltages  $\leq$  500 V.

The motor insulation system may mean that it is necessary to further limit periodically occurring overvoltages.

**Zone 1** - PTB 03 ATEX 3107X, PTB 02 ATEX 3060X, PTB 01 ATEX 3335X, PTB 01 ATEX 3336X, PTB 01 ATEX 3337X, PTB 04 ATEX 3041X

Special conditions relating to the installation:

If the non-terminated cable ends are connected to the external power circuit according to EN 60079-0, Paragraph 14.1 in the hazardous zone, then a terminal box with its own certification and explosion protection marking must be selected according to the conditions that prevail at the installation site.

**Zone 1** - PTB 02 ATEX 3024X

It is only permissible that these types of motors are operated in conjunction with gas return pumps at converters of the type specified above with the defined setting values. Further, they must be monitored using the adapted equipment described in the data sheet. The maximum cable length between the converter and motor is 4 m.

**Zone 1** - PTB 03 ATEX 3053X, PTB 03 ATEX 3054X

It is only permissible that the motors are operated with a converter and filter of the types specified in the data sheet with the setting values defined there. The motors must also be monitored corresponding to what is specified in the data sheet.

**Zone 2, 22** - BVS 14 ATEX E 081 X, BVS 14 ATEX E 082 X

It is only permissible that the motor is fed from a voltage-source DC link converter with pulse width modulation, maintaining the parameters listed in Section 15.3.

Before commissioning it must be carefully ensured that when fed from a converter, no inadmissibly high overvoltages occur at the motor terminals. The clearances and creepage distances in the terminal box do not permit overvoltages as a result of converter operation with a periodic peak value of more than 1500 V for rated voltages  $\leq$  1000 V.

The motor insulation system may mean that it is necessary to further limit periodically occurring overvoltages.

## Description

### 3.1 Area of application

The rotating electrical motors of this series are used as industrial drives. They are designed for a wide range of drive applications both for line operation as well as in conjunction with frequency converters.

They are characterized by their high power density, extreme robustness, long service life and outstanding reliability.

#### Intended use of the machines

These machines are intended for industrial installations. They comply with the harmonized standards of the series EN / IEC 60034 (VDE 0530). It is prohibited to use these motors in hazardous zones if the marking on the rating plate does not explicitly permit line or converter operation. If other/more wide-ranging demands (e.g. protection so that they cannot be touched by children) are made in special cases – i.e. use in non-industrial installations – these conditions must be ensured by the customer.

---

#### Note

##### Machine directive

Low-voltage motors are components designed for installation in machines in accordance with the current Machinery Directive. Commissioning is prohibited until it has been absolutely identified that the end product is in conformance with this Directive. Please observe the EN / IEC 60204-1 standard.

---

## CE

#### Use of machines without CE marking

Machines without CE marking are intended for operation outside the European Economic Area (EEA). Do not use any machines without a CE marking in the EEA!

## EAC

#### Use of machines without EAC marking

EAC machines are appropriately marked on the rating plate, and are intended for operation within the Eurasian customs union.

Within the Eurasian customs union, do not use machines without the appropriate EAC marking.

## Use in hazardous areas

Explosion-proof electrical machines correspond to standards of the IEC/EN 60034 and IEC/EN 60079 series. Only operate the machine in hazardous areas, strictly complying with the specifications of the responsible supervisory authority. The relevant supervisory authority is responsible for determining the hazard level of each area and classifying the zones. The type of protection as well as special regulations are stamped on the rating plate or in the test certificate. If the certificate number is supplemented by an X, to safely operate the machine observe the special notes in the operating instructions or if available in the EC or EU type-examination certificate or in the IECEx Certificate of Conformity. Operation with a converter must be certified. It is essential that you observe the separate manufacturer's information and instructions.

## Explosion hazard from hybrid mixtures

Hybrid mixtures are mixtures of flammable dusts with explosive gas/air atmospheres which can together create a dangerous explosive atmosphere if they occur at the same time. Changes can arise in the safety characteristics here, such as a change in the zonal classification, increase in the explosion pressure, reduction in the minimum ignition energy and a reduction in the maximum temperatures to be observed.

An explosion can result. This can result in death, serious injury or material damage.

- For this reason, the relative characteristics must be considered both for gas (zones 0, 1 and 2) and for dust (zones 20, 21 and 22) where hybrid mixtures arise. It is necessary for a competent assessor to determine in the individual case whether the parameters determining ignition are unfavorably affected in a particular hybrid mixture.
- Motors with dual plates for G ("Gas") and D ("Dust") may only be used where these two occur after prior examination of the properties of the hybrid mixtures by the user.

### Type of protection Ex nA or ex ec

This machine has type of protection "non-sparking" Ex nA according to IEC / EN 60079-0 and IEC / EN 60079-15 - or type of protection "Increased safety" Ex ec according to IEC / EN 60079-0 and IEC / EN 60079-7. Only operate the machine in hazardous **Zone 2** according to IEC / EN 60079-10-1.

### Type of protection Ex e or Ex eb

This machine has type of protection "Increased safety" Ex e or ex eb according to IEC / EN 60079-0 and IEC / EN 60079-7. Only operate the machine in hazardous **Zones 1 and 2** according to IEC / EN 60079-10-1.

### Type of protection Ex tb, Ex tc

This machine has optionally (or exclusively) "Protection through enclosure" (Ex t) type of protection according to IEC / EN 60079-0 and IEC / EN 60079-31. Only operate the machine in hazardous **Zones 21 and 22** in type of protection Ex tb - and only in **Zone 22** in type of protection Ex tc according to IEC / EN 60079-10-2.

## 3.2 Rating plates


### Rating plate

The rating plate shows the identification data and the most important technical data. The data on the rating plate and the contractual agreements define the limits of proper usage.


### Data on the rating plate

Item	Description	Item	Description
<b>General data</b>		<b>Electrical data</b>	
1	Type of machine	31	Electrical data
2	Machine type	33	Rated voltage V
3	Serial number (incl. date of manufacture YY.MM)	34	Winding connections
4	Standards	35	Frequency Hz
5	Additional details (optional)	36	Rated power kW
6	Customer data (optional)	37	Rated current A
7	Country of origin	38	Power factor cosφ
8	Production location	39	Rated speed rpm
9	Identification number of testing agency (optional)	40	Efficiency class
10	Regulations (optional)	41	Efficiency
49	Company logo	42	Torque Nm (optional)
52	Marine regulation	45	Starting current ratio
53	Motor family type	46	Operating mode (optional)
54	Data for explosion-protected machines	48	Anti-condensation heating (optional)
56	Converter type	51	Converter data
<b>Mechanical data</b>		57	Temperature class
11	Frame size		
12	Type of construction		
13	Degree of protection		
14	Machine weight kg		
15	Temperature class		
16	Ambient temperature range (optional)		
17	Installation altitude (only if higher than 1000 m)		
18	Vibration severity grade		
19	Bearing sizes		
20	Relubrication data/specifications (optional)		
24	Feather key arrangement		

**Line operation (DOL) rating plate**

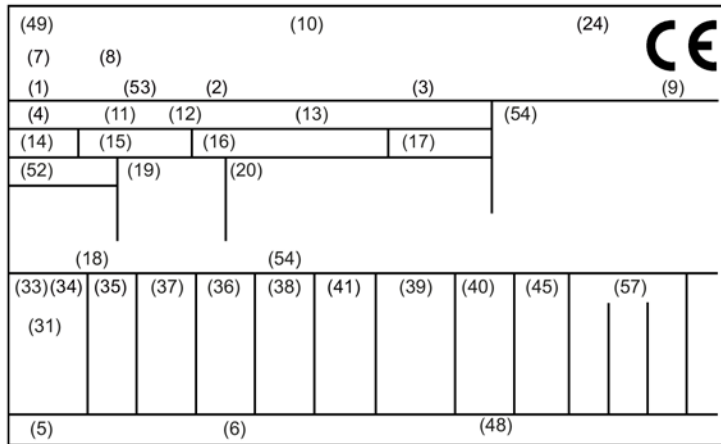

**Converter operation (VSD) rating plate**

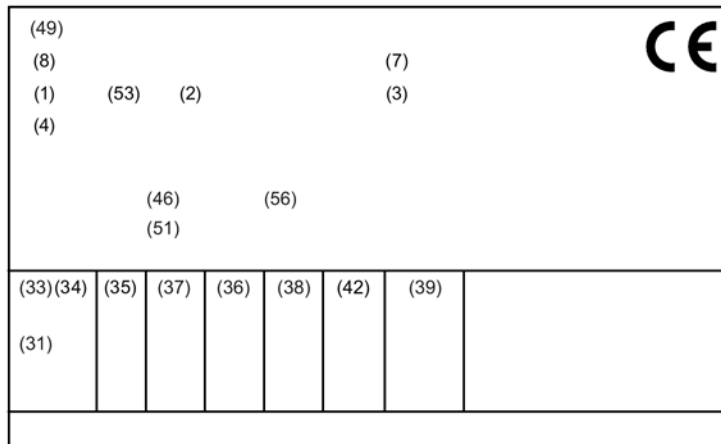

### 3.3 Installation

**Machine design**

The regulations and standards used as the basis to design and test this machine are stamped on the rating plate.

The machine design basically complies with the subsequent standards. Please refer to the EU Declaration of Conformity for the versions of the harmonized standards referenced.



### 3.3.1 Regulations

Table 3- 1 Applicable general regulations

Feature	Standard	EAC
Dimensioning and operating behavior	EN / IEC 60034-1	GOST R IEC 60034-1
Procedure for determining the losses and the efficiency of rotating electrical machines and inspections	EN / IEC 60034-2-1 EN / IEC 60034-2-2 EN / IEC 60034-2-3	GOST R IEC 60034-2-1 GOST R IEC 60034-2-2 GOST RIEC 60034-2-3
Degree of protection	EN / IEC 60034-5	GOST R IEC 60034-5
Cooling	EN / IEC 60034-6	GOST R IEC 60034-6
Type of construction	EN / IEC 60034-7	GOST R IEC 60034-7
Terminal designations and direction of rotation	EN / IEC 60034-8	GOST R IEC 60034-8
Noise emission	EN / IEC 60034-9	GOST R IEC 60034-9
Starting characteristics of rotating electrical machines	EN / IEC 60034-12	GOST R IEC 60034-12
Vibration severity grades	EN / IEC 60034-14	GOST R IEC 60034-14
Efficiency classification of three-phase squirrel-cage induction motors	EN / IEC 60034-30-1	GOST R IEC 60034-30-1
IEC standard voltages	IEC 60038	GOST R IEC 60038

Table 3- 2 Regulations applied for explosion-protected machines

Feature	Standard	EAC
Electrical equipment for hazardous gas atmospheres, Part 0: General requirements	EN / IEC 60079-0	GOST 30852 0 - 2002
Electrical equipment for hazardous gas atmospheres – Part 1: Device protection provided by flameproof enclosure "d"	EN / IEC 60079-1	GOST 30852 1 - 2002
Electrical equipment for hazardous gas atmospheres, Part 7: Increased safety "e"	EN / IEC 60079-7	GOST 30852 8 - 2002
Electrical equipment for hazardous gas atmospheres, Part 14: Electric installations for endangered atmospheres (except underground excavation)	EN / IEC 60079-14	GOST 30852 13 - 2002
Electrical equipment for hazardous gas atmospheres, Part 15: Type of protection "n"	EN / IEC 60079-15	GOST 30852 14 - 2002

Feature	Standard	EAC
Electrical equipment for use in the presence of combustible dust - Part 17: Inspection and maintenance of electrical systems in hazardous areas (except underground excavation)	EN / IEC 60079-17	GOST 30852 16 - 2002
Electrical equipment for hazardous gas atmospheres, Part 19: Repairs and overhauls	EN / IEC 60079-19	GOST 30852 18 - 2002
Potentially explosive atmosphere - Part 31: Device dust explosion protection by enclosure "t"	EN / IEC 60079-31	GOST R IEC 60079-31
Directive on the approximation of the laws of the Member States concerning equipment and protective systems intended for use in hazardous areas.	Directive 2014/34/EU	TR CU

### 3.3.2 Cooling and ventilation

The machines of this series are three-phase induction machines with a closed primary (internal) cooling circuit and an open secondary cooling circuit (surface cooling). The surface cooling varies depending on the version.

#### 3.3.2.1 Machines with a fan

##### Self-ventilation (standard): Cooling method IC 411 according to EN / IEC 60034-6

Located at the ND end of the stator housing is an air intake cowl that guides the external air on its way to the motor. The external air is drawn in through openings in the air intake cowl and flows axially across the outer cooling ribs of the motor frame. The fan wheel for the external flow of cooling air is attached to the machine shaft.

The fan wheels are bidirectional.

Check the cooling effect below rated speed in the case of frequent switching or braking – or if the speed is controlled continually below the rated speed.

##### Forced ventilation (optional): Type of cooling IC 416 in accordance with EN / IEC 60034-6

Cooling that does not depend on the speed is achieved by means of a unit that is independent of the motor operating state (forced ventilation). This unit is closed to the outside by a fan cover. It has its own main drive with fan impeller which creates the cooling air flow required for cooling the motor.

#### 3.3.2.2 Machines without a fan (optional)

##### Cooling method IC 410

Surface cooling by free convection: Cooling method IC 410 according to EN / IEC 60034-6

##### Cooling method IC 418

Surface cooling by relative movement of cooling air: Cooling method IC 418 according to EN / IEC 60034-6

### 3.3.3 Bearings

In order to support the machine shaft and maintain its position in the non-moving part of the machine, only 2 rolling bearings are used. One rolling bearing performs the function of a location bearing that transfers axial and radial forces from the rotating machine shaft to the non-moving part of the machine. The second rolling bearing is implemented as floating and support bearing in order to allow thermal expansion inside the machine and transfer radial forces.

The nominal (calculated) useful life of the bearings according to ISO 281 is at least 20,000 hours with utilization of the permissible radial/axial forces. However, the achievable useful life of the bearings can be significantly longer in the case of lower forces (e.g. operation with self-aligning couplings).

Rolling bearings with permanent lubrication are maintenance-free.

The machine is equipped with grease-lubricated rolling bearings.

- In the standard version, the bearings of machines up to shaft height 250 are permanently lubricated.
- The bearings of machines from shaft height 280 and above are equipped with a relubrication system.

### 3.3.4 Balancing

As standard, the motor is balanced dynamically with a half feather key (code "H"). Vibration level "A" is standard and, if ordered as an option, vibration level B is specified on the rating plate.

 
 




 


 

 
#### See also



Balancing (Page 56)

### 3.3.5 Types of construction/method of installation

The type of construction of the machine is stated on the rating plate.

Table 3- 3 Type of construction

  Basic type of construction code	Diagram	Other methods of installation	Diagram
IM B3 (IM 1001)		IM V5 (IM 1011)	
		IM V6 (IM 1031)	
		IM B6 (IM 1051)	
		IM B7 (IM 1061)	
		IM B8 (IM 1071)	
IM B5 (IM 3001)		IM V1 (IM 3011)	
		IM V3 (IM 3031)	
IM B14 (IM 3601)		IM V18 (IM 3611)	
		IM V19 (IM 3631)	




Basic type of construction code	Diagram
IM B35 (IM 2001)	
IM B34 (IM 2101)	

### Types of construction/Installation conditions for explosion-proof machines

The type of construction of the machine is stated on the rating plate.

In the case of explosion-proof machines where the shaft extensions point downwards (types of construction IM V5, IM V1 or IM V18 ) a protective top cover is mandatory. Explosion-proof machines with IM V5, IM V1 and IM V18 types of construction are fitted with a canopy at the factory.

Table 3- 4 Construction type with protective top cover

Conditions of installation	Graphics-Based Representation
IM V5 (IM 1011)	
IM V1 (IM 3011)	
IM V18 (IM 3611)	

### 3.3.6 Degree of protection

The machine has a type of protection as stamped on the rating plate, and can be installed in dusty or humid environments.

Machines intended for use in Zone 1 (type of protection flameproof enclosure "db" or increased safety "eb") or in Zone 2 (type of protection "ec") are designed with IP 55 degree of protection.

Machines intended for use in Zone 1 (increased safety "eb") or in Zone 2 (type of protection "ec") are designed with an IP 55 degree of protection.

Machines intended for use in Zone 21 (dust explosion protection "tb") have IP 65 degree of protection. Machines intended for use in Zone 22 (dust explosion protection "tc") have IP 55 degree of protection and can be used in dusty environments such as in grinders, silos, animal feed plants, and malhouses, as well as in certain areas of the chemical industry.

### 3.3.7 Environmental conditions

#### Limit values for the standard version

Relative humidity for ambient temperature $T_{amb}$ 40 °C	Max. 55 %
Ambient temperature	-20 °C to +40 °C
Installation altitude	≤ 1000 m
Air with normal oxygen content, usually	21 % (V/V)

The standard machines are not suitable for use in corrosive atmospheres, atmospheres with a high salt content, or outdoor applications.

#### Limit values for the special versions

If the environmental conditions are different from the details listed here, then the values on the rating plate or in the catalog will apply.

### 3.3.8 Optional built-on and built-in accessories

Machines can be equipped with the following integrated components/devices:

- Temperature sensors integrated in the stator winding in order to monitor the temperature and protect the stator winding from overheating.
- Anti-condensation heating for machines whose windings are subject to a risk of condensation due to the climatic conditions.

Machines can be equipped with the following mounted components/devices:

- Brake
- Rotary pulse encoder
- External fan (forced ventilation)
- Measuring nipple for SPM shock pulse measurement for bearing monitoring

---

#### Note

#### Further documents

Observe all of the other documents provided with this machine.

---

### Supplementary devices

Depending on the order, various supplementary devices can be installed or mounted. These include sensors for bearing temperature monitoring or winding monitoring, for example.

**⚠ DANGER**


**Risk of explosion during operation due to too high surface temperature**


This can result in death, serious injury, or material damage.

- Prevent the maximum surface temperature from being exceeded by maintaining the specified operating conditions.
- Monitor the coil temperature. Use the temperature sensor that is built into the stator winding for this as specified on the rating plate or extra rating plate.

### 3.3.9 Class


#### 3.3.9.1 Zone 1, type of protection increased safety Ex "e" or "eb"

<b>CE</b>	0158		II	2	G	Ex	eb	IIC	T3	Gb
①	②	③	④	⑤	⑥	⑦	⑧	⑨	⑩	⑪

<b>EAC</b>	<b>ГБ 05</b>		1	Ex	e	IIC	T3	Gb	X
①	②	③	⑫	⑦	⑧	⑨	⑩	⑪	⑬

- ① CE - or EAC marking
- ② Identification number or name of nominated testing agency
- ③ Code for prevention of explosions
- ④ Device group: II not for mines susceptible to firedamp, but other hazardous zones
- ⑤ Device category: 2 for occasional danger
- ⑥ Atmosphere: G for gas
- ⑦ Explosion protection: International
- ⑧ Explosion protection type "e" or "eb" increased safety
- ⑨ Explosion group: IIC for acetylene IIB für ethylene
- ⑩ Temperature class: T3 for maximum surface temperature of 200° C
- ⑪ Device protection level: Gb for a high level of protection in hazardous zones with explosive gas mixtures
- ⑫ Zone 1
- ⑬ "X" special conditions

3.3.9.2 Zone 2, type of protection increased safety Ex "ec" or Non sparking "nA"


<b>CE</b>		<b>II</b>	<b>3</b>	<b>G</b>	<b>Ex</b>	<b>ec</b>	<b>IIC</b>	<b>T3</b>	<b>Gc</b>
①	②	③	④	⑤	⑥	⑦	⑧	⑨	⑩


<b>EAC</b>	<b>ГБ 05</b>		<b>2</b>	<b>Ex</b>	<b>nA</b>	<b>IIC</b>	<b>T3</b>	<b>Gc</b>	<b>X</b>
①	⑪	②	⑫	⑥	⑦	⑧	⑨	⑩	⑬

- ① CE - or EAC marking
- ② Code for prevention of explosions
- ③ Device group: II not for mines susceptible to firedamp, but other hazardous zones
- ④ Device category: 3 for infrequent, short-term danger
- ⑤ Atmosphere: G for gas
- ⑥ Explosion protection: International
- ⑦ Type of protection: "ec" increased safety or "nA" for Non Sparking
- ⑧ Explosion group: IIC for acetylene IIB für ethylene
- ⑨ Temperature Class: T3 for maximum surface temperature of 200° C
- ⑩ Device protection level: Gc for an extended level of protection in hazardous zones with explosive gas mixtures
- ⑪ Identification number or name of nominated testing agency
- ⑫ Zone 2
- ⑬ "X" special conditions



**3.3.9.3 Zone 21 with type of protection Ex tb IIIC Db (equipment dust explosion protection provided by the enclosure "t")**


<b>CE</b>	0158		II	2	D	Ex	tb	IIIC	T125°C	Db
①	②	③	④	⑤	⑥	⑦	⑧	⑨	⑩	⑪


<b>EAC</b>	<b>ГБ 05</b>		Ex	tb	IIIC	T125°C	Db	X
①	②	③	⑦	⑧	⑨	⑩	⑪	⑫

- ① CE - or EAC marking
- ② Identification number or name of nominated testing agency
- ③ Code for prevention of explosions
- ④ Device group: II not for mines susceptible to firedamp, but other hazardous zones
- ⑤ Device category: 2 for occasional danger
- ⑥ Atmosphere: D for dust
- ⑦ Explosion protection: International
- ⑧ Type of protection: "tb" for protection by enclosure
- ⑨ Explosion group: IIIC for conductive dust
- ⑩ Maximum surface temperature: T 125°C
- ⑪ Device protection level: Db for a high level of protection in flammable dusty atmospheres
- ⑫ "X" special conditions

3.3 Installation

3.3.9.4 Zone 22 with type of protection Ex tc IIIB Dc (equipment dust explosion protection provided by the enclosure "t")

CE		II	3	D	Ex	tc	IIIB	T125°C	Dc
①	②	③	④	⑤	⑥	⑦	⑧	⑨	⑩

EAC	ГБ 05		Ex	tc	IIIB	T125°C	Dc	X
①	⑪	②	⑥	⑦	⑧	⑨	⑩	⑫

- ① CE - or EAC marking
- ② Code for prevention of explosions
- ③ Device group: II not for mines susceptible to firedamp, but other hazardous zones
- ④ Device category: 3 for infrequent, short-term danger
- ⑤ Atmosphere: D for dust
- ⑥ Explosion protection: International
- ⑦ Type of protection: "tc" for protection by enclosure
- ⑧ Explosion group: IIIB for non-conductive dust
- ⑨ Maximum surface temperature: T 125°C
- ⑩ Device protection level: Dc for an extended protection level in flammable dust atmospheres
- ⑪ Identification number or name of nominated testing agency
- ⑫ "X" special conditions

3.3.10 Terminal box

As an option, additional connecting terminals are available in the terminal box for monitoring equipment. For larger machines, an additional terminal box can be optionally mounted. You can see the number of available terminals in the circuit diagrams. It is possible to turn the top side of a machine terminal box 4 x 90 degrees (if screwed on).

3.3.11 Paint finish

Paint finish

The machine is painted according to the instructions in your order.

**Suitability test of the paint system for hazardous areas**

Proof is available for the electrostatic suitability with explosion-proof machines for the paint systems ordered by default. Such evidence is not available for paint systems that are non-standard or specifically requested by customers. Take into consideration that the provided evidence is not valid for repaintings.

## Preparing for use

Good planning and preparation of machine applications are essential in terms of keeping installation simple and avoiding errors, ensuring safe operation, and allowing access to the machine for servicing and corrective maintenance.

This chapter outlines what you need to consider when configuring your plant in relation to this machine and the preparations you need to make before the machine is delivered.

### 4.1 Safety-related aspects to consider when configuring the plant

A number of residual risks are associated with the machine. These are described in the chapter titled "Safety information" (Page 11) and in related sections.

Take appropriate safety precautions (covers, barriers, markings, etc.) to ensure the machine is operated safely within your plant.

### 4.2 Observing the operating mode

Observe the machine's operating mode. Use a suitable control system to prevent overspeeds, thus protecting the machine from damage.

### 4.3 Machines without final paint coating

For machines, which are only delivered with primer, you must paint them to comply with the applicable guidelines for the specific application. The primer alone does not provide adequate corrosion protection.

The paint applied must conform to the requirements to avoid electrostatic charging, see EN 60079-0.

Please contact the Service Center for recommendations relating to the paint finish.

## 4.4 Delivery

### Checking the delivery for completeness

The drive systems are put together on an individual basis. When you take receipt of the delivery, please check immediately whether the items delivered are in accordance with the accompanying documents. Siemens will not accept any claims relating to items missing from the delivery and which are submitted at a later date.

- Report any apparent transport damage to the delivery agent immediately.
- Report any apparent defects/missing components to the appropriate SIEMENS office immediately.

Archive the safety and commissioning notes provided in the scope of delivery as well as the optionally available operating instructions so that these documents are always easily accessible.

The rating plate optionally enclosed as a loose item with the delivery is provided to enable the motor data to be attached on or near the machine or installation.

## 4.5 Transport and storage

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.

### WARNING

#### **Risk of dropping and swinging when transported suspended**

If you transport the motor suspended from cables or ropes, the cables or ropes can break, e.g. as a result of damage. Further, if not adequately attached, the motor can swing. This can result in death, serious injury, or material damage.

- Use additional, suitable lifting equipment for transport and during installation.
- Two cables alone must be able to carry the complete load.
- Prevent the lifting equipment from sliding by appropriately securing it.
- When using 2-cable lifting equipment, ensure that the maximum angle of inclination is  $\leq 45^\circ$  according to ISO 3266 (DIN 580).
- Align the eyebolts so that the cables used for lifting are aligned with the planes of the eyebolts.

 **WARNING**

**Toppling over or slipping of the motor**

The motor can slide or topple over if it is not correctly lifted or transported. This can result in death, serious injury, or material damage.

- Use all the lifting eyes on the machine.
- When using the lifting eyes on the machine, do not attach any additional loads or weight. The lifting eyes are only designed for the weight of the machine itself.
- Any eyes that are screwed in must be tightly fastened.
- Eyebolts must be screwed in right up to their supporting surface.
- Comply with the permissible eyebolt loads.
- When necessary, use suitably dimensioned lifting equipment, for example hoisting straps (EN1492-1) and load restraints (EN12195-2).

- Never remain under or in the immediate vicinity of the machine when it is lifted. If the lifting gear or load handling attachments were to fail, the machine could fall. This can result in death, serious injury or material damage.
- In order to gain easy and safe access to the underside of the machine, place it in a secure and raised position.

**Note**

When lifting the machines for transport, only lift them in a position that corresponds to their basic construction type.

The type of construction of the machine is stated on the rating plate.

If any transport locks are in place, remove them before commissioning. Store the transport locks or disable them. Use the transport locks when transporting the motors again or reactivate the transport locks.

The machines are packed in different ways depending on how they are transported and their size. If not otherwise contractually agreed, the packaging corresponds to the packing guidelines according to ISPM (International Standards for Phytosanitary Measures).

Comply with the images shown on the packaging. Their meaning is as follows:



Up



Fragile goods



Protect against moisture



Protect against heat



Center of gravity



Hand hooks forbidden



Attach here

## 4.5.1 Storage

### Storing outdoors

<b>NOTICE</b>
<b>Damage to the motor</b>
Damage can occur if incorrectly stored.
Take all precautions to protect the motor under extreme climatic conditions, e.g. salt-laden and/or dusty, moist/humid atmospheres.

Choose a dry storage location which is safe from flooding and free from vibration. Repair any damage to the packaging before putting the equipment into storage if this is necessary to ensure proper storage conditions. In order to ensure protection against ground moisture, locate machines, equipment and crates on pallets, wooden beams or foundations. Prevent equipment from sinking into the ground. Do not impede air circulation under the stored items.

Covers or tarpaulins used to protect the equipment against the weather must not come into contact with the surfaces of the equipment. Use wooden spacer elements to ensure that air can circulate freely around the equipment.

### Storing indoors

The storage rooms must provide protection against extreme weather conditions. They must be dry, free from dust, frost and vibration and well ventilated.

### Bare metal surfaces

For transport, the bare surfaces (shaft ends, flange surfaces, centering edges) should be coated with an anti-corrosion agent which will last for a limited amount of time (<6 months). Apply suitable anti-corrosion measures for longer storage times.

### Condensation drain hole

Open any condensation drain holes to drain the condensation depending on the environmental conditions, every six months at the latest.

The materials used are specially designed for the temperature range required by the customer. The relevant temperature limits are specified on the rating plate.

 **WARNING**

**Risk of explosion due to damaged sealing materials**

Storing the machine at temperatures that do not fall within the specified limits can damage the material of the seals and cause them to fail. As a result, a potentially explosive gaseous atmosphere can enter the machine and be ignited during commissioning. Explosions can occur. This can result in death, serious injury or material damage.

- Do not store the machine in conditions that lie outside the specified temperature limits.

## Storage temperature

Permissible temperature range: -20 °C to +50 °C

Maximum permissible air humidity: 60%

For machines that have a special design regarding the ambient temperature in the operating state or the installation altitude, other conditions could apply regarding the storage temperature. In this case, refer to the machine rating plate for data on the ambient temperature and installation altitude.

## Storage time

Turn the shaft once every year to avoid bearing brinelling. Prolonged storage periods reduce the useful life of the bearing grease (aging).

### Open bearings

- For open bearings, e.g. 1Z, check the status of the grease when stored for longer than 12 months.
- Replace the grease if it is identified that the grease has lost its lubricating properties or is polluted. The consistency of the grease will change if condensation is allowed to enter.

### Closed bearings

- For closed bearings, replace the DE and NDE bearings after a storage time of 48 months.

**NOTICE**

**Storage**

The motor can be damaged if you use it or store it unprotected outdoors.

- Protect the motor against intensive solar radiation, rain, snow, ice and dust. Use a superstructure or additional cover, for example.
- If required, contact the service center, or technically coordinate outdoors use.

### 4.5.2 Securing the rotor

Depending on the version, the machine is fitted with a rotor shipping brace. This protects the bearings against damage due to shock and vibration during transport or storage.

**NOTICE**

**Motor damage due to vibrations**


Not using the rotor shipping brace can cause damage to the machine if it is jolted during transport or storage. Material damage can result.

- If the machine is fitted with a rotor shipping brace, this should always be used when transporting the machine. The rotor shipping brace must be attached during the transport.
- Protect the motor against strong radial shocks and vibration when storing, as the rotor shipping brace cannot completely absorb these forces.
- Do not remove the rotor shipping brace until you are ready to push on the output element.
- If the customer already has mounted parts, such as a coupling or belt pulley, the bearings can be damaged during transport. In this case, make sure that the customer uses a rotor shipping brace.
- For machines with a vertical type of construction:
  - Do not remove the rotor shipping brace until the machine is in a vertical position.
  - If a machine has to be transported in a horizontal position, the rotor must be fixed in position before the machine is turned onto its side. Vertical machines can be supplied in the horizontal position from the manufacturing plant.



### Alternative rotor bracing

- If you transport the machine after the output element has been pulled on, then you must axially fix the rotor in another way.

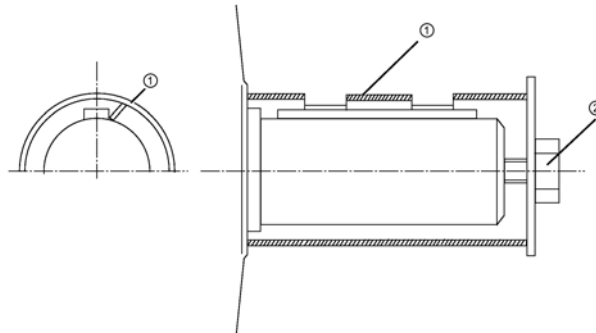

① Sleeve

② Shaft screw and washer

Figure 4-1 Axial fastening of the rotor

Thread in the shaft extension	Tightening torque
M16	40 Nm
M20	80 Nm
M24	150 Nm
M30	230 Nm

Tightening torques for other rotor shipping brace types

- The thread in the shaft extension indicates the rotor weight. This indirectly specifies the required preload force when axially fastening the rotor.

Thread in the shaft extension	Preload
M16	13 kN
M20	20 kN
M24	30 kN
M30	40 kN

Axial preload force for other rotor shipping brace types

### Store the rotor locking device

Be sure to store the rotor locking device. It must be remounted for possible disassembly and transport.

### 4.5.3 Commissioning after storage

#### 4.5.3.1 Insulation resistance and polarization index

Measuring the insulation resistance and polarization index (PI) provides information on the condition of the machine. It is therefore important to check the insulation resistance and the polarization index at the following times:

- Before starting up a machine for the first time
- After an extended period in storage or downtime
- Within the scope of maintenance work

The following information is provided regarding the state of the winding insulation:

- Is the winding head insulation conductively contaminated?
- Has the winding insulation absorbed moisture?

As such, you can determine whether the machine needs commissioning or any necessary measures such as cleaning and/or drying the winding:

- Can the machine be put into operation?
- Must the windings be cleaned or dried?

Detailed information on testing and the limit values can be found here:

"Testing the insulation resistance and polarization index" (Page 53)

#### 4.5.3.2 Lubricating the rolling bearings

If you correctly store the machine for a longer period of time, it can be assumed that within a period of two years, the grease in the bearings will not deteriorate.

- For motors with thermal class 155, for normal ambient temperatures, use a lithium-soap rolling bearing grease with a melting point of at least 180° C.
- For machines with thermal class 180, and for certain special machines, use the special grease specified on the machine lubricant plate.

#### 4.5.3.3 Regreasing rolling bearings after storage periods of up to two years

- For machines with regreasing systems, briefly lubricate both bearings after commissioning with the machine running as a precautionary measure.
- Grease type, grease quantity and relubrication intervals for the regreasing system are stamped on the rating plate attached to the machine.

#### 4.5.3.4 Releasing the rotor shipping brace before commissioning

If one is being used, release the rotor shipping brace before commissioning.

## 4.6 Ensure adequate cooling

** WARNING****Overheating and failure of the motor**

Death, severe injury or material damage can occur if you do not carefully observe the following points.

- Do not obstruct ventilation.
- Prevent the air expelled by neighboring equipment from being immediately sucked in again.
- For machines with a vertical type construction with air entry from above, prevent the ingress of foreign bodies and water in the air entry openings (standard IEC / EN 60079-0).
- If the shaft extension is facing upwards, liquid must be prevented from entering by moving along the shaft.











** WARNING****Damage caused by small parts falling in**

Material damage and injury can occur if the fan is destroyed and therefore the motor overheats.

- For types of construction with the shaft extension facing downwards, prevent small parts from falling into the fan cover by providing suitable covers (standard IEC / EN 60079-0).
- Ensure that the cooling air flow is not reduced as a result of covers and that the minimum air clearances are maintained.

4.6 Ensure adequate cooling

Table 4- 1 Air guidance

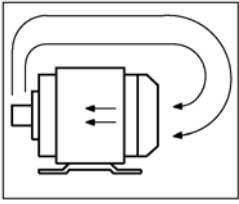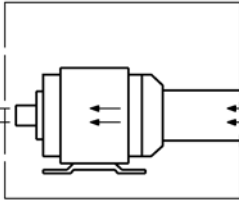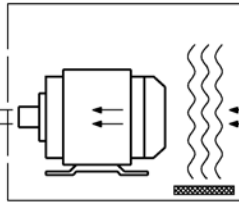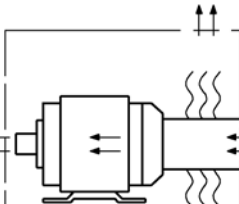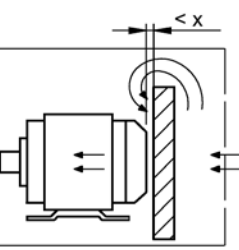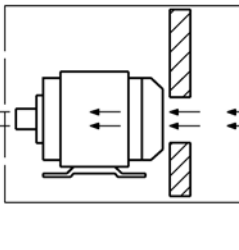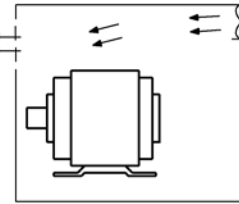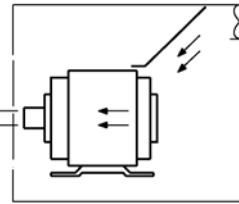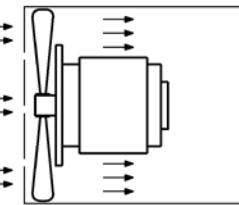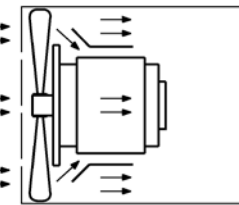Incorrect	Correct
	
	
	
	
	

Minimum dimension "x" for the distance between neighboring modules and the air intake of the machine

Table 4- 2 Minimum dimension "X" for the distance between adjacent modules and the air intake of the machine

Shaft height	X mm
63 ... 71	15
80 ... 100	20
112	25
132	30
160	40
180 ... 200	90
225 ... 250	100
280 ... 315	110
355	140

## 4.7 Thermal protection

Protect explosion-protected machines against overload according to IEC / EN 60079-14, Section "Rotating electrical machines".

Use a motor circuit breaker, directly monitor the winding temperature or use equipment to provide the same functionality corresponding to the explosion type of protection.

For pole-changing motors, in addition to the circuit breaker, use temperature sensors in the windings.

### Ex d and Ex t

Line supply

- Set the protective device (e.g. circuit breaker) to the rated current (see the rating plate).
- Or protect the machine using the certified temperature monitoring specified on the supplementary plate .

Converter

- Always operate explosion-protected machines fed from converters with temperature sensors that directly monitor the temperature.

### Ex e and Ex eb

Line supply

- Set the protective device (e.g. circuit breaker) to the rated current (see the rating plate),  $I_{LR}/I_{Rated}$  and the locked rotor time.
- Or protect the machine using the certified temperature monitoring specified on the supplementary plate.

Converter

- Always operate explosion-protected machines fed from converters with temperature sensors that directly monitor the temperature.
- Converter operation for these machines must be expressly certified. It is essential that you observe the specific manufacturer's information and instructions. Converter, machine and protective devices must be marked as belonging together and the permitted operating data must be defined in the common EC or EU-type examination certificate.

Ex n and Ex ec

Line supply

- Set the protective device (e.g. circuit breaker) to the rated current (see the rating plate).
- Or protect the machine using the certified temperature monitoring specified on the supplementary plate .

Converter

- Always operate explosion-protected machines fed from converters with temperature sensors that directly monitor the temperature.

## 4.8 Interlock circuit for anti-condensation heating


If the anti-condensation heating is operated while the machine is running, this can increase the temperatures inside the machine.

- Install an interlock circuit that switches off the anti-condensation heating once the main machine is switched on.
- Only switch on the anti-condensation heating after the machine has been switched off.

### See also

Switching on with the anti-condensation heating active (Page 103)

## 4.9 Noise emission

 <b>CAUTION</b>
<b>Hearing damage when operating three-phase motors</b>
If the permissible sound pressure level is exceeded, hearing damage can occur when operating three-phase motors at their rated power.
Observe the maximum permissible sound pressure level according to the ISO 1680 standard. The maximum permissible sound pressure level is 70 dB (A).

## 4.10 Voltage and frequency fluctuations during line operation

Unless stated otherwise on the rating plate, the permissible voltage/frequency fluctuation is corresponds to range B in IEC / EN 60034-1.

### Material damage due to excessively high winding temperature rise

Do not exceed the winding temperature tolerances. Inadmissibly high winding temperatures can damage the machine over the long term.

Keep within the permissible tolerance for voltage and frequency.

Every machine must be protected against an inadmissible temperature rise. Observe the following notes:

- Protect every machine according to IEC/EN 60079–14 using a current-dependent, delayed circuit breaker with phase failure protection according to IEC/EN 60947 or a similar device in all phases.
- Set the protective device to the rated current (value is stamped on the rating plate).
- Protect the windings in a delta connection in such a way that the tripping unit or relay is connected in series with the winding phases. When selecting and setting the tripping unit, define the rated value of the phase current. The phase current is 0.58 times the rated machine current. Any thermal machine protection via direct temperature monitoring to be used in addition to the machine circuit breaker is specified on the rating plate if required.

### See also

Thermal protection (Page 43)

## 4.11 Rotational speed limit values

### Danger as a result of resonance within certain speed ranges

At over-critical speeds, machines encounter resonance within certain speed ranges. Such vibrations can reach impermissibly high levels. This can result in death, serious injury or material damage.

- The controller must ensure that those speed ranges are blocked when the converter is in operation. Please note the data on the blocked speed ranges specified in the Electrical Data.
- The blocked speed ranges must be run through rapidly.

### Machine damage due to excessively high speeds

Excessive rotational speed can lead to serious damage to the machine. This can result in death, serious injury or material damage.

- Avoid operation above the permissible speed by using the appropriate control function.
- Observe the speeds stamped on the rating plate and in the Electrical Data.

## 4.12 System-inherent frequencies

Excessively high vibration levels and system resonances can damage the machine set.

- Configure and match the system consisting of the foundation and machine set in such a way that no system resonances can arise and result in the permissible vibration levels being exceeded.
- The vibration values according to DIN ISO 10816-3 must not be exceeded.

## 4.13 Electromagnetic compatibility

---

### Note

If the torque levels are very unequal (e.g. when a reciprocating compressor is being driven), a non-sinusoidal machine current will be induced whose harmonics can have an impermissible effect on the supply system and cause impermissible interference emissions as a result.

---

### Note

#### Converter

- If operated with a frequency converter, the emitted interference varies in strength, depending on the design of the converter (type, interference suppression measures, manufacturer).
  - Avoid that the specified limit values stipulated for the drive system (consisting of the motor and converter) are exceeded.
  - You must observe the EMC information from the manufacturer of the converter.
  - The most effective method of shielding is to conductively connect a shielded machine supply cable to the metal terminal box of the machine (with a metal screw connection) over a large surface area.
  - On machines with integrated sensors (e.g. PTC thermistors), disturbance voltages caused by the converter may occur on the sensor cable.
- 

When used in accordance with their intended purpose and operated on an electrical supply system with characteristics according to EN 50160, the enclosed machines comply with the requirements of the EC Directive concerning electromagnetic compatibility.

## Immunity to interference

The machines fulfill the requirements of interference immunity in conformity with EN / IEC 61000-6-2. If machines with integrated sensors (e.g. PTC thermistors) are used, the operating company must ensure sufficient interference immunity by selecting a suitable sensor signal lead (possibly with shielding, connected in the same way as the machine feeder cable) and a suitable evaluation unit.

When operating the machines from a converter at speeds higher than the rated speed, then the mechanical speed limits must be carefully observed (safe operating speed EN / IEC 60034-1).



## 4.14 Converter operation

### 4.14.1 Parameterizing the converter

- If the design of the motor requires connection to a particular converter type, the rating plate will contain corresponding additional information.
- Correctly parameterize the converter. Parameterizing data can be taken from the machine rating plates.  
You can find parameter data here:
  - In the operating instructions for the converter.
  - In the SIZER engineering tool
  - In the SINAMICS Configuration Manuals.
  - For explosion-protected machines, also in the declaration of compliance with the order 2.1.
- Do not exceed the specified maximum speed limit  $n_{\max}$ . You can either find this on the rating plate  $n_{\max}$  or on the supplementary plate for converter operation as the highest speed.
- Check that the machine is cooled sufficiently for commissioning purposes.

### 4.14.2 Converter input voltage

The insulation system of SIMOTICS machines significantly exceeds the requirements of stress category C (IVIC C = high stress). If voltage peaks higher than those specified according to IVIC C can occur, then observe the data in the respective Catalog ([http://w3app.siemens.com/mcms/infocenter/content/en/Pages/order\\_form.aspx](http://w3app.siemens.com/mcms/infocenter/content/en/Pages/order_form.aspx)):

- For a line voltage (converter input voltage) up to max. 480 V and operation connected to a SINAMICS G / SINAMICS S converter with uncontrolled/controlled infeed: Comply with the guidelines for configuring motor and converter.
- For line voltages (converter input voltages) higher than 480 V, motors, which are ordered for converter operation, have an appropriate insulation system.
- Operation with a converter from another manufacturer: Comply with the permissible voltage peaks according to IEC 60034-18-41 in accordance with stress category C, dependent on the particular line voltage (converter input voltage) and the motor insulation system.

#### NOTICE

##### Material damage caused by an excessively high supply voltage

The insulation system will be damaged if the supply voltage is too high for the insulation system. This can completely destroy the machine.

- Comply with the peak voltages as laid down in the guidelines above.

### 4.14.3 Reducing bearing currents for converter operation

Taking the following actions will reduce the bearing currents:

- Ensure that the contacts are made over a large area. Solid copper cables are not suitable for high-frequency grounding because of the skin effect.

Equipotential bonding conductors:


Use equipotential bonding conductors:

- between motor and driven machine
- between motor and converter
- between the terminal box and the RF grounding point at the motor enclosure.

Selecting and connecting the cable:

As far as possible, use symmetrically arranged, shielded connection cables. The cable shielding, made up of as many strands as possible, must have good electrical conductivity. Braided shields made of copper or aluminum are very suitable.

- The shield is connected at both ends, at the motor and converter.
- To ensure good discharging of high-frequency currents, provide contacting over a large surface area:
  - as contact established through 360° at the converter
  - at the motor, for instance with EMC glands at the cable entries.
- If the cable shield is connected as described, then it ensures the specified equipotential bonding between the motor enclosure and converter. A separate RF equipotential bonding conductor is then not necessary.

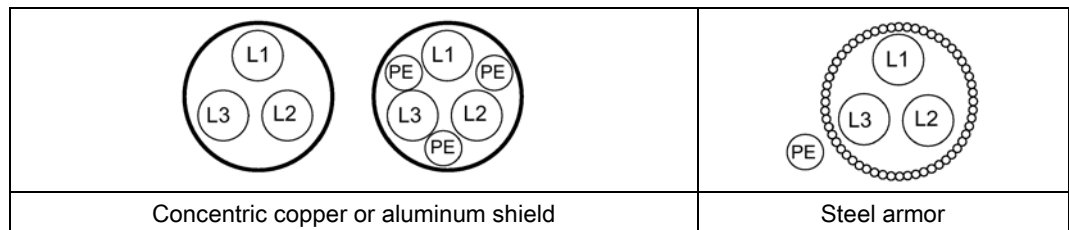

- If the cable shield is not connected due to special secondary conditions, or not adequately connected, then the specified equipotential bonding is not provided. In this particular case, use a separate RF equipotential bonding conductor:
  - Between the motor enclosure and protective ground rail of the converter.
  - Between motor enclosure and driven machine
  - Use braided flat copper straps or high-frequency cables with finely-stranded conductors for the separate RF equipotential bonding cable.
  - Ensure that the contacts are made over a large area.

## Measures to reduce bearing currents

To specifically reduce bearing currents, you must consider the system as a whole, which comprises the motor, converter, and driven machine. The following measures support you when reducing bearing currents and help to avoid damage:

- In the overall system, set up a properly meshed grounding system with low impedance.
- Use the common-mode filter (damping cores) at the converter output. The Siemens sales representative is responsible for selection and dimensioning.
- Limit the rise in voltage by using output filters. Output filters dampen the harmonic content in the output voltage.
- The operating instructions for the converter are not part of this documentation. Refer to the configuration information for the converter.

### 4.14.4 Insulated bearings when operated with a converter

If the machine is operated from a low-voltage converter, insulated bearings are fitted at the NDE and an insulated encoder with insulated bearings (option).

Comply with the plates on the machine relating to bearing insulation and possible bridges.

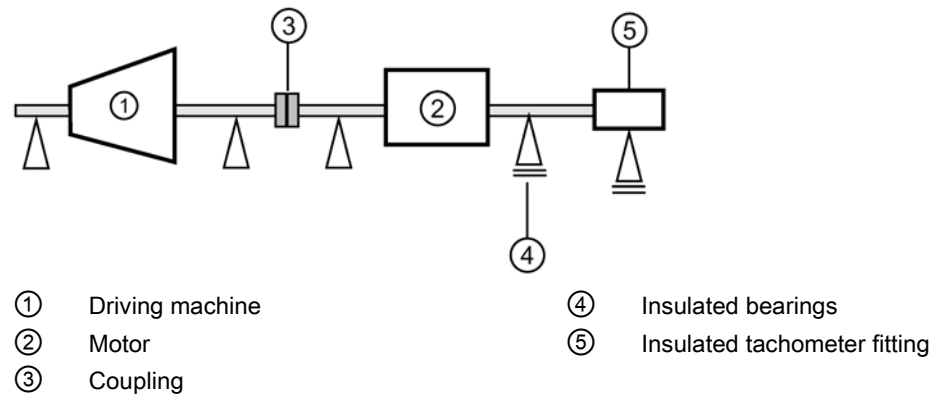


Figure 4-2 Schematic representation of a single drive

#### NOTICE

##### Bearing damage

The bearing insulation must not be bridged. Bearing currents can damage bearings.

- Also for subsequent installation work, such as the installation of an automatic lubrication system or a non-insulated vibration sensor, make sure that the bearing insulation cannot be bridged.
- Please contact the service center if necessary.

### Tandem operation

If you connect two motors in series in "tandem operation", install an insulated coupling between the motors.

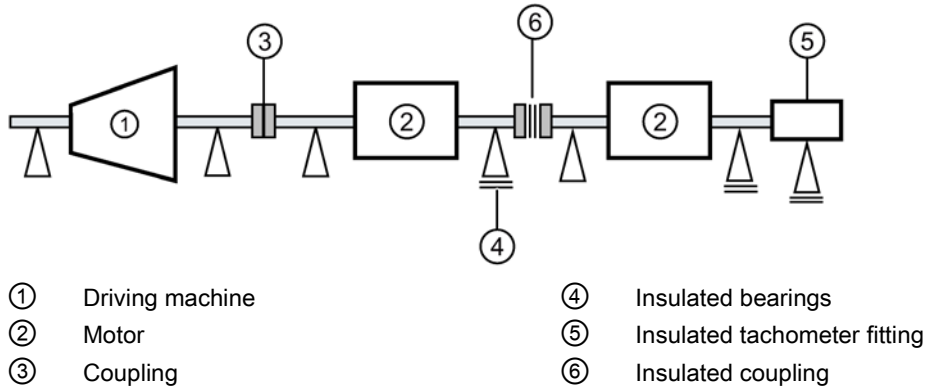


Figure 4-3 Schematic representation of a tandem drive

#### NOTICE

##### Bearing damage

Bearing currents can flow if the coupling between the motors of the tandem drive is not insulated. This can damage the DE bearings of both motors.

- Use an insulated coupling to link the motors.

### 4.14.5 Tandem operation

If you connect two motors in series in "tandem operation", locate a coupling between the motors; this coupling should satisfy the Directive 2014/34/EU or the regulations that apply in the country where the equipment is installed.

### 4.14.6 Speed limits for converter operation

Observe the information on the rating plate regarding the speed limits for converter operation.

# Assembly

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.

## Loss of conformity with European directives

In the delivery state, the machine corresponds to the requirements of the European directives. Unauthorized changes or modifications to the machine lead to the loss of conformity with European directives and the loss of warranty.

## Explosion hazard when making modifications to the machine

Substantial modifications to the machine are not permitted – or may only be performed by the manufacturer. Otherwise an explosion can occur in an explosive atmosphere. This can result in death, serious injury or material damage.

- If necessary, please contact the service center.

## 5.1 Preparing for installation

### 5.1.1 Requirements for installation

The following requirements must be satisfied prior to starting installation work:

- Staff have access to the operating and installation instructions.
- The machine is unpacked and ready for mounting at the installation location.

---

#### Note

#### Measure the insulation resistance of the winding before starting installation work

Measure the insulation resistance of the winding before starting any installation work. If the insulation resistance lies below the specified value, take appropriate remedial measures. These remedial measures may necessitate the machine being removed again and transported.

---

---

**Note**

Note also the technical data on the rating plates on the motor enclosure.

---

**NOTICE**

**Damage to the motor**

To avoid material damage, before commissioning, check whether the correct direction of rotation of the machine has been set on the customer side, e.g. by decoupling from the driven load.

### Damage to mounted parts and components as a result of high temperatures

The motor components get very hot during operation. High temperatures can damage parts mounted by customers, such as cables manufactured out of materials that are not heat resistant.

- Temperature-sensitive parts must not come in contact with or be attached to components mounted on the machine.
- Only use heat-resistant mounting parts. The connecting cables and cable entries must be suitable for the particular application.

## 5.1.2 Insulation resistance

### 5.1.2.1 Insulation resistance and polarization index

Measuring the insulation resistance and polarization index (PI) provides information on the condition of the machine. It is therefore important to check the insulation resistance and the polarization index at the following times:

- Before starting up a machine for the first time
- After an extended period in storage or downtime
- Within the scope of maintenance work

The following information is provided regarding the state of the winding insulation:

- Is the winding head insulation conductively contaminated?
- Has the winding insulation absorbed moisture?

As such, you can determine whether the machine needs commissioning or any necessary measures such as cleaning and/or drying the winding:

- Can the machine be put into operation?
- Must the windings be cleaned or dried?

Detailed information on testing and the limit values can be found here:

"Testing the insulation resistance and polarization index" (Page 53)

### 5.1.2.2 Testing the insulation resistance and polarization index



	<p><b>! WARNING</b></p> <p><b>Hazardous voltage at the terminals</b></p> <p>During and immediately after measuring the insulation resistance or the polarization index (PI) of the stator winding, hazardous voltages may be present at some of the terminals. Contact with these can result in death, serious injury or material damage.</p> <ul style="list-style-type: none"> <li>• If any power cables are connected, check to make sure line supply voltage cannot be delivered.</li> <li>• Discharge the winding after measurement until the risk is eliminated, e.g. using the following measures:             <ul style="list-style-type: none"> <li>– Connect the terminals with the ground potential until the recharge voltage drops to a non-hazardous level</li> <li>– Attach the connection cable.</li> </ul> </li> </ul>
--	---

#### Measure the insulation resistance

1. Before you begin measuring the insulation resistance, please read the operating manual for the insulation resistance meter you are going to use.
2. Short-circuit the ends of the temperature sensor cables before applying the test voltage. If the test voltage is connected to only one temperature sensor terminal, the temperature sensor will be destroyed.
3. Make sure that no power cables are connected.
4. Measure the winding temperature and the insulation resistance of the winding in relation to the machine enclosure. The winding temperature should not exceed 40° C during the measurement. Convert the measured insulation resistances in accordance with the formula to the reference temperature of 40° C. This thereby ensures that the minimum values specified can be compared.
5. Read out the insulation resistance one minute after applying the measuring voltage.

#### Limit values for the stator winding insulation resistance

The following table specifies the measuring voltage and limit values for the insulation resistance. These values correspond to IEEE 43-2000 recommendations.

Table 5- 1 Stator winding insulation resistance at 40° C

$U_N$ V	$U_{meas}$ V	$R_C$ MΩ
$U \leq 1000$	500	$\geq 5$
$1000 \leq U \leq 2500$	500 (max. 1000)	100
$2500 < U \leq 5000$	1000 (max. 2500)	
$5000 < U \leq 12000$	2500 (max. 5000)	
$U > 12000$	5000 (max. 10000)	

$U_{rated}$  = rated voltage, see the rating plate

$U_{meas}$  = DC measuring voltage

$R_C$  = minimum insulation resistance at a reference temperature of 40 °C

**Conversion to the reference temperature**

When measuring with winding temperatures other than 40° C, convert the measuring value to the reference temperature of 40° C according to the following equations from IEEE 43-2000.

(1) $R_C = K_T \cdot R_T$	$R_C$	Insulation resistance converted to 40° C reference temperature
	$K_T$	Temperature coefficient according to equation (2)
	$R_T$	Measured insulation resistance for measuring/winding temperature $T$ in °C
(2) $K_T = (0.5)^{(40-T)/10}$	40	Reference temperature in °C
	10	Halving/doubling of the insulation resistance with 10 K
	$T$	Measuring/winding temperature in °C

In this case, doubling or halving the insulation resistance at a temperature change of 10 K is used as the basis.

- The insulation resistance halves every time the temperature rises by 10 K.
- The resistance doubles every time the temperature falls by 10 K.

For a winding temperature of approx. 25° C, the minimum insulation resistances are 20 MΩ ( $U \leq 1000$  V) or 300 MΩ ( $U > 1000$  V). The values apply for the complete winding to ground. Twice the minimum values apply to the measurement of individual assemblies.

- Dry, new windings have an insulation resistance of between 100 and 2000 MΩ, or possibly even higher values. An insulation resistance value close to the minimum value could be due to moisture and/or dirt accumulation. The size of the winding, the rated voltage and other characteristics affect the insulation resistance and may need to be taken into account when determining measures.
- Over its operating lifetime, the motor winding insulation resistance can drop due to ambient and operational influences. Calculate the critical insulation resistance value depending on the rated voltage by multiplying the rated voltage (kV) by the specific critical resistance value. Convert the value for the current winding temperature at the time of measurement, see above table.

**Measuring the polarization index**

1. To determine the polarization index, measure the insulation resistances after one minute and ten minutes.
2. Express the measured values as a ratio:

$$PI = R_{\text{insul 10 min}} / R_{\text{insul 1 min}}$$

Many measuring devices display these values automatically following the measurement.

For insulation resistances > 5000 MΩ, the measurement of the PI is no longer meaningful and consequently not included in the assessment.

$R_{(10 \text{ min})} / R_{(1 \text{ min})}$	Assessment
$\geq 2$	Insulation in good condition
$< 2$	Dependent on the complete diagnosis of the insulation



**NOTICE****Damage to insulation**

If the critical insulation resistance is reached or undershot, this can damage the insulation and cause voltage flashovers.

- Contact the service center (Page 163).
- If the measured value is close to the critical value, you must subsequently check the insulation resistance at shorter intervals.

**Limit values of the anti-condensation heating insulation resistance**

The insulation resistance of the anti-condensation heating with respect to the machine housing should not be lower than 1 MΩ when measured at 500 V DC.

## 5.2 Mounting and installed the machine

### 5.2.1 Preparing the assembly area

1. Prepare a suitable assembly area (e.g. assembly stands). Make sure that the assembly area has sufficient clearance from the floor for the DE shaft end. The necessary data is provided in the machine dimension drawing.
2. Refer to the shipping documents to check that all motor components are available for assembly.
  - For vertical installation, use all of the eyebolts provided and when necessary, hoisting straps (DIN EN 1492-1) and/or lashing straps (DIN EN 12195-2) to stabilize the position of the motor.
  - Prevent foreign bodies from falling into the fan cover. For vertical machine installation with the shaft end facing downwards, attach a protective canopy.
  - If the shaft extension is facing upwards, the user must prevent liquid from moving along the shaft and entering the motor.
  - Clean bare metal surfaces with anti-corrosion agent using white spirit to ensure proper installation and / or machine mounting.
  - Do not obstruct the ventilation! Do not draw in the discharged air directly – also from adjacent equipment.
  - Avoid exposing them to direct, intense solar radiation, rain, snow, ice, or also dust for extended periods. Attach a covering structure or an additional cover when using or storing outdoors.
  - Do not exceed the permissible axial and radial forces.
  - Only use explosion-protected machines in appropriate areas in accordance with directive 1999/92/EC.


If the certification is supplemented by an X, please note the special conditions in the EC type examination certificate. Special conditions for explosion-proof machines (Page 17)

- When installing electrical systems in hazardous zones, observe EN/IEC 60079-14 and the corresponding country regulations.
- The machine temperature class specified on the rating plate must be equal to or greater than the temperature class of any combustible gases that may develop.
- Select optional mounted equipment according to the requirements of Directive 2014/34/EU.

### 5.2.2 Balancing


The rotor is dynamically balanced. For shaft extensions with feather keys, the balancing type is specified using the following coding on the face of the drive end of the shaft:

- "H" means balancing with a half feather key (standard)
- "F" means balancing with a whole feather key
- "N" means balancing without a featherkey.

 <b>CAUTION</b>
<b>Risk of injury due to Incorrect installation or removal</b>
If the required touch protection measures for drive output elements are not observed this can result in physical injury and material damage.
<ul style="list-style-type: none"><li>• The general touch protection measures for drive output elements must be observed.</li><li>• Drive output elements may only be pushed on or pulled off with the correct equipment.</li><li>• The feather keys are only locked against falling out during shipping. If you commission a machine without a drive output element, the feather keys must be secured to prevent them from being thrown out.</li></ul>


The featherkey data on the shaft and transmission element must indicate the correct type of balancing in each case and must be correctly mounted.

The balancing quality corresponds to vibration severity grade "A" for the complete machine; vibration severity grade "B" is possible as an option, i.e. in order to ensure the desired balancing quality, it must be ensured that the featherkey data on the hub and machine shaft complement each other in the case of a shorter or longer output transmission element.

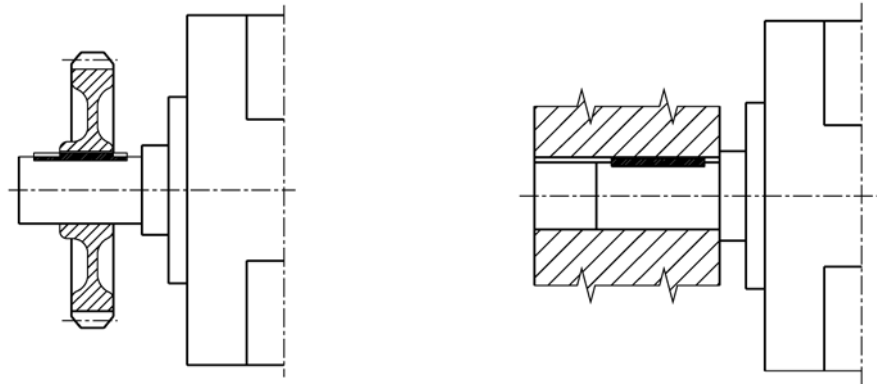


Align the offset at the coupling between electrical machines and the driven machines so that the maximum permissible vibration values according to ISO 10816-3 are not exceeded.

### 5.2.2.1 Mounting and withdrawing output transmission elements

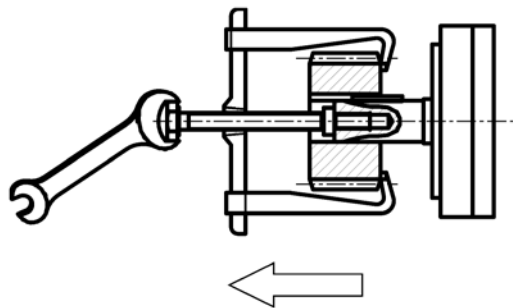

Withdrawing output transmission elements

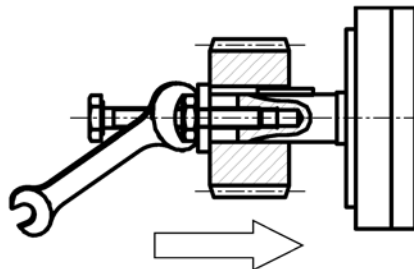

Mounting output transmission elements

- When mounting output transmission elements (coupling, gear wheel, belt pulley etc. ) use the thread at the shaft end.  
If possible, heat up the output transmission elements as required.
- Use a suitable device when withdrawing output elements.

- When mounting or withdrawing, do not apply any blows, for example with a hammer or similar tool, to the parts to be mounted or withdrawn.
- Only transfer radial or axial forces specified in the catalog to the motor bearings via the shaft extension.

### 5.2.3 Machines with type of construction IM B15, IM B9, IM V8 and IM V9

#### Types of construction without bearings on the drive side

These machines do not have their own bearing system for the machine shaft at the drive end (DE). The machine shaft is accepted by the (hollow) shaft or coupling of the system or driven machine.

- Using the centering edge, the machine is aligned with respect to enclosures, flanges or driven machines.
- Note that the temperature of the motor and motor shaft increases during operation. The thermal expansion of the machine shaft must be compensated by the customer by applying suitable measures.

Use the spring washers provided to locate the NDE bearing without any play.

<b>NOTICE</b>
<b>Damage to the motor</b>
Material damage can occur if the following notes are not carefully observed:
<ul style="list-style-type: none"><li>• The IM B3 bearing shield with integrated distance ring mounted at the drive end (DE) is only used transport lock. A warning label is attached to this bearing shield.</li><li>• The spacer ring is not a roller bearing.</li><li>• Remove the bearing shield and the spacer ring.</li><li>• Remove the transport lock before commissioning.</li></ul>



### 5.2.4 Foot mounting

---

#### Note

Only authorized retrofit partners must be employed to relocate the bolted on mounting feet at the machine enclosure.

---

After attaching the mounting feet, you must note the following in order to avoid stressing and deforming the machine.

- Ensure that the foot mounting surfaces are aligned in one plane and are parallel to the machine shaft.
- Post-machine the foot mounting surfaces or use thin shims, for example.
- Professionally touch up damaged painted surfaces.
- Observe the information provided in Chapter Aligning and mounting (Page 59)

## 5.3 Alignment and fastening

Observe the following when aligning and mounting:

- Ensure a flat and uniform contact surface for foot and flange mounting.
- When mounting on the wall, support the machine from below, e.g. using a bracket, or bolt it.
- Precisely align the machine when couplings are used.
- Ensure that the mounting surfaces are clean and free of any dirt.
- Remove any anti-corrosion protection using white spirit.
- Avoid installation-related resonances with the rotating frequency and twice the line frequency.
- Note any unusual noise when the rotor is manually turned.
- Check the direction of rotation with the motor uncoupled.
- Avoid rigid couplings.
- Repair any damage to the paint, this must be done immediately and correctly.

### 5.3.1 Repainting/touching up the paint finish of explosion-protected machines

---

#### Note

#### Repainting/touching up the paint finish of explosion-protected machines

For explosion-protected machines, observe the information in Chapter Repainting/touching up (Page 122).

---

### 5.3.2 Measures for alignment and mounting

The following measures are required in order to compensate any radial offset at the coupling and to horizontally adjust the electrical machine with respect to the driven load:

- **Vertical positioning**  
For vertical mounting positions, avoid deforming the machines by placing shims under the mounting feet. Keep the number of shims low; only use a few stacked shims.
- **Horizontal positioning**  
To position the machine horizontally, shift it sideways on the foundation and ensure that the axial position is maintained (angularity error).
- When positioning the motor, ensure that a uniform axial gap is maintained around the coupling.
- **Smooth running**

Preconditions for smooth, vibration-free operation:

- Stable foundation design free of any shock or vibration.
- A precisely aligned coupling.
- A well-balanced drive output element (coupling, belt pulleys, fans, ...)

Maintain the maximum permissible vibration values in operation according to ISO 10816-3.

Avoid inadmissible vibration caused by imbalance, for example (drive output element), external vibration or any resonance over the complete speed range.

It may be necessary to completely balance the machine with the drive output element or the system resonance frequency must be shifted.

- **Foot mounting/flange mounting**
  - Use the specified thread size laid down in EN 50347 when flanging the machine to a foundation or a machine flange.
  - Mount the machine at all the foot or flanged holes provided. The choice of fixing elements depends on the foundation and is the plant operator's responsibility. Comply with the required property classes for screwed connections and materials for fixing elements.
  - Select the correct screw length for IM B14 flanges.
  - Ensure that the screw heads are in full contact with the flange surface. Use additional flat washers (ISO 7093), especially for elongated foot mounting holes.

### 5.3.3 Flatness of the supporting surfaces for conventional motors

Shaft height	Flatness [mm]
≤ 132	0.10
160	0.15
≥ 180	0.20

### 5.3.4 Machine frame mounting feet (special design)

Please note that when the terminal box is mounted at the NDE (option H08), dimension C can deviate from EN 50347.

To comply with dimension C according to EN 50347, for machines with double or triple holes at the NDE, use the appropriate screw bore.

## 5.4 Installing the machine

### 5.4.1 Preconditions for smooth, vibration-free operation

Preconditions for smooth, vibration-free operation:

- Stable foundation design
- Precise alignment of the machine
- Correct balancing of parts to be fitted to the shaft end.
- Vibration values in compliance with ISO 10816-3

### 5.4.2 Aligning the machine to the driven machine and mounting

#### 5.4.2.1 Selecting bolts

- Unless specified otherwise, use fixing screws with at least strength class 8.8 to ISO 898-1 to ensure that the machine is securely mounted and to transmit the torque-generated forces.
- When selecting the bolts and the design of the foundation, take into account the maximum forces occurring in the case of a fault such as short circuit or system transfers in phase opposition, etc.

Request the foundation force values from the Service Center if required.

#### 5.4.2.2 Horizontal types of construction with mounting feet

1. Refer to any instructions for aligning the driven machine and those of the coupling manufacturer.
2. Align the machines with coupling output to the driven machine in such a manner that the center lines of the shafts are parallel with no offset. This ensures that no additional forces affect their bearings during operation.
3. For the vertical positioning ( $x \rightarrow 0$ ) place thin shims under the machine feet. The number of shims should be kept as low as possible, i.e. stack as few as possible. This also prevents the machine being subjected to any stress/distortion. If available, use the existing tapped holes for the forcing-off bolts to somewhat raise the machine.

4. When positioning the machine, ensure that a uniform axial gap ( $y \rightarrow 0$ ) is maintained around the coupling.
5. Fix the machine to the foundation. The choice of fixing elements depends on the foundation and is the plant operator's responsibility.

---

**Note**

**Machine expansion**

When aligning, make allowance for the thermal expansion of the machine when the temperature increases.

---

#### 5.4.2.3 Horizontal types of construction with flange

The standard flange is provided with a centering. The choice of fit for the mating flange on the driven machine is the system manufacturer's or the plant operator's responsibility.

If the machine is not fitted with a standard flange, align the machine to suit the driven machine.

#### Procedure

The machine axis must be horizontal when it is lifted and the flange must be parallel to the mating flange, so as to avoid seizing and stressing. Otherwise damage to the centering will result.

1. Grease the centering flange with assembly paste to make the process easier.
2. Screw three studs into tapped holes spaced about 120° apart around the driven machine flange. The studs act as positioning aids.
3. Position the machine so that its axis is aligned with that of the driven machine, but not yet quite touching. Advance the machine slowly towards the driven machine; advancing too quickly risks damaging the centering.
4. If necessary, rotate the machine into the right position so that the clearance holes in the flange are central to the tapped holes.
5. Move the machine fully up against the mating flange so that it is fully in contact.
6. Fix the machine using the flange fixing bolts, finishing by replacing the studs.

#### 5.4.2.4 Vertical types of construction with flange

The standard flange is provided with a centering. The choice of fit for the mating flange on the driven machine is the system manufacturer's or the plant operator's responsibility.

If the machine is not fitted with a standard flange, align the machine to suit the driven machine.



**Procedure**

The machine axis must be vertical when it is lifted and the flange must be parallel to the mating flange, so as to avoid seizing and stressing. Otherwise damage to the centering will result.

1. Grease the centering flange with assembly paste to make the process easier.
2. Screw in two studs into tapped holes on opposite sides of the driven machine flange. The studs act as positioning aids.
3. Lower the machine slowly toward the driven machine and into the centering, so that the flanges do not quite touch. Lowering too quickly risks damaging the centering.
4. If necessary, rotate the machine into the right position so that the clearance holes in the flange are central to the tapped holes.
5. Lower the machine completely onto the mating flange so that it is fully in contact; then remove the studs.
6. Fix the machine using the flange fixing bolts.

**5.4.3 Removing the rotor shipping brace**

If a rotor shipping brace is attached to the machine, remove it at the last possible moment, for example, when you are ready to push on the output or drive element.

**Store the rotor locking device**

Be sure to store the rotor locking device. It must be remounted for possible disassembly and transport.

Details about the alignment accuracy can be found in the Section "Information about the machine dimension drawing".

**5.4.4 Recommended alignment accuracy**

The alignment accuracy required depends essentially on the configuration of the overall machine train. Observe the required alignment accuracy of the coupling manufacturer in all cases when aligning the machine.

Table 5- 2 Recommended alignment accuracy

Speed rpm	Parallel offset mm	Angular offset mm per 100 mm coupling diameter
750	0.09	0.09
1500	0.06	0.05
3000	0.03	0.025

To avoid stressing the motor feet, the overall flatness of the installation surfaces must satisfy the values in the following table:

Table 5-3 Overall flatness of the installation surfaces

Shaft height	Overall flatness of the installation surfaces
≤ 080	0.1 mm
090 - 355	0.2 mm
≥ 400	0.3 mm

If shims are necessary for height adjustment and to avoid stresses, make them out of adequately sized pieces of flat rolled strip. Complete balancing of the rotor together with the transmission element may be found necessary.

### 5.4.5 Mounting the output elements

#### Balance quality

The rotor is dynamically balanced. For shaft ends with feather keys, the balancing type is specified using the following coding on the rating plate:

- "H" means balancing with a half feather key
- "F" means balancing with a whole feather key
- "N" means balancing without a featherkey.

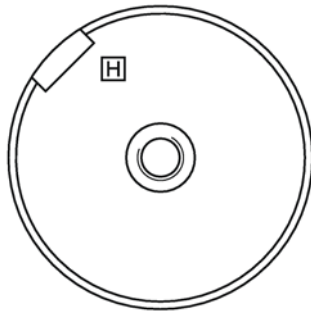


Figure 5-1 Balancing type on the drive-end side

## Pushing on the power output elements

- Requirements:
  - The coupling and/or the output element must be appropriately dimensioned for the operating case at hand.
  - Comply with the coupling manufacturer's instructions.
  - Make sure that the balancing type of the transmission element correctly matches the type of balance of the rotor.
  - Use only ready drilled and balanced transmission elements. Check the hole diameters and the balancing status before pulling them on. Thoroughly clean the shaft extension.
- Pulling on:
  - Warm up the drive output elements to expand them before pulling them on. Select the temperature difference for the heating process to suit the coupling diameter, fit and material. See the coupling manufacturer's instructions.
  - Power output elements may only be pushed on or pulled off with the correct equipment. The transmission element must be pulled on in one continuous operation via the front thread holes in the shaft or pushed on by hand.
  - Do not use a hammer, as this will damage the bearings.

## Shaft extensions with feather key

To maintain the balancing quality, you have the following options:

- If the transmission element is shorter than the feather key with balancing type "H", then you must machine off the section of feather key protruding from the shaft contour and transmission element in order to maintain the balance quality.
- If the transmission element is drawn up on to the shoulder of the shaft, you must ensure that the part of the coupling groove where the feather key is not inserted is taken into consideration when balancing the coupling.

The following applies to all four-pole machines with a frequency  $\geq 60$  Hz:

- The feather key must be shortened if the coupling hub is shorter than the feather key.
- The center of gravity of the coupling half should be within the length of the shaft end.
- The coupling used must be prepared for system balancing.

## Danger as a result of a feather key being flung out

Rotating parts are dangerous. The feather keys are only locked against falling out during shipping. If a machine with 2 shaft extensions does not have an output element on one shaft extension, the feather key can be flung out during operation. Rotating parts can result in death, serious injury or material damage.

- Do not operate the machine unless the transmission elements have been pulled on.
- On shaft extensions without drive output element, take suitable measures to ensure that the feather key cannot be flung out. For balancing type "H", shorten the feather key by about half.

### 5.4.6 Axial and radial forces

You can obtain the permissible values for axial and radial forces by contacting the Service Center or referring to the machine catalog.



#### **WARNING**

##### **Damage to bearings or the shaft**

Large output masses and their centers of gravity outside the shaft extensions can lead to resonance in operation. This can result in damage to the bearings and shaft. In an explosive atmosphere, there is a risk of explosion. Death, serious injury, or material damage can result.

- Ensure that the permissible loads for the forces on the shaft extension are adhered to in accordance with the catalog data or configuration data.

## Electrical connection

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.

---

### Note

#### Service Center

If you require support when electrically connecting up the machine, please contact the Service Center.

---

### Risk of explosion by fixing elements becoming loose

If you use fixing elements made from the wrong material or apply the wrong tightening torque, this could impair current transfer or cause connecting parts to become loose. Fastening elements can work loosely, so that the minimum air clearances are no longer maintained. Sparking formation may occur, in an explosive atmosphere it can lead to an explosion. This could result in death, serious injury or material damage to the machine or even in failure, which could in turn lead indirectly to material failure of the system.

- Tighten the screwed connections to the specified tightening torques.
- Observe any specifications regarding the materials from which fixing elements must be made.
- When performing servicing, check the fastenings.

## 6.1 Preparation

### 6.1.1 Selecting cables


Take the following criteria into account when selecting the connecting cables:

- Rated current
- Rated voltage
- If required, service factor
- System-dependent conditions, such as ambient temperature, routing type, cable cross-section as defined by required length of cable, etc.

- Configuration notes
- Requirements according to IEC/EN 60204-1
- Dimensioning for bundled cable routing, e.g. according to DIN VDE 0298 Part 4 or IEC 60364-5-52

## 6.2 Connecting the machine



 <b>DANGER</b>
<b>Hazardous voltages</b> Death, injury or material damage can occur. Note the following safety information before connecting-up the machine: <ul style="list-style-type: none"><li>• Only qualified and trained personnel should carry out work on the machine while it is stationary.</li><li>• Disconnect the machine from the power supply and take measures to prevent it being reconnected. This also applies to auxiliary circuits.</li><li>• Check that the machine really is in a no-voltage condition.</li><li>• Establish a safe protective conductor connection before starting any work.</li><li>• If the incoming power supply system displays any deviations from the rated values in terms of voltage, frequency, curve form or symmetry, such deviations will increase the temperature and influence electromagnetic compatibility.</li><li>• Operating the machine on a line supply system with a non-grounded neutral point is only permitted over short time intervals that occur rarely, e.g. the time leading to a fault being eliminated (ground fault of a cable, EN 60034-1).</li></ul>

Observe the information in EN / IEC 60034-1 (VDE 0530-1) regarding operation at the limits of the A zones ( $\pm 5\%$  voltage difference and  $\pm 2\%$  frequency difference) and the B zones, especially in respect of temperature increase and deviation of the operating data from the rated data on the rating plate. Never exceed the specified limits!

Connect up so that a permanently safe electrical connection is guaranteed (no protruding wire ends); use the assigned cable-end fittings (e.g. cable lugs, end sleeves). Connect up the line supply voltage and arranged the disconnecting link in accordance with the circuit diagram provided in the terminal box.

Select the connecting cables in accordance with DIN VDE 0100 and in accordance with the rated current and the installation-specific conditions (e.g. ambient temperature, routing method etc. according to DIN VDE 0298 and/or EN / IEC 60204-1).

The technical specifications stipulate the following that have to be taken into account with respect to the motor connection:

- Direction of rotation.
- The number and arrangement of the terminal boxes.
- The circuit and connection of the machine winding.

All cable entries and sealing plugs must be approved for use in the respective hazardous zone.

- Any openings that are not being used must be sealed using the appropriate certified sealing plugs.
- Please observe the manufacturer's specifications when fitting cable entries.

The following features make this type of electrical connection different from that for standard machines:

- For machines marked with Zone A, maintain area A in EN / IEC 60034-1 (VDE 0530-1) ( $\pm 5\%$  voltage or  $\pm 2\%$  frequency deviation, waveform, line supply symmetry) so that the temperature rise remains within the permissible limits.
- Larger deviations from the rated data may result in electrical machines heating up to impermissible levels. This information must be specified on the rating plate. Under no circumstances exceed the limits!
- Protect every explosion-protected machine according to EN / IEC 60079-14 Chapter "Rotating electrical machines".
- For machines with type of protection increased safety "eb", select the overcurrent device with current-dependent delayed trip so that the tripping time, which should be taken from the characteristic of the switch for the ratio  $I_A / I_N$  of the machine to be protected, is not longer than the safe locked rotor time  $t_E$ . Take the ratio  $I_A / I_N$  as well as the safe-locked rotor time  $t_E$  from the rating plate. Set the protective device to the rated current. Use a tripping unit certified according to directive 2014/34/EU.
- For machines with increased safety "eb" type of protection, in the event of a locked rotor the protective device must disconnect within the safe locked rotor time ( $t_E$  time) specified for the relevant temperature class. Protect electric machines used for heavy duty starting (acceleration time  $> 1.7 \times t_E$  time - locked rotor time) by monitoring the starting process using suitable equipment corresponding to the data provided in the EC or EU type examination certificate.  
Direct monitoring of the winding temperature is permissible as a means of thermal machine protection, provided that this is certified and specified on the rating plate.
- With pole-changing machines, separate, interlocked protective devices are required for each speed step. Equipment with EC or EU type examination certificate are recommended.

## See also

Thermal protection (Page 43)

6.2.1 Terminal box



<p><b>⚠ DANGER</b></p> <p><b>Hazardous voltage</b></p> <p>Electric motors have high voltages. When incorrectly handled, this can result in death or severe injury.</p> <p>Switch off the machine so that it is in a no-voltage condition before you open the terminal box.</p>
--

<p><b>NOTICE</b></p> <p><b>Damage to the terminal box</b></p> <p>If you incorrectly carry out work on or in the terminal box, this can result in material damage. You must observe the following to avoid damaging the terminal box:</p> <ul style="list-style-type: none"> <li>• Ensure that the components inside the terminal box are not damaged.</li> <li>• It must be ensured that there are no foreign bodies, dirt or moisture in the terminal box.</li> <li>• Close the terminal box using the original seal so that it is dust tight and water tight.</li> <li>• Use O-rings or suitable flat gaskets to seal entries in the terminal box (DIN 42925) and other open entries.</li> <li>• Please observe the tightening torques for cable entries and other screws.</li> </ul>
---

See also

Tightening torques for screw and bolt connections (Page 165)

6.2.1.1 Terminal marking

According to IEC / EN 60034-8, the following basic definitions apply to the terminal markings for 3-phase machines:

Table 6- 1 Terminal markings using the 1U1-1 as an example

1	U	1	-	1	Marking
x					Index for pole assignment for pole-changing machines where applicable. A lower index signifies a lower speed. Special case for split winding.
	x				Phase designation U, V, W
		x			Index for winding start (1) or end (2) or if there is more than one connection per winding
				x	Additional indices for cases in which it is obligatory to connect parallel power feed cables to several terminals with otherwise identical markings



### 6.2.1.2 Circuit diagram inside the terminal box cover

Data on the connection and connecting the machine winding can be found in the circuit diagram in the cover of the terminal box.

### 6.2.1.3 Direction of rotation

The standard motors are suitable for clockwise and counter-clockwise rotation.

For defined directions of rotation (direction of rotation arrow), appropriately connect the line power cables.

- If you connect the line cables with phase sequence L1, L2, L3 at U, V, W or according to NEMA at T<sub>1</sub> T<sub>2</sub> T<sub>3</sub>, then the machine rotates in the clockwise direction.
- If you interchange two connections, e.g. L1, L2, L3 at V, U, W or according to NEMA at T<sub>2</sub> T<sub>1</sub> T<sub>3</sub>, then the machine rotates counter-clockwise.

	According to IEC	According to NEMA
Clockwise rotation	U V W	T <sub>1</sub> T <sub>2</sub> T <sub>3</sub>
Counter-clockwise rotation	V U W	T <sub>2</sub> T <sub>1</sub> T <sub>3</sub>

Direction of rotation of the motor when looking at DE


### 6.2.1.4 Knockout openings

**NOTICE**

**Damage to the terminal box**

To avoid damaging the terminal box:

- Knockout openings in the terminal box must be knocked out using appropriate methods.
- Do not damage the terminal box, the terminal board, the cable connections etc. inside the terminal box.

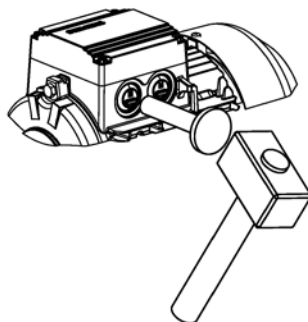

---

**Note**

Have additional holes in the terminal box with type of protection Ex d made only by the manufacturer or by a specialist workshop for electrical machinery authorized by the manufacturer.

---

**Making holes in the terminal box**

If you drill holes in the terminal box for explosion-protected motors, then document the data about these holes in the motor documentation:

- Number and size of the holes
- Type of thread, e.g. metric or NPT

Data regarding the installation of pipes and accessories is provided in IEC / EN 60079-14.

**Requirements placed on drilled holes in Zone 21/22**

For applications in Zone 21 (Ex tb) or Zone 22 (Ex tc), according to EN 60079-31, the following requirements are placed on drilled holes:

Through holes:

- The nominal diameter of the through holes for the entry may not be 0.7 mm larger than the nominal diameter of the thread of the cable entry or connection element.
- The inside of the terminal box must have sufficient space to attach a locking nut at the cable entry or at the connection element.

Openings with thread must have the following attributes:

- Conical thread: Without additional sealant or seals, not less than three and one half thread turns.
- Cylindrical threads: At least five thread turns, tolerance of 6H, even better according to ISO 965-1. For less than five thread turns, an additional seal or sealant is required.

### 6.2.1.5 Cable entry

#### Certified cable entries, thread adapters and sealing plugs

Only use sealing plugs, cable entries and conductor entries or thread adapters that are suitable, certified and marked for use in the respective explosion protection type and degree of protection (DIN EN 60079-14).

#### Terminal box


The number and size of the cable entry tapped holes is provided in the machine dimension drawing.


### Inserting cables into the terminal box

1. Only use cable entries that are suitable for the cables.
2. Only use cable entries and cables suitable for the prevailing ambient temperature.
3. Ensure that the power cables are strain relieved when inserting them in the terminal box.
4. Carefully connect the cables and ensure a reliable protective conductor connection.
5. Tighten the glands and the elements for the strain relief with the torque specified by the manufacturer.
6. Check the cable entries and cables to ensure that they are correctly sealed and firmly seated.
7. Correctly close and seal threads or holes that are not being used ensuring that the IP degree of protection is maintained. The IP degree of protection is specified on the rating plate.

#### 6.2.1.6 Protruding connection cables



 <b>WARNING</b>
<b>Risk of short-circuit and voltage hazard</b> A short circuit can occur if connecting cables are clamped and crushed between parts of the enclosure and the cover plate. This can result in death, severe injury and material damage. <ul style="list-style-type: none"><li>• During disassembly and particularly when installing the cover plate, make sure that the connecting cables are not clamped between enclosure parts and the cover plate.</li></ul>

 <b>CAUTION</b>
<b>Damage to connecting cables that are freely led out</b> You must observe the following note to avoid damaging connecting cables that are freely led out: <ul style="list-style-type: none"><li>• It must be ensured that there are no foreign bodies, dirt, or moisture in the terminal base of the machine enclosure.</li><li>• Use O-rings or suitable flat gaskets to seal entries in cover plates (DIN 42925) and other open entries.</li><li>• Seal the terminal base of the machine enclosure using the original seal of the cover plate to prevent dust and water from entering.</li><li>• Please observe the tightening torques for cable entries and other screws.</li></ul>

#### 6.2.1.7 Connecting protruding cables

In the case of connection cables brought out of the machine, no terminal board is installed on the terminal base of the machine housing. The connection cables are directly connected to stator winding terminals at the factory.

The connection cables are color-coded or labeled. The customer directly connects individual cables in the control cabinet for their system in accordance with the labeling.

**6.2.1.8 Connection with/without cable lugs**


In the case of terminals with terminal clamps, distribute the conductors in such a way that the clamping heights on both sides of the fillet are about the same. This method of connection requires that you must bend a single conductor in a U shape or use a cable lug. The same applies to the inner and outer terminals of the ground conductor.

When connecting up using cable lugs, select their size corresponding to the required cable cross-section and the stud size. An inclined arrangement is only permitted provided the required air clearances and creepage distances are carefully maintained.

Remove insulation from the ends of the conductors so that the remaining insulation almost reaches the cable lug.

**Note**

The direct contact between the cable lug surfaces and the contact nuts or contact screws ensure that the connection can conduct current.

 <b>WARNING</b>
<p><b>Short-circuit hazard</b></p> <p>Live conductors released from the terminal board can cause short circuits. Death or serious injury can result.</p> <ul style="list-style-type: none"> <li>You must bend single-core line conductors into a U shape in order to prevent the contact force being transferred at just one side.</li> <li>In order to prevent the cable lug from rotating, for a line connection using a cable lug, angle single- or multi-core cables downwards through an angle of approx. 40°.</li> </ul>

**6.2.1.9 Thread sizes in the terminal box**

Shaft height	Threaded entry	
	Size	Quantity
71 ... 90	M 16 x 1.5 M 25 x 1.5	1
100 ... 132	M 32x1.5	2
160 ... 180	M 40x1.5	2
200 ... 225	M 50x1.5	2
250 ... 315	M63x1.5	2
355	M 80x2	2

Thread size for additional entries, e.g. PTC thermistor or heater M16x1.5 or M20x1.5.

Other thread sizes are possible as an option.

### 6.2.1.10 Minimum air clearances

After proper installation, verify that the minimum air clearances between non-insulated parts are maintained. Be aware of any protruding wire ends.

Table 6- 2 Minimum air clearance dependent on rms value of the alternating voltage  $U_{rms}$

Rms value of the alternating voltage $U_{rms}$	Minimum air clearance mm		
	Ex tc Ex tb	Ex nA Ex ec	Ex e Ex eb
≤ 250 V	3.0	2.5	5.0
≤ 500 V	3.0	5.0	8.0
≤ 630 V	5.5	5.5	10.0
≤ 1000 V	8.0	8.0	14.0

Values apply at an installation altitude of up to 2000 m.


When determining the required minimum air clearance, the voltage value in the table may be increased by a factor of 1.1, so that the rated input voltage range is taken into account during general use.

### 6.2.1.11 Internal equipotential bonding

The internal equipotential bonding between the grounding terminal in the terminal box, the terminal box components and the machine enclosure is ensured via metallic contact, a copper braided strip or a stranded wire.


## 6.2.2 Cable glands

### Cable glands with (sheet metal) nuts (EN 50262)

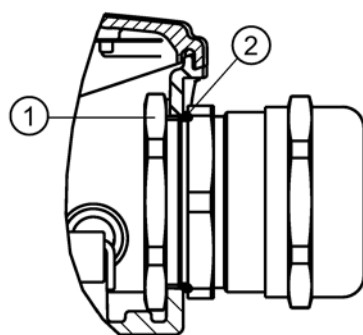


- ① Nut
- ② O ring

Cable glands with reductions and (sheet metal) nuts (EN 50262)

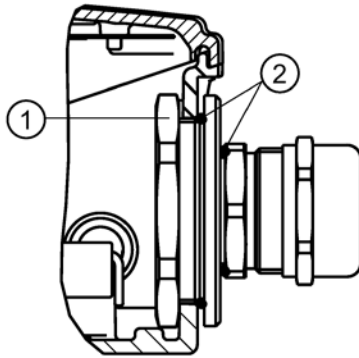


- ① Nut
- ② O ring

6.2.2.1 Mounting position of sheet metal nuts in screw-type connections

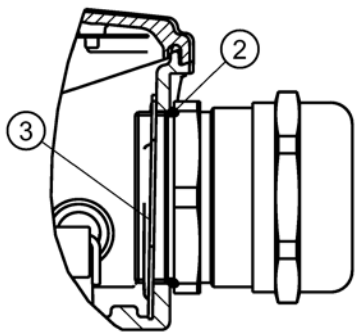

- ② O ring
- ③ Mounting position of metal-sheet nuts

Cable glands with connecting thread in the terminal box (EN 50262)

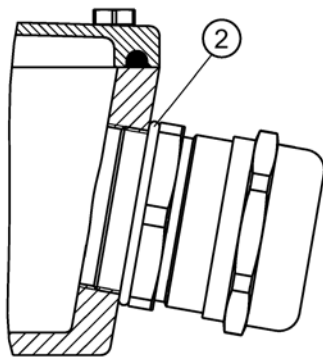

- ② O ring

6.3 Tightening torques

Note the information in Chapter Tightening torques (Page 165).

### 6.3.1 Cable entries, sealing plugs and thread adapters

All cable entries and sealing plugs must be approved for use in the respective hazardous zone.

- Any openings that are not being used must be sealed using the appropriate certified sealing plugs.
- Please observe the manufacturer's specifications when fitting cable entries.

Note the following when mounting:

- Avoid damaging the cable jacket.
- Adapt the tightening torques to the cable jacket materials.

Observe the documentation for tightening torques of the cable entries and sealing plugs for direct mounting at the machine as well as additional glands (e.g. adapters).

## 6.4 Connecting the grounding conductor

The machine's grounding conductor cross-section must comply with EN / IEC 60034-1.

Please also observe installation regulations such as those specified in EN / IEC 60204-1.

Basically, there are two ways of connecting a grounding conductor to the machine.



- Internal grounding with a connection in terminal box at the location intended for this purpose and marked accordingly.
- External grounding with connection at the stator housing at the locations intended for this purpose and marked accordingly.

### 6.4.1 Minimum surface area of grounding conductor

Table 6- 3 Minimum cross-sectional area of grounding conductor

Minimum cross-section of the phase conductor for installation S [mm <sup>2</sup> ]	Minimum cross-section of the associated grounding connection [mm <sup>2</sup> ]
$S \leq 25$	S
$25 < S \leq 50$	25
$S > 50$	0.5 S

### 6.4.2 Grounding connection type

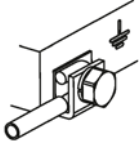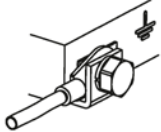Enclosure grounding method		Conductor cross-section mm <sup>2</sup>
Connection of an individual conductor under the external grounding bracket.		... 10
Connection is made using a DIN cable lug under the external grounding bracket. DIN 46 234		... 25

#### Internal ground terminal

When making connections, ensure the following:

- Ensure that the connecting surface is bare and is protected against corrosion using a suitable substance, e.g. acid-free Vaseline.
- Arrange the flat washer and spring washer under the bolt head.
- Locate the cable lug under the clamping bracket.
- Use the terminals designated for the grounding conductor in the terminal box.
- Observe the tightening torque (Page 166) for the locking screw.

#### External ground terminal

When making connections, ensure the following:

- Ensure that the connecting surface is bare and is protected against corrosion using a suitable substance, e.g. acid-free Vaseline.
- Position the cable lug between the contact bracket and the grounding bracket; do not remove the contact bracket pressed into the enclosure!
- Arrange the flat washer and spring washer under the bolt head.
- Use the marked connection location for the grounding conductor on the stator housing.
- Observe the tightening torque (Page 166) for the locking screw.



Shaft height	Thread size for the grounding conductor
63 ... 160	1 x M 5
180	1 x M 6
200	2 x M 6
225 ... 315	2x M8
315 ... 355 (1MB)	2 x M 12

The additional grounding point (generally on the opposite side) is optionally available.


## 6.5 Connecting the temperature sensor/anti-condensation heater

### 6.5.1 Connecting optional integrated devices and equipment


In addition to the current-dependent overload protective device located in the connecting cables, use the optionally available integrated devices and equipment, for example, temperature sensor, anti-condensation heating.

Depending on the terminal box version, connect the auxiliary circuits to the terminal block or to the terminal board.

Terminal block connection

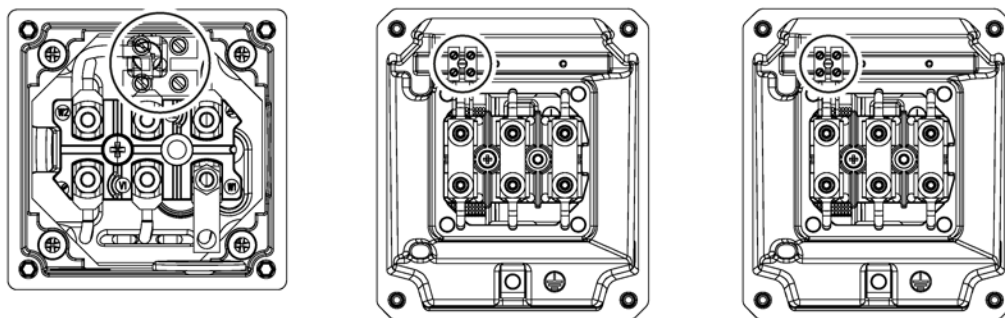

Terminal board connection

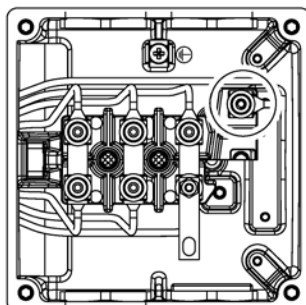

## 6.6 Conductor connection

Cross-sections that can be connected depending on the size of the terminal (possibly reduced due to size of cable entries)




Table 6- 4 Max. conductor connection for standard machines and Ex tc


 

 
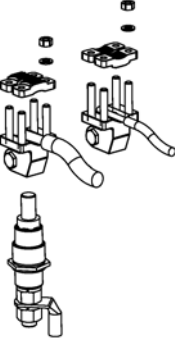





Shaft height	Max. connectable conductor cross-section mm <sup>2</sup>
63 ... 90	1.5 2.5 with cable lug
100 ... 112	4.0
132	6.0
160 ... 180	16.0
200	25.0
225	35.0 with cable lug
250 ... 280	120.0
315	240.0


Table 6- 5 Max. conductor connection for explosion-protected machines (with the exception of Ex tc) and VIK in the standard version

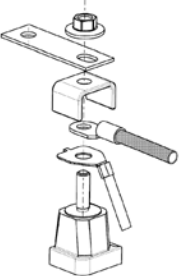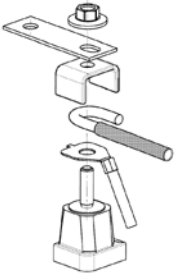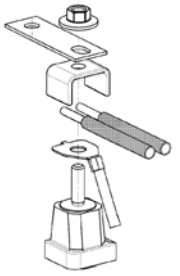Shaft height	Max. connectable conductor cross-section mm <sup>2</sup>
63 ... 112	4.0
132	6.0
160	16.0
180	10.0
180 (1LG4, 1LG6)	16.0
200 ... 225	50.0
250 ... 280	120.0
315	240.0
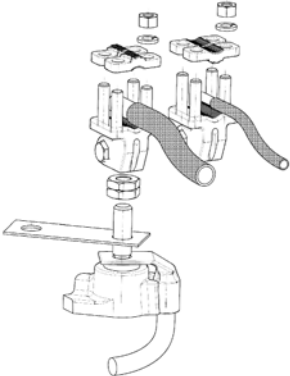
### 6.6.1 Connecting conductors

 Type of connection	Terminal studs	Cable cross-section mm <sup>2</sup>
Connection with cable lug DIN 46234 	M 4	1 ... 4 1 ... 6 (shaft height 132)
	M5	1 ... 16
	M6	4 ... 35
Connection of a single conductor 	M 4	1 ... 4 1 ... 6 (shaft height 132)
	M5	1 ... 16
	M6	4 ... 35
Connection of two conductors of the same thickness with terminal clamp 	M 4	Not permitted
	M5	Not permitted
	M6	4 ... 35

Type of connection	Terminal studs	Cable position with terminal	Cable cross-section mm <sup>2</sup>
	M 8		2.5 ... 25
			16 ... 50
			10 ... 16
	M 10		10 ... 95
	M 12		25 ... 185
	M 16		50 ... 300
	M 10		50 ... 120
	M 12		95 ... 240
	M 16		120 ... 300
	M 10		16 ... 35
	M 12		16 ... 70
	M 16		16 ... 120
	M 20		25 ... 300

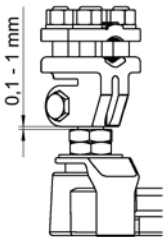Assembly of clamping device	
	<p style="text-align: center;"><b>M8</b></p> <p style="text-align: center;">Mount the clamping devices on the terminal board at a distance of 0.1 ... 1 mm to the lock nuts.</p>

## 6.6.2 Cable ends with wire end sleeves

1. Preferably use end sleeves instead of soldering cable ends.
2. Before connecting, attach the end sleeves so as to form a technically correct, current-carrying crimped joint at the end of the conductor.

### WARNING

#### **Risk of explosion due to excessive temperature rise**

If the end of the conductor is not correctly enclosed by the end sleeve, but is trapped by it, this can lead to overheating. The temperature class of the machine can be exceeded. This can trigger ignition of an explosive mixture. This can result in death, serious injury or material damage.

- Insert only one conductor end into each end sleeve. Attach the end sleeve correctly.

## 6.6.3 Connecting aluminum conductors

If you are using aluminum conductors, then comply with the following:

- Use only cable lugs that are suitable for connecting aluminum conductors.
- Immediately before inserting the aluminum conductor, remove the oxide layer from the contact areas on the conductor and/or the mating piece. Do this using a brush or file.
- Then grease the contact areas immediately using neutral Vaseline. This prevents a new oxide layer from forming.

### **NOTICE**

#### **Aluminum flow due to contact pressure**

Aluminum flows following installation due to the contact pressure. The connection using clamping nuts can loosen as a result. The contact resistance increases, obstructing the current from being conducted. This can result in fire and material damage to the machine – or even in total failure, as well as material damage to the plant or system due to machine failure.

- Retighten the clamping nuts after approximately 24 hours and then again after approximately four weeks. Make sure that the terminals are de-energized before you tighten the nuts.

## 6.7 Connecting the converter



**NOTICE**

**Excessively high supply voltage**

Material damage can occur if the supply voltage is too high for the insulation system.

SIMOTICS machines can be operated with SINAMICS G converters and SINAMICS S converters (uncontrolled and controlled infeed) when maintaining the permissible peak voltages.

Carefully observe the values in the following tables.

Rise times  $t_r > 0.1 \mu s$ .

The insulation system of SIMOTICS machines corresponds to the specifications laid down in IEC 60034-18-41 according to voltage stress category C (IVIC C = high stress).

Table 6- 6 Maximum voltage peaks at the motor terminals for line (DOL) motors, converter operation possible

Rated motor voltage V	Maximum peak voltage at the motor terminals $\hat{U}_{max}$ dependent on the rise time $t_r$			
	$\hat{U}_{phase-to-phase}$ $V_{pk}$	$\hat{U}_{phase-to-ground}$ $V_{pk}$	Rise time $t_r$ $\mu s$	DC link $U_{DC}$ V
$\leq 500 V$	1500	1100	0.5	750
	900	900	0.1	

Table 6- 7 Maximum voltage peaks at the motor terminals for motors specifically designed for converter operation (e.g. VSD 10)

Rated motor voltage V	Maximum peak voltage at the motor terminals $\hat{U}_{max}$ dependent on the rise time $t_r$			
	$\hat{U}_{phase-to-phase}$ $V_{pk}$	$\hat{U}_{phase-to-ground}$ $V_{pk}$	Rise time $t_r$ $\mu s$	DC link $U_{DC}$ V
$\leq 500 V$	1600	1400	0.5	750
	1000	1000	0.1	
$> 500 V$ to 690 V	2200	1800	0.5	1080
	1000	1000	0.1	

**See also**

Further documents (Page 163)

 **WARNING****Machine overheating**

Operating explosion-protected machines at the converter without using the appropriate protective equipment can result in death or severe injury.

Always use PTC thermistor monitoring when operating explosion-protected machines at the converter. Tripping units according to Directive 2014/34/EU ("Explosion Protection Directive") are always necessary when using PTC thermistor monitoring.

**Machines with non-sparking "ec" "nA" type of protection**

The operation of the explosion-proof machines on the converters is permitted, when the specifications for the speed control range and torque characteristic are observed, and if winding temperature monitoring is ensured via the integrated temperature sensors in conjunction with a certified tripping unit.

**Machines with increased safety "eb" type of protection**

Converter operation for these machines must be expressly certified. It is essential that you observe the separate manufacturer's information and instructions. Converter and protective devices must be marked as belonging together and the permitted operating data must be defined in the common EC-type examination certificate.

**Machines with type of protection, dust explosion protection "tb" or dust explosion protection "tc"**

These machines are generally equipped with 3 PTC thermistors in accordance with DIN 44082 with a rated response temperature that depends on the maximum possible surface temperature. Select the PTC thermistors in accordance with this standard. The maximum temperature at the cable entries is 120 °C. Use suitable cables for this temperature. Do not exceed the maximum frequency dependent on the number of poles, which is stamped on the rating plate.

**System, converter - cable - electrical machine**

Please observe the information and data provided in EN / IEC 60034-17 and EN / IEC 60034-25 regarding winding stress. For line supplies with operating voltages up to 690 V, the maximum value of the voltage peaks at the end of the cable must not exceed twice the value of the converter's DC-link voltage.

**See also**

Thermal protection (Page 43)

## **6.8 Final checks**

Before closing the terminal box/terminal base of the machine enclosure, check the following:

- Establish the electrical connections in the terminal box in accordance with the information in this documentation.
- Maintain the air clearances between non-insulated parts as described in Chapter Minimum air clearances. (Page 75)
- Avoid protruding wire ends.
- In order not to damage the cable insulation, freely arrange the connecting cables.
- Connect the machine corresponding to the specified direction of rotation.
- Keep the inside of the terminal box clean and free from trimmed-off ends of wire.
- Ensure that all seals and sealing surfaces are undamaged and clean.
- Correctly and professionally close unused openings in the terminal boxes. Observe the information in this documentation.
- Observe the information on torques in this documentation.

### **See also**

Tightening torques for screw and bolt connections (Page 165)



# Commissioning

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.
- Before commissioning, carefully observe the requirements laid down in Standard IEC / EN 60079-14 or IEC / EN 60079-17.

---

**Note****Service Center**

Please contact the Service Center if you require commissioning support.

---

## 7.1 Measures before commissioning

The following list of checks to be performed prior to commissioning does not claim to be complete. It may be necessary to perform further checks and tests in accordance with the specific situation on-site.

Once the system has been correctly installed, you should check the following prior to commissioning:

- Carefully ensure that the machine is not damaged.
- Ensure that the machine has been correctly installed and aligned.
- Ensure the correct setting conditions of the drive output elements depending on the type. For example, alignment and balancing of couplings, belt forces in the case of a belt drive, tooth forces and tooth flank backlash/play in the case of gear wheel output, radial and axial clearance in the case of coupled shafts.
- Carefully ensure that all fastening screws, connecting elements and electrical connections have been tightened to the specified torque.
- Carefully checked that the operating conditions match the data provided in accordance with the technical documentation, such as degree of protection, ambient temperature, etc.
- Carefully ensure that moving parts, for example the coupling, move freely.
- Carefully ensure that all touch protection measures for moving and live parts have been correctly applied.
- Remove any lifting eyes that were screwed after installation – or secure them to prevent them becoming loose.

### Second shaft extension

If the second shaft extension is not used:

- Carefully secure the feather key to prevent it from being thrown out, and for balancing type "H" (standard type), ensure its weight is reduced to approximately 60 % of the original value.
- Using covers, carefully secure the unused shaft extension so that it cannot be touched.

### Risk of losing the IP degree of protection as a result of damaged shaft sealing rings

This can result in death, serious injury, or material damage.

- Replace damaged components immediately.
- Rotate the rotor to ensure that it does not touch the stator.
- Ensure that the bearing insulation is not bridged/jumpered.
- Using the appropriately designed and adjusted control and speed monitoring functions ensure that the permissible speeds specified on the rating plate cannot be exceeded.
- Ensure that any supplementary equipment used to monitor the motor is correctly connected and is functioning.

### Electrical connection

- Carefully check the grounding and potential bonding connections.
- Connect the machine corresponding to the specified direction of rotation.
- Using the appropriate open-loop control and speed monitoring functions, carefully ensure that no higher speeds can be achieved than are permitted and specified in the technical data. For this purpose, compare the data on the rating plate or, if necessary, the system-specific documentation.
- Comply with the minimum insulation resistances.
- Comply with the minimum air clearances.
- Correctly connect possibly available machine monitoring devices and equipment - and carefully ensure that they are functioning correctly.
- Check the correct functioning of the brakes or backstops.
- Set the values for "Alarm" and "Shutdown" at the monitoring devices.
- Carefully ensure that temperature-sensitive parts and components, e.g. cables are not in contact with the machine enclosure.

### Converter operation

- If the motor design requires connection to a specific converter type, carefully check the supplementary data on the rating plate/supplementary plate.
- Carefully ensure that the converter is correctly parameterized. The parameterization data is specified on the rating plate of the machine. Information about the parameters is available in the operating instructions for the converter.

- Check that the supplementary equipment and devices to monitor the machine are correctly connected and are functioning correctly.
- In continuous operation, carefully ensure that the motor cannot exceed the specified upper speed limit  $n_{\max}$  or fall below the lower speed limit  $n_{\min}$ .

The permissible acceleration time to the limit speed  $n_{\min}$  depends on the parameter assignment.

### 7.1.1 Insulation resistance and polarization index

Measuring the insulation resistance and polarization index (PI) provides information on the condition of the machine. It is therefore important to check the insulation resistance and the polarization index at the following times:

- Before starting up a machine for the first time
- After an extended period in storage or downtime
- Within the scope of maintenance work

The following information is provided regarding the state of the winding insulation:

- Is the winding head insulation conductively contaminated?
- Has the winding insulation absorbed moisture?

As such, you can determine whether the machine needs commissioning or any necessary measures such as cleaning and/or drying the winding:

- Can the machine be put into operation?
- Must the windings be cleaned or dried?

Detailed information on testing and the limit values can be found here:

"Testing the insulation resistance and polarization index"

## 7.1.2 Testing the insulation resistance and polarization index



### WARNING

#### Hazardous voltage at the terminals

During and immediately after measuring the insulation resistance or the polarization index (PI) of the stator winding, hazardous voltages may be present at some of the terminals. Contact with these can result in death, serious injury or material damage.

- If any power cables are connected, check to make sure line supply voltage cannot be delivered.
- Discharge the winding after measurement until the risk is eliminated, e.g. using the following measures:
  - Connect the terminals with the ground potential until the recharge voltage drops to a non-hazardous level
  - Attach the connection cable.

### Measure the insulation resistance

1. Before you begin measuring the insulation resistance, please read the operating manual for the insulation resistance meter you are going to use.
2. Short-circuit the ends of the temperature sensor cables before applying the test voltage. If the test voltage is connected to only one temperature sensor terminal, the temperature sensor will be destroyed.
3. Make sure that no power cables are connected.
4. Measure the winding temperature and the insulation resistance of the winding in relation to the machine enclosure. The winding temperature should not exceed 40° C during the measurement. Convert the measured insulation resistances in accordance with the formula to the reference temperature of 40° C. This thereby ensures that the minimum values specified can be compared.
5. Read out the insulation resistance one minute after applying the measuring voltage.

## Limit values for the stator winding insulation resistance

The following table specifies the measuring voltage and limit values for the insulation resistance. These values correspond to IEEE 43-2000 recommendations.

Table 7- 1 Stator winding insulation resistance at 40° C

$U_N$ V	$U_{meas}$ V	$R_C$ MΩ
$U \leq 1000$	500	$\geq 5$
$1000 \leq U \leq 2500$	500 (max. 1000)	100
$2500 < U \leq 5000$	1000 (max. 2500)	
$5000 < U \leq 12000$	2500 (max. 5000)	
$U > 12000$	5000 (max. 10000)	

$U_{rated}$  = rated voltage, see the rating plate

$U_{meas}$  = DC measuring voltage

$R_C$  = minimum insulation resistance at a reference temperature of 40 °C

## Conversion to the reference temperature

When measuring with winding temperatures other than 40° C, convert the measuring value to the reference temperature of 40° C according to the following equations from IEEE 43-2000.

(1)	$R_C$	Insulation resistance converted to 40° C reference temperature
	$K_T$	Temperature coefficient according to equation (2)
	$R_T$	Measured insulation resistance for measuring/winding temperature $T$ in °C
$R_C = K_T \cdot R_T$		
(2)	40	Reference temperature in °C
	10	Halving/doubling of the insulation resistance with 10 K
	$T$	Measuring/winding temperature in °C
$K_T = (0.5)^{(40-T)/10}$		

In this case, doubling or halving the insulation resistance at a temperature change of 10 K is used as the basis.

- The insulation resistance halves every time the temperature rises by 10 K.
- The resistance doubles every time the temperature falls by 10 K.

For a winding temperature of approx. 25° C, the minimum insulation resistances are 20 MΩ ( $U \leq 1000$  V) or 300 MΩ ( $U > 1000$  V). The values apply for the complete winding to ground. Twice the minimum values apply to the measurement of individual assemblies.

- Dry, new windings have an insulation resistance of between 100 and 2000 MΩ, or possibly even higher values. An insulation resistance value close to the minimum value could be due to moisture and/or dirt accumulation. The size of the winding, the rated voltage and other characteristics affect the insulation resistance and may need to be taken into account when determining measures.
- Over its operating lifetime, the motor winding insulation resistance can drop due to ambient and operational influences. Calculate the critical insulation resistance value depending on the rated voltage by multiplying the rated voltage (kV) by the specific

critical resistance value. Convert the value for the current winding temperature at the time of measurement, see above table.

**Measuring the polarization index**

1. To determine the polarization index, measure the insulation resistances after one minute and ten minutes.
2. Express the measured values as a ratio:

$$PI = R_{\text{insul 10 min}} / R_{\text{insul 1 min}}$$

Many measuring devices display these values automatically following the measurement.

For insulation resistances > 5000 MΩ, the measurement of the PI is no longer meaningful and consequently not included in the assessment.

$R_{(10 \text{ min})} / R_{(1 \text{ min})}$	Assessment
$\geq 2$	Insulation in good condition
$< 2$	Dependent on the complete diagnosis of the insulation

<p><b>NOTICE</b></p> <p><b>Damage to insulation</b></p> <p>If the critical insulation resistance is reached or undershot, this can damage the insulation and cause voltage flashovers.</p> <ul style="list-style-type: none"> <li>• Contact the service center (Page 163).</li> <li>• If the measured value is close to the critical value, you must subsequently check the insulation resistance at shorter intervals.</li> </ul>
--

**Limit values of the anti-condensation heating insulation resistance**

The insulation resistance of the anti-condensation heating with respect to the machine housing should not be lower than 1 MΩ when measured at 500 V DC.

**7.1.3 Testing the cooling of the machine**

**Cooling**

- Check that the machine cooling is available for commissioning.

**See also**

Preparing for use (Page 33)

### 7.1.4 Commissioning an external fan

An external fan is suitable for use only in unidirectional operation; refer to the specification of the direction of rotation on the fan cowl or on the fan unit. The external fan ensures that the machine is cooled irrespective of the machine speed or direction of rotation.

If the cooling air is in open circulation, it must have only weak, chemically abrasive properties and only a low dust content.

#### Checks before the first test run

Before the first test run, carry out the following checks:

- The external fan is correctly fitted and aligned.
- The rotor runs freely.
- All of the retaining elements and electrical connections are securely tightened.
- The grounding and equipotential bonding connections to the mains have been correctly made.
- The air flow is not impeded or shut off by flaps, covers or similar.
- All protection measures have been taken to prevent accidental contact with moving or live parts.

#### Performing the test run

1. Switch the external fan motor on and off briefly.
2. Compare the the direction of rotation of the external fan with the arrow indicating the direction of rotation. If the direction of rotation and the arrow do not match, then switch two of the three phases of the external fan motor.

---

#### Note

Use these operating instructions for motors with external fans.

---

### 7.1.5 Further documents

---

#### Note

#### Further documents

Observe all of the other documents provided with this machine.

---

## 7.2 Setpoint values for monitoring the bearing temperature

### Prior to commissioning

If the machine is equipped with bearing thermometers, set the temperature value for disconnection on the monitoring equipment before the first machine run.

Table 7- 2 Set values for monitoring the bearing temperatures before commissioning

Set value	Temperature
Alarm	115 °C
Shutting down	120 °C

### Normal operation

Determine the maximum operating temperature of the bearings  $T_{\text{operation}}$  taking into account the temperature, bearing load and influences of the plant on the motor in °C. Set the values for shutdown and warning corresponding to the operating temperature  $T_{\text{op}}$ .

Table 7- 3 Set values for monitoring the bearing temperatures

Set value	Temperature
Alarm	$T_{\text{operation}} + 5 \text{ K} \leq 115 \text{ °C}$
Shutting down	$T_{\text{operation}} + 10 \text{ K} \leq 120 \text{ °C}$

## 7.3 Switching on

### Measures for start-up

After installation or inspections, the following measures are recommended for normal start-up of the machines:

- Start the machine without a load. To do this, close the circuit breaker and do not switch the machine off prematurely. Switching the machine off again while it is starting up and still running at slow speed should be kept to a bare minimum, for example for checking the direction of rotation or for checking in general. Allow the machine to run to a standstill before switching it back on again.
- Check mechanical operation for noise or vibration at the bearings or end shields.
- If the machine is not running smoothly or is emitting abnormal noises, switch it off, and determine the cause of the fault as it runs down.
- If mechanical operation improves immediately after the machine is switched off, then the cause is magnetic or electrical, e.g. voltage imbalance, magnetic imbalance. If mechanical operation does not improve immediately after switching the machine off, then the cause is mechanical, e.g. an imbalance in the electrical machines or in the driven



machine, inadequate alignment of the machine set, operation of the machine with the system resonating (system = machine + base frame + foundations etc.).

- If the machine runs perfectly in terms of its mechanical operation, switch on any cooling devices present and continue to monitor the machine for a while as it idles.
- If it runs perfectly, connect a load. Check that it runs smoothly. Read off and document the values for voltage, current, and power. Where possible, read off corresponding values for the driven machine and document them as well.
- Monitor the bearing temperature, winding temperature, etc. until the system reaches a steady state. Document these, provided this is possible with existing measuring instruments.

<b>NOTICE</b>
<b>Destruction of the machine</b>
The machine can be destroyed if the vibration values are not strictly complied with.
<ul style="list-style-type: none"> <li>• In operation, maintain vibration values in accordance with DIN ISO 10816-3.</li> </ul>

- Start the machine without a load; to do this, close the motor starter protector and do not switch the machine off prematurely.
- You should limit how often you switch the machine off while it is starting up and still running at a slow speed, for checking the direction of rotation or the required dimensions, for example.
- Allow machines to reach a standstill before switching them back on.

### 7.3.1 Test run

After installation or inspection, carry out a test run:

1. Start up the machine without a load. To do this, close the circuit breaker and do not switch off prematurely. Check whether it is running smoothly.

Switching the machine off again while it is starting up and still running at slow speed should be kept to a bare minimum, for example for checking the direction of rotation or for checking in general.

Allow the machine to run down before switching it on again.

<b>NOTICE</b>
<b>Avoiding mechanical damage to the cylindrical roller bearing</b>
Under all circumstances maintain the minimum load on cylindrical roller bearings of 50% corresponding to what is specified in the catalog.

2. If the machine is running smoothly and evenly, switch on the cooling equipment. Continue to observe the machine for a while in no-load operation.

3. If it runs perfectly, connect a load.

**NOTICE**

**Thermal overload of motors connected directly to the line supply**

In addition to the load torque, the ramp-up (accelerating) time is essentially influenced by the moment of inertia to be accelerated. While ramping up when connected to the line supply, the inrush (starting) current is a multiple of the rated current. This can result in thermal overload. This can damage the motor.

As a consequence, when ramping up, observe the following:

- Monitor the ramp-up time and number of consecutive starts.
- Comply with the limit values and/or ramp-up conditions specified in the catalog or the order documentation.

4. During the test run, check and document the following:
  - Check whether it is running smoothly.
  - Document the voltage, current and power values. As far as possible, document the corresponding values of the driven machine.
  - If this is possible using the available measuring equipment, check the bearing and stator winding temperatures until they have reached steady-state values.
  - Check the machine for noise or vibrations on the bearings or bearing shields as it runs.
5. In case of uneven running or abnormal noise, switch off the machine. As the machine runs down, identify the cause.
  - If the mechanical operation improves immediately after the machine is switched off, then the cause is magnetic or electrical.
  - If the mechanical running does not improve immediately after switching the machine off, then the cause is mechanical.
    - Imbalance of the electrical machine or the driven machine
    - The machine set has not been adequately aligned
    - The machine is being operated at the system resonance point. System = motor, base frame, foundation, ...

**NOTICE**

**Serious damage to the machine**

If the vibration values in operation are not maintained in accordance with DIN ISO 10816-3, then the machine can be mechanically destroyed.

- During operation, observe the vibration values in accordance with DIN ISO 10816-3.

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.

## 8.1 Safety instructions for operation

### Risk of injury due to rotating parts

Rotating parts are dangerous. Touch protection against rotating parts is no longer guaranteed if covers are removed. Touching rotating parts can result in death, serious injury or material damage.

- Carefully ensure that all of the covers are closed while operational.
- First switch off and disconnect the machine if you must remove covers. Comply with the "Five safety rules":
- Only remove the covers when the rotating parts have come to a complete standstill.

### Danger as a result of stationary parts under voltage (live parts)

Live parts represent a hazard. Touch protection against active (live) parts is no longer guaranteed if covers are removed. The minimum air and creepage distances may be fallen below (violated) when coming close to active parts. Touching or coming close can result in death, serious injury or material damage.

- Carefully ensure that all of the covers are closed while operational.
- First switch off and disconnect the machine if you must remove covers. Comply with the "Five safety rules":
- When the machine is in operation, the terminal boxes must remain closed at all times. Terminal boxes may be opened only when the machine is stopped and in a no-voltage condition.

### Faults in operation

Any changes with respect to the normal condition can indicate that the machine is not functioning correctly.

- Higher power consumption, temperatures or vibration levels.
- Unusual noise or smells.
- Monitoring devices respond.

This can cause faults which can result in eventual or immediate death, serious injury or material damage.

- Immediately inform the service personnel.
- If you are in doubt, immediately switch off the machine, carefully observing the system-specific safety conditions.

### Damage caused by condensation

Humidity in the air can condense for intermittent duty or load fluctuations. Condensate can collect. Moisture can have a negative impact on the winding insulation or result in damage, such as corrosion.

- Ensure that any condensation can freely flow away.

### Risk of burn injuries as a result of hot surfaces

Individual machine parts can become hot in operation. Burns can result when coming into contact with these parts.

- Never touch machine parts during operation.
- Allow the machine to cool down before starting work.
- Check the temperature of parts before touching them. If required, wear suitable protective equipment.

### Hazardous substances

Chemical substances required for the setup, operation and maintenance of machines can present a health risk. Poisoning, skin damage, cauterization of the respiratory tract, and other health damage may result.

- Read the information in these operating instructions and the product information supplied by the manufacturer.
- Observe the relevant safety regulations and wear the personal protective equipment specified.

### Substances that can be easily ignited and are flammable

Chemical substances required for the setup, operation and maintenance of machines may be flammable. Burns and other damage to health and material may result.

- Read the information in these operating instructions and the product information supplied by the manufacturer.
- Observe the relevant safety regulations and wear the personal protective equipment specified.

## Switching on the machine


**! DANGER**
**Hazardous voltages**

Electrical machines are at hazardous voltage levels. Contact with these can result in death, serious injury or material damage.

Operating the machine on a line supply system with a non-grounded neutral point is only permitted for short periods of time that occur rarely, e.g. the time leading to a fault being eliminated. Cable ground fault EN / IEC 60034-1.

**NOTICE**
**Damage to the machine or premature bearing failure**

The bearings can be damaged if the following is not observed.

- It is absolutely crucial that you maintain the permissible vibration values to avoid damage to the machine or its destruction.
- In operation, observe the vibration values in accordance with ISO 10816-3.
- Under all circumstances maintain the minimum radial load of cylindrical roller bearings of 50% corresponding to what is specified in the catalog.
- Take the appropriate measures to reduce bearing currents. Observe the Chapter Converter operation.

**! WARNING**
**Faults in operation**

Changes with respect to normal operation indicate that there is an impaired function. This can cause faults which can result in eventual or immediate death, severe injury or material damage.


For instance, observe the following signs that could indicate a malfunction:

- Higher power drawn than usual
- Higher temperatures than usual
- Unusual noises
- Unusual smells
- Response of monitoring equipment

Immediately contact the maintenance personnel if you identify any irregularities. If you are in doubt, immediately switch off the machine, being sure to observe the system-specific safety conditions.

<b>NOTICE</b>
<b>Risk of corrosion due to condensation</b>
If the machine and/or ambient temperatures fluctuate, this can result in condensation inside the machine.
<ul style="list-style-type: none"><li>• If available, remove the drain plugs or drain screws to drain the water depending on the ambient and operating conditions.</li><li>• If available, re-attach the drain plugs or drain screws.</li></ul>
If the motor is equipped with drain plugs, then the water can drain away by itself.

**Switching on the machine with anti-condensation heating (optional)**

 <b>CAUTION</b>
<b>Machine overheating</b>
Minor injury or material damage can occur if you do not observe the following:
<ul style="list-style-type: none"><li>• If available, switch off the anti-condensation heating each time before switching on.</li></ul>

**See also**

Converter operation (Page 47)

**Explosion hazard from hybrid mixtures**

Hybrid mixtures are mixtures of flammable dusts with explosive gas/air atmospheres which can together create a dangerous explosive atmosphere if they occur at the same time. Changes can arise in the safety characteristics here, such as a change in the zonal classification, increase in the explosion pressure, reduction in the minimum ignition energy and a reduction in the maximum temperatures to be observed.

An explosion can result. This can result in death, serious injury or material damage.

- For this reason, the relative characteristics must be considered both for gas (zones 0, 1 and 2) and for dust (zones 20, 21 and 22) where hybrid mixtures arise. It is necessary for a competent assessor to determine in the individual case whether the parameters determining ignition are unfavorably affected in a particular hybrid mixture.
- Motors with dual plates for G (“Gas”) and D (“Dust”) may only be used where these two occur after prior examination of the properties of the hybrid mixtures by the user.

 **WARNING****Explosion hazard**

These explosion-protected machines are not suitable for hybrid explosive environments.

This can result in death, serious injury or material damage.

Use in atmospheres where there is a risk of explosion caused by both gas and dust simultaneously is absolutely prohibited.

Only install machines with type of protection increased safety "eb" and machines "ec" in hazardous zones, carefully complying with the regulations laid down by the responsible regulatory body. They are responsible for determining the hazard level of each area (division into zones). For machines with Ex "t", under no circumstances must a layer of dust be greater than 5 mm!

- If there are no other specifications in the EC or EU-type examination certificate or on the rating plate regarding operating mode and tolerance, electrical machines are designed for continuous duty and normal starting procedures that are performed infrequently and do not result in excessive temperature rise. Only use these machines for the operating mode specified on the rating plate.
- If an anti-condensation heating system is available, it may only be switched on when the machines are not in operation.


**See also**

Thermal protection (Page 43)


 **WARNING****Explosion hazard due to overheating of the machine caused by deposits of dust**

Deposits of dust have a thermal insulation effect, which can lead to the machine overheating. The maximum surface temperature of the machine cannot be adhered to. The dust can ignite, resulting in an explosion. This can result in death, serious injury, or material damage.

- Dust the machine regularly.
- Do not switch the machine on until the dust has been removed.


 <b>WARNING</b>
<b>Risk of explosion due to excessive bearing temperature</b> The surface temperature cannot be maintained within maximum permissible limits if the bearing becomes too hot. The dust can ignite, resulting in an explosion. This can result in death, serious injury, or material damage. <ul style="list-style-type: none"><li>• Always check the bearing temperatures.</li><li>• In addition to the current-dependent overload protection device located in the three phases of the connecting cable, we recommend that you also monitor the temperature rise in the machine with the aid of the temperature sensors built into the stator winding.</li><li>• You will find the alarm and shutdown temperatures in the Technical Data.</li></ul>


To ensure problem-free machine cooling, the air ducts (ventilation grilles, channels, cooling fins, tubes) must be free of pollution.

 <b>WARNING</b>
<b>Risk of explosion when cleaning with compressed air</b> If you clean the machine with compressed air, plastic components may become statically charged and ignite a potentially explosive atmosphere; an explosion can occur. This can result in death, serious injury or material damage. <ul style="list-style-type: none"><li>• Do not use compressed air to clean motors when installed in hazardous zones!</li></ul>

### 8.1.1 Safety instructions relating to ventilation and cooling


Forced ventilation (optional): Type of cooling IC 416 in accordance with EN / IEC 60034-6

 <b>WARNING</b>
<b>Risk of burning</b> Operating the machine without external fan results in overheating. This may result in death, personal injury and material damage. <ul style="list-style-type: none"><li>• Never commission the machine without an external fan.</li></ul>

 <b>CAUTION</b>
<b>Risk of injury when touching the fan</b> There is a risk of injury at machines equipped with a fan cover (e.g. on machines in the textile industry), as the fan is not completely touch protected. <ul style="list-style-type: none"><li>• Do not touch the rotating fan.</li><li>• Do not put your fingers into the larger air discharge openings.</li><li>• Prevent manual intervention by using suitable measures, e.g. appropriate housings or a protective grating.</li></ul>



## 8.1.2 Bridging insulated bearings


 <b>DANGER</b>
<b>Explosion hazard if the bridging is removed from the insulated bearing</b>
Removing the factory-fitted bridging of the insulated bearing leads to potential differences between the rotor and the grounded motor. This can cause the generation of sparks, which especially in an explosive atmosphere can ignite surrounding dust or combustible gases. Explosions can occur. There is also a risk of an electric shock. Death, serious injury, or material damage will result.
Do not open the bridging of the bearing insulation during operation.

## 8.1.3 Switching on with the anti-condensation heating active

### Excessively high machine temperature when heating is switched on

If the anti-condensation heating is operated while the machine is running, this can increase the temperatures inside the machine. Material damage can result.

- Make sure that the anti-condensation heating is switched off before the machine is switched on.
- Only operate anti-condensation heating when the machine is switched off.

 <b>WARNING</b>
<b>Explosion hazard</b>
If the anti-condensation heating is switched on during operation, the temperature class or the maximum surface temperature of the machine can be exceeded.
In an explosive atmosphere, there is a risk of an explosion. This can result in death, serious injury or material damage.
Only switch the anti-condensation heating on after the motor has been switched off.

## 8.2 Switching on the machine

1. If at all possible, run the machine without load and check that it is running smoothly.
2. If it runs perfectly, connect a load.

### NOTICE

#### Thermal overload of motors connected directly to the line supply

In addition to the load torque, the ramp-up (accelerating) time is essentially influenced by the moment of inertia to be accelerated. While ramping up when connected to the line supply, the inrush (starting) current is a multiple of the rated current. This can result in thermal overload. This can damage the motor.

As a consequence, when ramping up, observe the following:

- Monitor the ramp-up time and number of consecutive starts.
- Comply with the limit values and/or ramp-up conditions specified in the catalog or the order documentation.

3. If this is possible using the available measuring equipment, check the bearing and stator winding temperatures.

## 8.3 Switching off the external fan

Do not immediately switch off the separately-driven (external) fan after switching off the machine. First wait for the machine to cool down. This will prevent the accumulation of residual heat.

## 8.4 Switching on again after an emergency switching-off

- Check the machine before recommissioning the driven machine after an Emergency Off.
- Eliminate all the causes that have led to the emergency off

## 8.5 Stoppages

The stoppage is a shutdown for a period of time, during which the machine is stopped but remains at the location of use.

Under normal ambient conditions, e. g. the stopped machine is not exposed to any vibration, no increased level of corrosion, etc. in general, the following measures are necessary during stoppages.

## Longer non-operational periods

### Note

- For longer non-operational periods (> 1 month), either operate the machine or at least turn the rotor regularly, approximately once per month.
- Please refer to the section "Switching on" before switching on to recommission the motor.
- Remove any machine rotor locking devices before you turn the rotor.

### NOTICE

#### Restricted motor function

If not used for longer periods of time, material damage or complete motor failure can occur.

If the motor is out of service for a period of more than 12 months, then environmental effects can damage the motor.

- Apply suitable corrosion protection, preservation, packing and drying measures.

## Switching on the anti-condensation heater

Switch on any anti-condensation heating while the machine is not being operated.

## Taking the machine out of service

Details regarding the necessary measures, Chapter Preparing for use (Page 33).

## Lubricating before recommissioning

### NOTICE

#### Dry running bearings

Bearings can be damaged if they do not have sufficient grease.

- Re-grease the bearings if they have been out of service for more than one year. The shaft must rotate so that the grease can be distributed in the bearings. Observe the data on the lubricant plate.

Chapter AUTOHOTSPOT.

 **WARNING**

**Explosion hazard**

If the anti-condensation heating is switched on directly after the machine is switched off, the temperature class or the maximum surface temperature of the machine can be exceeded.

In an explosive atmosphere, there is a risk of an explosion. This can result in death, serious injury or material damage.

- Only switch on the anti-condensation heating after the motor has been switched off. Carefully comply with the data on the anti-condensation heating plate.

### 8.5.1 Avoidance of damage to rolling bearings during stoppages

Extended stoppages at the identical or almost identical resting position of the rotor in the rolling bearings can result in damage, such as brinelling or corrosion.

- During stoppages, regularly start up the machine for a brief period once a month. As a minimum, turn the rotor several times.

If you have uncoupled the machine from the driven machine and secured the rotor with a rotor shipping brace, then remove this before turning the rotor over or starting up the machine.

Make sure that the resting position of the rotor after the rotor has been turned over is different from its previous position. Use the fitted key or the coupling halves as reference markers.

- During recommissioning, refer to the information in Chapter "Commissioning".

### 8.5.2 Decommissioning the machine

- Record the decommissioning steps. This log will be useful upon recommissioning.
- If the machine is going to be out of service for longer than six months, then take the necessary measures for preservation and storage. Otherwise, the machine could be damaged as a result of not being operated.

### 8.5.3 Re-commissioning the machine

When you re-commission the machine, proceed as follows:

- Study the record made when the machine was decommissioned, and reverse the measures that were taken for conservation and storage.
- Perform the measures listed in the "Commissioning" section.

#### See also

Commissioning (Page 87)

## 8.6 faults

### 8.6.1 Inspections in the event of faults

Natural disasters or unusual operating conditions, such as overloading or short circuit, are faults that overload the machine electrically or mechanically.

Immediately perform an inspection after such faults.

Correct the cause of the fault as described in the respective remedial measures section. Repair any damage to the machine.

### 8.6.2 Electrical faults

#### Note

If you are operating the motor with a converter, the operating instructions of the converter must also be observed if electrical faults occur.

Table 8- 1 Electrical faults

↓ Motor fails to start							
↓ Motor accelerates sluggishly							
↓ Rumbling noise during startup							
↓ Rumbling noise during operation							
↓ High temperature rise during no-load operation							
↓ High temperature rise with load							
↓ High temperature rise of individual winding sections							
						Possible causes of faults	Remedial measures
X	X		X		X	Overload	Reduce the load.
X						Interrupted phase in the supply cable	Check the switches and cables.
	X	X	X		X	Interrupted phase in the feeder cable after switching on	Check the switches and cables.
	X					Mains voltage too low, frequency too high	Check the power supply conditions.
				X		Mains voltage too high, frequency too low	Check the power supply conditions.
X	X	X	X		X	Stator winding incorrectly connected	Check the winding connection in the terminal box.
	X	X	X		X	Winding short circuit or phase short circuit in stator winding	Determine the winding resistances and insulation resistances. Carry out repair work <b>after consultation with the manufacturer</b> .
					X	Incorrect direction of rotation	Check the connection.

### 8.6.3 Mechanical faults

Table 8- 2 Mechanical faults

↓ Grinding noise				
		↓ Radial vibrations		
		↓ Axial vibrations		
		Possible causes of faults	Remedial measures	
X		Rotating parts grind	Establish the cause and realign the parts.	
	X	Stator or coupling not balanced.	Disconnect the stator or coupling and rebalance. If the machine has two shaft ends, and a transmission element is only fitted to one end, secure the fitted key at the other end to prevent it from being thrown out. If the rotor has balance type "H" (standard type), the fitted key must be cut back to roughly half of its length.	
	X	Rotor out of true, shaft bent	Consult the manufacturing plant.	
	X	X	Poor alignment	Align the machine set; check the coupling. <sup>(1)</sup>
	X		Coupled machine not balanced	Rebalance the coupled machine.
		X	Shocks from coupled machine	Investigate the coupled machine.
	X	X	Uneven running of gear unit	Fix the gearing.
	X	X	Resonance of the overall system comprising motor and foundation	Stabilize the foundation following consultation.
	X	X	Changes in foundation	Establish the cause of the changes and eliminate them if necessary; realign the machine.

<sup>(1)</sup> Take any changes into account when warming up the machine.

## 8.6.4 Rolling bearing faults

Damage to rolling bearings can be difficult to detect in some cases. If in doubt, replace the rolling bearing. Use other bearing designs only **after consulting the manufacturer**.

Table 8- 3 Rolling bearing faults

↓ Bearing overheats			
↓ Bearing "whistles"			
↓ Bearing "knocks"			
		Possible causes of faults	Remedial measures
X		High coupling pressure	Align the machine more accurately.
X		Belt tension too high	Reduce the drive belt tension.
X		Bearing contaminated	Clean or replace the bearing. Check the seals.
X		High ambient temperature	Use a suitable high-temperature grease.
X	X	Insufficient lubrication	Grease the bearings as instructed.
X	X	Bearing canted	Contact the service center.
X	X	Insufficient bearing play	Contact the service center.
	X	Excessive bearing play	Contact the service center.
X	X	Bearing corroded	Replace the bearing. Check the seals.
X		Too much grease in bearing	Remove surplus grease.
X		Wrong grease in the bearing	Use the correct grease.
	X	Friction marks on raceway	Replace the bearing.
	X	Brinelling or scoring	Replace the bearing. Avoid any vibration at standstill

## 8.6.5 Faults at the external fan

The following table shows the possible causes of and remedial measures for faults on forced-ventilated machines.

Table 8- 4 Cooling system faults

↓ High temperature rise with load		
	Possible causes of faults	Remedial measures
X	Wrong direction of rotation of the external fan	Check the electrical connections to the external fan.
X	External fan is not running	Check the external fan and its connections.
X	Reduced air flow	Check the air ducts; clean the machine.

## 8.7 Deactivating

Commission any devices provided for protection against condensation after switching off the machine.





# Maintenance

Through careful and regular maintenance, inspections, and overhauls you can detect faults at an early stage and resolve them. This means that you can avoid consequential damage.

Operating conditions and characteristics can vary widely. For this reason, only general maintenance intervals can be specified here. Maintenance intervals should therefore be scheduled to suit the local conditions (dirt, starting frequency, load, etc.).

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.

Comply with the IEC / EN 60079-17 standard during all service and maintenance work on the machine.

---

## Note

Please contact the service center (Page 163), if you require support with service, maintenance or repair.

---

## 9.1 Preparation and notes

### 9.1.1 North American market (optional)

When making changes or repairs, maintain the corresponding design standards! These machines are labeled on the rating plate with the following markings.



Underwriters Laboratories



Canadian Standard Association



Canadian Standard Association Energy Efficiency Verification

### 9.1.2 Customs union Eurasia (optional)

When making changes or repairs, maintain the corresponding design standards! These machines are labeled on the rating plate with the following markings.




Customs union Eurasia  
Eurasian customs union





Explosion-protected

## 9.2 Inspection and maintenance

### 9.2.1 Safety instructions for inspection and maintenance

 <b>WARNING</b>
<b>Rotating and live parts</b> Electric machines contain live and rotating parts. Fatal or serious injuries and substantial material damage can occur if maintenance work is performed on the machine when it is not stopped or not de-energized. <ul style="list-style-type: none"><li>• Perform maintenance work on the machine only when it is stopped. The only operation permissible while the machine is rotating is regreasing the rolling bearings.</li><li>• When performing maintenance work, comply with the five safety rules (Page 12).</li></ul>

 <b>WARNING</b>
<b>Machine damage</b> If the machine is not maintained it can suffer damage. This can cause faults which can result in eventual or immediate death, serious injury or material damage. Perform regular maintenance on the machine.

 <b>CAUTION</b>
<b>Dust disturbances when working with compressed air</b> When cleaning with compressed air, dust, metal chips, or cleaning agents can be whirled up. Injuries can result. When cleaning using compressed air, make sure you use suitable extraction equipment and wear protective equipment (safety goggles, protective suit, etc.).

**NOTICE****Damage to insulation**

If metal swarf enters the winding head when cleaning with compressed air, this can damage the insulation. Clearance and creepage distances can be undershot. This may cause damage to the machine extending to total failure.

When cleaning with compressed air, ensure there is adequate extraction.

**NOTICE****Machine damage caused by foreign bodies**

Foreign bodies such as dirt, tools or loose components, such as screws etc., can be left by accident inside the machine after maintenance is performed. These can cause short circuits, reduce the performance of the cooling system or increase noise in operation. They can also damage the machine.

- When carrying out maintenance work, make sure that no foreign bodies are left in or on the machine.
- Securely attach all loose parts again once you have completed the maintenance procedures.
- Carefully remove any dirt.

**Note**

Operating conditions and characteristics can vary widely. For this reason, only general intervals for inspection and maintenance measures can be specified here.

## 9.2.2 Explosion hazard due to increased surface temperature

 **WARNING**
**Explosion hazard due to increased surface temperature**

Components within the motor may be hotter than the maximum permissible surface temperature for the enclosure. In an explosive atmosphere, dust can ignite and an explosion occur. This can result in death, serious injury or material damage.

- Do not open the motor in an explosive and dusty atmosphere when it is still at normal operating temperature.
- Allow the machine to cool down before opening it.

 **WARNING**

**Explosion hazard due to overheating of the machine caused by a layer of dust**

Layers of dust thicker than 5mm can insulate the machine, resulting in overheating. The maximum surface temperature of the machine cannot be adhered to. The dust can ignite, resulting in an explosion. This can result in death, serious injury or material damage.

- Dust the machine regularly.
- Do not allow dust layers thicker than 5 mm to build up on the machine surface.
- Do not switch the machine on until the dust has been removed.

 **WARNING**

**Risk of explosion due to excessive bearing temperature**

The surface temperature cannot be maintained within maximum permissible limits if the bearing becomes too hot. The dust can ignite, resulting in an explosion. This can result in death, serious injury or material damage.

- Always check the bearing temperature.
- In addition to the current-dependent overload protection device located in the three phases of the connecting cable, we recommend that you also monitor the temperature rise in the motor with the aid of the temperature sensors built into the stator winding.

### 9.2.3 Static charging when cleaning

#### Risk of explosion due to static charging

If you clean the motor, plastic components may become statically charged and ignite a potentially explosive atmosphere. An explosion can occur. This can result in death, serious injury or material damage.

- When cleaning ensure that there is **absolutely no** explosive atmosphere present.
- Clean the plastic parts and components so that **absolutely no** static charging occurs
- Do **not** use compressed air for cleaning.

### 9.2.4 Inspections in the event of faults

Natural disasters or unusual operating conditions, such as overloading or short circuit, are faults that overload the machine electrically or mechanically.

Immediately perform an inspection after such faults.

### 9.2.5 First inspection

- Check after approx. 500 operating hours, but after not more than one year:

Check	When the motor is running	At standstill
The electrical parameters are maintained.	X	
The permissible bearing temperatures are not exceeded.	X	
The smooth running characteristics and machine running noise have not deteriorated.	X	
The foundation has no cracks or indentations. (*)	X	X

(\*) You can perform these checks while the motor is at standstill or, if required, while running.

- Further checks may be required if so specified in operating instructions of components or in accordance with the plant-specific conditions.
- If you find any deviations during the inspection, you must rectify them immediately. They may otherwise damage the motor.

### 9.2.6 General inspection

Check that the installation conditions are observed. We recommend that the following checks are performed after approx. 16 000 operating hours or at the latest after two years:

Table 9- 1 Checks that have to be performed during the general inspection

Checking	When the motor is running	At standstill
The electrical parameters are maintained	X	
The permissible bearing temperatures are not exceeded	X	
The smooth running characteristics and machine running noise have not deteriorated	X	
The motor foundation has no cracks and indentations (*)	X	X
The machine is aligned within the permissible tolerance ranges		X
All the fixing bolts/screws for the mechanical and electrical connections have been securely tightened		X
All the potential connections, grounding connections and shield supports are correctly seated and properly bonded		X
The winding insulation resistances are sufficiently high		X
Any bearing insulation is fitted as shown on the plates and labels		X
The CABLES and insulating parts and components are in good condition and there is no evidence of discoloring		X

(\*) You can perform these checks while the motor is at standstill or, if required, while running.

**NOTICE**

**Machine damage**

When carrying out the inspection, if you detect any impermissible deviations from the normal state, you must rectify them immediately. They may otherwise cause damage to the machine.

### 9.2.7 Assessing the rolling bearings

To assess the rolling bearings, it is generally not necessary to dismantle the machines. The motor only has to be dismantled if the bearings are to be replaced.

The state of a rolling bearing can be assessed by analyzing the bearing vibration. The measured values provide an indication and can be assessed by specialists. In this case, please contact the Service Center.

### 9.2.8 Mechanical explosion protection for rolling bearings

All machines marked in accordance with Directive 2014/34/EU ("Explosion Protection Directive") must be regularly inspected for mechanical damage which could constitute a risk of ignition in accordance with IEC/EN 60079-17 .

- Comply with the following intervals:
  - Bearing replacement intervals
  - Relubrication intervals
  - Grease replacement intervals
  - Oil change intervals
- Rolling bearing service life
  - Replace the rolling bearings once the nominal service life is reached. Alternatively, you can verify they are free of mechanical damage as part of an inspection.
  - In the case of rolling bearings without a regreasing system, it is ensured that the nominal service life will only be achieved clearly after achievement of the service life of the grease in the bearings.
  - The rolling bearing service life under full specified load is at least 20 000 hours for machines subject to radial or axial forces.
  - The nominal rolling bearing service life of machines which are not subject to any forces is at least 40 000 hours.
- For rolling bearings with external oil supply, monitor that lubrication is maintained.

## 9.2.9 Maintenance intervals

Please note the following in order to identify faults at an early stage, rectify them and avoid follow-on damage:

- Maintain the machine regularly and carefully.
- Inspect the machine.
- Motors must be allocated a revision/inspection number after inspection.

### NOTICE

#### Motor failure

Material damage can occur if the machine develops faults or is overloaded.

- Immediately inspect the machine if faults occur.
- An immediate inspection is especially necessary, if the three-phase motor is excessively stressed, either electrically or mechanically (e.g. overload or short-circuit).

The machines are equipped with permanently lubricated rolling bearings. The machine may be equipped with a regreasing device.

### CAUTION

#### Skin irritations and eye inflammations

Many greases can cause skin irritations and eye inflammations.

- Follow all safety instructions of the manufacturer.

### Measures, intervals and deadlines

Measures after operating period intervals or deadlines have elapsed:

Operating situations and characteristics can vary widely. For this reason, only general maintenance intervals are specified here. Maintenance intervals should therefore be scheduled to suit the local conditions (dirt, starting frequency, load, etc.).

Table 9- 2 Operating period intervals

Measures	Operating period intervals	Intervals
Initial inspection	After 500 operating hours	After 1/2 year at the latest
Relubrication (optional)	See the lubricant plate	
Clean	Depending on the degree of pollution	
Main inspection	Approximately every 16000 operating hours	After two years at the latest
Drain condensate	Depending on the climatic conditions	

### 9.2.10 Re-greasing

For machines with regreasing system, relubrication intervals, grease quantity and grease grade are provided on the lubricant plate. Additional data can be taken from the main machine rating plate.

Grade of grease for standard motors (IP55) UNIREX N3 - ESSO.

---

#### Note

It is not permissible to mix different types of grease.

---

Prolonged storage periods reduce the useful lifetime of the bearing grease. Check the condition of the grease if the equipment has been in storage for more than 12 months. If the grease is found to have lost oil content or to be contaminated, the machine must be immediately relubricated before commissioning. For information on permanently-greased bearings, please refer to the section titled Rolling bearings (Page 127).

#### Procedure

To relubricate the rolling bearings, proceed as follows:

1. Clean the grease nipples at the drive end and non-drive end.
2. Press-in the specified grease and amount of grease according to the data stamped on the lubrication plate.
  - Please observe the information on the rating and lubricant plates.
  - Regreasing should be carried out when the motor is running (max. 3600 rpm).

The bearing temperature can rise significantly at first, and then drops to the normal value again when the excess grease is displaced out of the bearing.

 <b>WARNING</b>
<b>Rotor can fall out</b>
If the machine is in a vertical position, the rotor can fall out while work is being performed on the locating bearing. This can result in death, serious injury or material damage.
Support or relieve the rotor when carrying out work with the machine in a vertical position.



## 9.2.11 Cleaning

### Cleaning the grease ducts and spent grease chambers

The spent grease collects outside each bearing in the spent grease chamber of the outer bearing cap. When replacing bearings, remove the spent grease.

---

#### Note

Dismantle the bearing cartridges to replace the grease in the lubrication duct.

---

### Cleaning the cooling air ducts

Regularly clean the cooling air ducts through which the ambient air flows.

The frequency of the cleaning intervals depends on the local degree of fouling.

<b>NOTICE</b>
<b>Damage to the machine</b>
Material damage can occur if you direct compressed air in the direction of the shaft outlet or machine openings.
<ul style="list-style-type: none"> <li>• Avoid pointing compressed air directly onto shaft sealing rings or labyrinth seals of the machine.</li> </ul>



---

#### Note

Please note the safety instructions for cleaning (Page 97).

---

## 9.2.12 Risk of explosion due to damaged seals

 <b>WARNING</b>
<b>Risk of explosion due to damaged seals</b>
The seals can be damaged if you clean motors with type of protection Ex t using compressed air. The type of protection is no longer complied with. An explosion can occur. This may result in death, personal injury and material damage.
<ul style="list-style-type: none"> <li>• Avoid pointing compressed air directly onto shaft sealing rings or labyrinth seals of the machine.</li> </ul>

### 9.2.13 Drain condensate

If there are condensation drain holes present, open these at regular intervals, depending on climatic conditions.



#### **! WARNING**

##### **Hazardous voltage**

The winding can be damaged if objects are introduced into the condensation holes (optional). This can lead to death, serious injury or material damage.

Note the following to maintain the degree of protection:

- Switch off the machine so that it is in a no-voltage condition before you open the condensation drain holes.
- Close the condensation drain holes, e.g. using T-plugs, before commissioning the machine.

#### **NOTICE**

##### **Reduction of the degree of protection**

If condensation drain holes are not closed, then this can result in material damage to the motor.

In order to maintain the degree of protection, after the condensation has been drained, you must close all of the drain holes.

### 9.2.14 Insulation resistance and polarization index

Measuring the insulation resistance and polarization index (PI) provides information on the condition of the machine. It is therefore important to check the insulation resistance and the polarization index at the following times:

- Before starting up a machine for the first time
- After an extended period in storage or downtime
- Within the scope of maintenance work

The following information is provided regarding the state of the winding insulation:

- Is the winding head insulation conductively contaminated?
- Has the winding insulation absorbed moisture?

As such, you can determine whether the machine needs commissioning or any necessary measures such as cleaning and/or drying the winding:

- Can the machine be put into operation?
- Must the windings be cleaned or dried?

Detailed information on testing and the limit values can be found here:

"Testing the insulation resistance and polarization index" (Page 90)

## 9.2.15 Maintaining the external fan (forced ventilation)



### WARNING

#### Rotating or live parts

Live electrical parts are dangerous. Contact with them can cause death, serious injury or material damage.

Before performing any maintenance work on the external fan, disconnect it from the mains, particularly before opening the terminal box. Make sure that the device cannot be switched back on.

### Servicing the external fan

The external fan is essentially maintenance-free. However, dirt and dust deposits on the impeller and the motor, particularly in the gap between the impeller and the inlet nozzle can impair its function.

- Remove the dirt and dust deposits regularly; the intervals depend on how dirty the surrounding area is.
- Make sure that the impeller is evenly cleaned, as irregular deposits can lead to an imbalance.  
The full flowrate is only achieved if the inward flow of air to the impeller is unrestricted.

### Servicing the external fan motor


Please observe all specifications and intervals in the operating instructions for the external fan motor. If a **SIMOTICS XP** 1MB1.5/1MB5.5 low-voltage motor is used as an external fan motor, these operating instructions also apply for the external fan motor.

To avoid unnecessary downtimes, always carry out all inspection and maintenance work on the main and external fan motor simultaneously.

- Perform an occasional visual inspection of the external fan motor and check it electrically and mechanically every time the rolling bearings are replaced.
- Replace permanently lubricated rolling bearings in the external fan motor as specified in the operating instructions for the external fan motor.

## 9.2.16 Repainting

### 9.2.16.1 Paint finish resistant to sea air

 <b>WARNING</b>
<b>Risk of explosion as a result of processes with high levels of electrostatic charging</b>
Carefully observe the appropriate precautionary measures in order to avoid death or severe injury.
For paint finish "resistant to sea air" (C4 according to EN ISO 12944-2) for motors belonging to explosion group III, processes that generate significant levels of electrostatic discharge are absolutely not permissible. Paint can be electrostatically charged as a result of intensive dust turbulence or processes with high levels of electrostatic charging. Electrostatic discharges can occur. Minimize the risk of electrostatic charging by applying the following effective measures.
<ul style="list-style-type: none"><li>• Increase the conductivity of bulk goods and plant/system parts, e.g. by applying an appropriate coating or paint finish.</li><li>• Increase the humidity or ionization.</li><li>• Reduce the amount of fine particles in bulk goods, e.g. resulting from abrasion.</li><li>• Restrict the degree of dispersion, e.g. by selecting plug conveying instead of dilute phase conveying.</li><li>• Reduce the flow rate, the mass flow rate or the air velocity.</li><li>• Avoid large heaps of bulk goods.</li><li>• Transport using gravity is the preferred choice rather than pneumatic transport.</li><li>• When pneumatically transporting bulk goods, use conductive hoses in order to avoid electrostatic discharge.</li></ul>
Additional measures are listed in IEC 60079-32-1.

### 9.2.16.2 Touch up any damaged paintwork

If the paint is damaged, it must be repaired in order to protect the unit against corrosion.

---

#### Note

#### Paint system

Contact the Service Center (Page 163) before you repair any damage to paint. They will provide you with more information about the correct paint system and methods of repairing paint damage.

---

**⚠ WARNING****Explosion hazard caused by incorrect painting**

The paint coat can become electrostatically charged where there is a thick coat. Electrostatic discharges can occur. There is a risk of explosion if potentially explosive mixtures are also present at this moment. This can result in death, serious injury or material damage.

You must comply with one of the following requirements when you repaint painted surfaces:

- Limit the total paint film thickness according to the explosion protection group:
  - IIA, IIB: Total paint coating thickness  $\leq 2$  mm
  - IIC: Overall coating thickness  $\leq 0.2$  mm for motors of group II (gas)
- Limit the surface resistance of the paint used:
  - Surface resistance  $\leq 1$  G $\Omega$  for motors of groups II and III (gas and dust)
- Charge transfer limit
  - 60 nC for Group I or Group IIA devices
  - 25 nC for Group IIB devices
  - 10 nC for Group IIC devices
  - 200 nC for Group III devices (values not valid for strongly charge generating processes)
- Breakdown voltage  $\leq 4$  kV for explosion group III (gas and dust)

**⚠ WARNING****Risk of explosion as a result of processes with high levels of electrostatic charging**

For paint finishes in explosion group III, the paint can be electrostatically charged as a result of intensive dust turbulence or processes with high levels of electrostatic charging. Electrostatic discharges can occur. Minimize the risk of electrostatic charging by applying effective measures according to IEC 60079-32-1. This can result in death, serious injury or material damage.

**Note**

Paint finishes for IIC are optionally available with more than 200  $\mu\text{m}$  coat thickness. Paint finishes exceeding 200  $\mu\text{m}$  are tested with respect to electrostatic charging. Motors with a coating thickness exceeding 200  $\mu\text{m}$  may only be painted over if the conditions mentioned above are complied with.

**Suitability test of the paint system for hazardous areas**

Suitability certificates for the electrostatic suitability on explosion-protected machines are available for paint systems ordered as standard. These certificates are not available for non-standard or customized paint systems. Take into consideration that the provided evidence is not valid for repaintings.

## 9.3 Corrective maintenance

Observe the following when carrying out any work on the machine:

- Comply with the general safety instructions (Page 11)
- Comply with the applicable national and sector-specific regulations.
- When using the machine within the European Union, comply with the specifications laid down in EN 50110-1 regarding safe operation of electrical equipment.

If the motor has to be transported, please observe the information and instructions in the chapter "Transport (Page 34)".

### 9.3.1 Extended motor marking

The machine marking based on IEC / EN 60079–0 was supplemented by the "X" symbol.

- Maintain the special conditions for repairs. The gap dimensions for the electric machine **do not** comply with the standardized values in IEC / EN 60079–1. For repair work, obtain the gap dimensions of the electrical machine from the manufacturer.
- Perform maintenance, repair and modification work on explosion-protected machines in strict compliance with the corresponding national health and safety legislation, the safety instructions and descriptions in the general maintenance instructions.

Have work influencing explosion protection performed by the manufacturer or by a specialist workshop for electrical machinery authorized by the manufacturer. This includes the following operations, for example:

- Repairs to the stator or rotor windings and to the terminals
- Repairs to the ventilation system
- Repairs to the bearings
- Dismantling machines with flameproof enclosures
- Connection work performed in the terminal box

Identify the work performed by an additional repair plate bearing the following information:

- Date
- Company carrying out repair
- Type of repair
- Reference number of the repair technician regarding repair work

Test in accordance with the relevant EU directives after repair.

 **WARNING**

**Risk of explosion due to alteration of the ignition gap geometry**

Changing ignition gap geometries (gap dimensions) as part of repair work according to the minimum specifications of IEC / EN 60079-1 is not permissible.

This can result in death, serious injury or material damage.

- Obtain the gap dimensions of the electrical machine from the manufacturer for the repair or restoration of ignition gap geometries.

Comply with the IEC / EN 60079-17 standard during all service and maintenance work on the machine.

### Risk of explosion as a result of inadmissible repair work

Repairs are only permissible within the scope of the work described in these operating instructions. Otherwise an explosion can occur in an explosive atmosphere. This can result in death, serious injury or material damage.

- For repairs to go beyond this scope, please contact the Service Center.

 **WARNING**

**Explosion hazard due to increased surface temperature**

Components within the motor may be hotter than the maximum permissible surface temperature for the enclosure. In an explosive atmosphere, dust can ignite and an explosion occur. This can result in death, serious injury or material damage.

- Do not open the motor in an explosive and dusty atmosphere when it is still at normal operating temperature.
- Allow the machine to cool down before opening it.

## 9.3.2 Anti-condensation heating

### Explosion hazard due to improper maintenance of the anti-condensation heating

If the anti-condensation heating is not correctly repaired, e.g. if unauthorized or untested spare parts are used, this can result in explosions during operation in a potentially explosive atmosphere. This can result in death, serious injury or material damage.

- Only appropriately trained specialists in the service center (Page 163) are authorized to repair anti-condensation heating systems. The anti-condensation heating must then be subject to a routine test, which requires extensive specialist knowledge.
- Only use authorized and tested spare parts.

 **WARNING**

**Explosion hazard due to improper maintenance**

If repairs to the anti-condensation heating are not carried out correctly, e.g. if unauthorized or untested spare parts are used, this can result in explosions during operation in a potentially explosive gaseous atmosphere. This can result in death, serious injury, or material damage.

- Repairing and mounting the anti-condensation heating and the subsequent routine testing must always be undertaken by experts from the service center (Page 163), because this work requires extensive specialist knowledge.
- Only authorized and tested spare parts may be used.

---

**Note**

Before commencing removal, you should mark how each of the fastening elements has been assigned, as well as how internal connections are arranged. This simplifies subsequent reassembly.

---

If possible, assemble the machine on an alignment plate. This ensures that the mounting feet surfaces are all on the same plane.

Avoid damaging the windings protruding out of the stator enclosure when assembling the end shield.

### 9.3.3 Sealing measures

#### Sealing measures

1. For 1MB10, shaft heights 100...160, apply the appropriate liquid sealant, e.g. Fluid-D or Hylomar to the centering edge.
2. Check the terminal box seals, and if required, replace these.
3. Repair any damage to the paint, also to screws/bolts.
4. Take the necessary measures to ensure compliance with the applicable degree of protection.
5. Do not forget the foam rubber cover in the cable entry. Completely seal the holes, and ensure that cables do not come into contact with sharp edges.



### 9.3.4 Rolling bearings

Refer to the rating plate or the catalog for the designations of the bearings being used.

#### Bearing lifetime

Prolonged storage periods reduce the useful lifetime of the bearing grease. For permanently lubricated bearings, this reduces the bearing service life.

We recommend that the grease is replaced after a storage time of 12 months. Replace greased bearings also in the case of closed bearings (suffix 2Z or 2 RS). After 4 years in storage, generally replace all rolling bearings and grease.

#### Replacing bearings

Recommended interval after which bearings are to be replaced under normal operating conditions:

Table 9- 3 Bearing replacement intervals

Ambient temperature	Principle of operation	Bearing replacement intervals
40 °C	Horizontal coupling operation	40 000 h
40 °C	With axial and radial forces	20 000 h

- Do not reuse bearings that have been removed.
- Remove the dirty spent grease from the bearing shield.
- Replace the existing grease with new grease.
- Replace the shaft seals when the bearings are replaced.
- Slightly grease the contact surfaces of the sealing lips.



---

#### Note

##### Special operating conditions

The operating hours are reduced, e.g.

- When machines are vertically mounted.
  - High vibration and surge loads
  - Frequent reversing operation
  - Higher ambient temperatures.
  - High speeds etc.
-

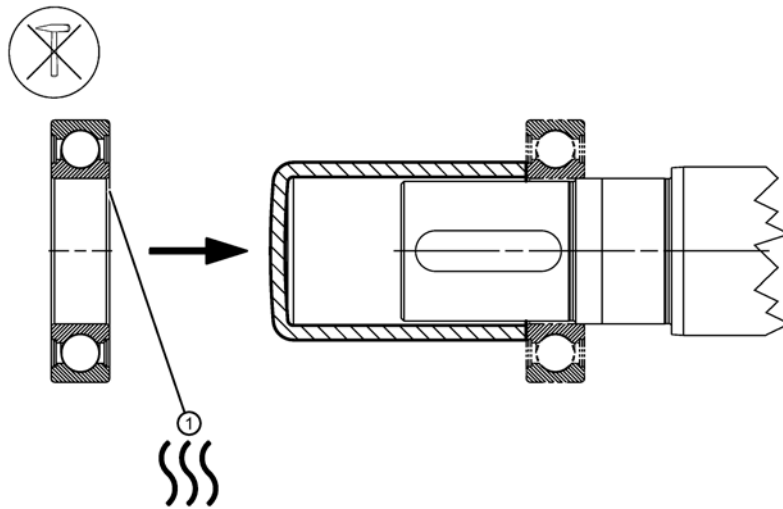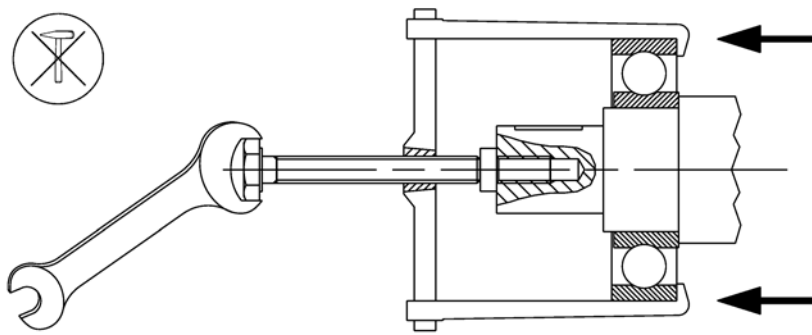

① Heat up 80 ... 100 °C

#### 9.3.4.1 Replacing bearings in explosion-proof machines

- When changing the bearings, renew the sealing rings and only use original Siemens spare parts.
- For radial sealing rings with dust protection lip (DIN 3760-AS), completely fill the spaces (100%) in the sealing ring as well as in the bearing shield hub with a suitable grease.

#### 9.3.4.2 Bearing bushes

Protect the bearings against the ingress of dirt and moisture.

### 9.3.4.3 Fitting bearings

#### Sealing the bearings

Note the following details:

- Shaft sealing rings are used to seal machines at the rotor shaft.
  - For V rings, comply with the assembly dimension.
- Use the specified bearings.
- Ensure that the bearing sealing disks are in the correct position.
- Insert the elements for bearing preloading at the correct end.
- Fixed bearings can have a locking ring or bearing cover.
- Seal the bearing cap screws with the appropriate gaskets or with grease.
- Do not interchange the position of the bearing covers (DE and NDE or inner and outer).

 <b>WARNING</b>
<b>Rotor can fall out</b>
If the motor is in a vertical position, the rotor can fall out while work is being performed on the locating bearing. This can result in death, serious injury or damage.
<ul style="list-style-type: none"><li>• Support or unload the rotor when carrying out work with the machine in a vertical position.</li></ul>



#### Bearing seals for explosion-protected machines

---

**Note****Bearing seals for explosion-protected machines**

For explosion-protected machines, only use the original replacement and repair parts.

---

#### Fitting the bearing cartridges

When fitting the bearing cartridges, observe the specified screw tightening torques (Page 133).

### Installing rolling bearings

- Extreme caution and attention to cleanliness are vital when installing rolling bearings. Observe the correct assembly sequence of the components.
- Attach all components with the specified tightening torques (Page 165).

---

#### Note

For further information about mounting the rolling bearing, please refer to the catalog or the information provided by the rolling bearing manufacturer.

---

### Procedure

1. Replace the damaged components.
2. Remove any dirt from the components. Remove any grease and the remains of sealant or liquid threadlocker.
3. Prepare the bearing seats:
  - Lightly oil the inner ring seat.
  - Grease the outer ring seat with a solid lubricant such as Altemp Q NB 50.
  - Press the inner bearing cover onto the shaft.
4. Warm up the rolling bearing.
5. Push the inner ring of the warmed up rolling bearing onto the shaft. Avoid any blows that might damage the bearing.
6. Make sure that the rolling bearing is resting against the shaft shoulder or the second bearing.
7. Fill the bearing to the top with the specified lubricating grease as stamped on the lubricant plate.
8. Warm up the grease slinger and push it onto the shaft.
9. Depending on the particular version, fix the bearing with a locking ring or shaft nut.
10. Support the rotor when installing the bearing housing or bearing end shield.
11. Use a suitable sealant when assembling.
12. Assemble the bearing shield or bearing housing together with the bearing shield.
13. Install the outer bearing cover if one is being used.
14. Install the sealing elements:

#### 9.3.4.4 Insulated roller bearings

If insulated rolling bearings are fitted, use insulated rolling bearings of the same type as spare parts. This will prevent any bearing damage being caused by bearing currents.



**! WARNING****Explosion hazard due to overheating of the rolling bearings**

If the rolling bearings are not regularly regreased, local overheating may be possible, and, as a consequence, an explosion in an explosive atmosphere. This can result in death, serious injury, or material damage.

- Regrease the rolling bearings regularly according to the lubrication plate.
- Implement bearing temperature monitoring if not yet in existence.

**9.3.5 Mounting dimension "x"**

Mounting dimension "x" of V rings

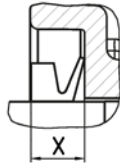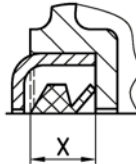Shaft height	x mm	
71	4.5 ±0.6	<b>Standard design</b>  <b>Special design</b> 
80 ... 112	6 ±0.8	
132 ... 160	7 ±1	
180 ... 200 (1LA, 1MA)		
180 ... 225	11 ±1	
250 ... 355	13.5 ±1.2	

**9.3.6 Fan****NOTICE****Destruction of the fan**

Material damage can occur by forcefully removing the fan from the shaft.

Take care not to damage the snapping mechanisms on fans that are equipped with these.

**Plastic fan**

- Correctly expose the breakout openings provided in the fan plate.
- Heat up the fans to a temperature of approximately 50° C around the area of the hub.

- Use a suitable tool to pull off the fan (puller).
- Locate the arms of the pulling tool in the breakout openings and slightly tension the pressure screw of the tool.
- For fans with snapping mechanisms, simultaneously release the two snap-in lugs of the fan from the annular shaft groove.  
Keep the snap-in lugs in this position.
- Uniformly withdraw the fan from the shaft by turning the pressure screw of the pulling tool.
- Do not apply any hammer blows to avoid damaging the rotor shaft, the fan and the bearings.
- Order the appropriate new parts if damaged.

### 9.3.6.1 Metal fan disassembly

#### Metal fan

- Remove the locking ring.
- Use a suitable tool to pull off the fan (puller).
- Locate the arms of the pulling tool in the openings in the fan in the vicinity of the hub.
- Alternatively, place the pulling tool at the outer edge of the fan plate.
- Uniformly withdraw the fan from the shaft by turning the pressure screw of the pulling tool.
- Do not apply any hammer blows to avoid damaging the rotor shaft, the fan and the bearings.
- Order the appropriate new parts if damaged.

### 9.3.6.2 Mounting fans

- Take care not to damage the snapping mechanisms on fans that are equipped with these.
- To ensure this, the fans should be heated to a temperature of approximately 50 °C around the area of the hub.
- If any damage is caused, request new parts.

### 9.3.7 Cable entries, sealing plugs and thread adapters

All cable entries and sealing plugs must be approved for use in the respective hazardous zone.

- Any openings that are not being used must be sealed using the appropriate certified sealing plugs.
- Please observe the manufacturer's specifications when fitting cable entries.

Note the following when mounting:

- Avoid damaging the cable jacket.
- Adapt the tightening torques to the cable jacket materials.

Observe the documentation for tightening torques of the cable entries and sealing plugs for direct mounting at the machine as well as additional glands (e.g. adapters).

### 9.3.8 Terminal boxes, end shields, grounding conductors, sheet metal fan covers

If no other tightening torques are specified, then the values in the following table apply.

Table 9- 4 Tightening torques for screws on the terminal box, end shields, screw-type grounding conductor connections

Thread Ø		M 3.5	M 4	M 5	M 6	M 8	M 10	M 12	M 16	M20
Nm	min	0.8	2	3.5	6	16	28	46	110	225
	max	1.2	3	5	9	24	42	70	165	340

### 9.3.9 Terminal board and grounding

Table 9- 5 Tightening torques for electrical connections on the terminal board and grounding

Thread Ø		M 3.5	M 4	M 5	M 6	M 8	M 10	M 12	M 16
Nm	min	0.8	0.8	1.8	2.7	5.5	9	14	27
	Max.	1.2	1.2	2.5	4	8	13	20	40

### 9.3.10 Screw lock washers

Nuts or bolts that are mounted together with locking, resilient and/or force-distributing elements (e.g., safety plates, spring-lock washers, etc.) must be refitted together with identical, fully functional elements.

Locking and sealing elements must always be replaced!

### 9.3.11 Links

- Replace any corroded screws.
- Take care not to damage the insulation of live parts.
- Document the position of any rating and supplementary plates that have been removed.
- Avoid damaging the centering edges.

### 9.3.12 Reassembly: Miscellaneous information

- Position all rating and supplementary plates as in the original state.
- Where relevant, fix electric cables.
- Check the tightening torques of all screws, as well as those of screws that have not been released.

### 9.3.13 Optional add-on units

You can find additional operating instructions here: Service and support (Page 163)

### 9.3.14 O-ring seal

If O-ring seals are present, you should check that they are in perfect condition and that the O-ring seals are properly seated in the grooves between the components. Replace damaged O-ring seals.

O-ring seals can be present on the following components, for instance:

- Adapters, tapers
- Entries, glands
- Bearing seals
- End shield seals
- Terminal box sealing
- etc.



## Spare parts

### 10.1 Parts order

In addition to the exact part designation, please specify the machine type and the serial number of the machine in all orders for spare parts and repair parts. Ensure that the part designation is the same as that in the parts list, and make sure you also use the associated part number.

When spare and repair parts are ordered, the following details must be provided:

- Designation and part number
- Order number and serial number of the machine

The machine type and serial number can be found on the rating plate.

#### See also

Spares On Web (<https://www.sow.siemens.com/>)

### 10.2 Data matrix code on the machine

#### Data matrix code

A data matrix code is provided as adhesive label for motors manufactured in Europe. You can retrieve the following information from the data matrix code:

- Machine type
- Serial number
- Customer material number, if ordered as option Y84

### 10.3 Ordering data

---

#### Note

The graphical representations in this chapter show schematic diagrams of the basic versions. They are used for spare parts definitions. The supplied version may differ in details from these representations.

---

## 10.4 Purchasing commercially available spare parts

 **WARNING**

**Explosion hazard due to unsuitable spare parts**

If you use parts other than the original spare parts, the type of protection can no longer be guaranteed. This can result in an explosion during operation in a potentially explosive atmosphere. This can result in death, serious injury, or material damage.

- Use only original spare parts for explosion-proof machines, including components, such as seals, terminals, cables, and cable entries. If you have any questions, please contact the service center (Page 163).
- Commercially available equivalent standard parts such as screws and bolts may be used.

## 10.5 Ordering spare parts via the Internet

You can use "Spares on Web" to determine the order numbers for motor spare parts quickly and easily.

Spares on Web (<https://www.sow.siemens.com/?lang=en>).



### See also

Guide for Spares on Web ([https://www.weblogx.siemens.de/SoWHilfe\\_HS/motors/en/](https://www.weblogx.siemens.de/SoWHilfe_HS/motors/en/))

## 10.6 Roller bearings

If insulated rolling bearings are fitted, use insulated rolling bearings of the same type as spare parts. This will prevent any bearing damage being caused by bearing currents.

## 10.7 Anti-condensation heating

### WARNING

#### **Explosion hazard due to improper maintenance**

If repairs to the anti-condensation heating are not carried out correctly, e.g. if unauthorized or untested spare parts are used, this can result in explosions during operation in a potentially explosive gaseous atmosphere. This can result in death, serious injury, or material damage.

- Repairing and mounting the anti-condensation heating and the subsequent routine testing must always be undertaken by experts from the service center (Page 163), because this work requires extensive specialist knowledge.
- Only authorized and tested spare parts may be used.

## 10.8 Parts groups definition

**A distinction is made between the following groups of parts:**

### **Spare parts**

Spare parts are machine parts that can be ordered during the production time - and for a further 5 years after discontinuation of production. These parts should only be replaced by authorized service or modification partners.

### **Repair parts**

Repair parts are machine parts that can be supplied during the active production of the machine (until the product discontinuation).

Repair parts are parts used for the repair or modification of the current products. These parts should be replaced only by authorized service or modification partners.

### **Standardized parts**

Standardized parts are machine parts obtained from free trade outlets in accordance with their necessary dimensions, materials and surface finish. A detailed list can be found in the "Standardized parts" section.

### **Other parts**

Other parts are small parts required to complete the exploded drawing. However, these parts cannot be supplied as individual spare or repair parts. The delivery in assembly units (e.g. complete terminal box) is possible on request.

The following supply commitments apply to replacement machines and repair parts following delivery of the motor:

- For up to 3 years after the delivery of the original machine, in the event of total machine failure, Siemens will supply a comparable replacement machine with regard to the mounting dimensions and functions; it is possible that this will involve a new series.
- If a replacement machine is supplied within the 3 year period, this does not mean that the warranty restarts.
- Replacement machines delivered after the active production of the machine series are also identified as spare motors on the rating plate.
- Spare parts are offered only for these spare motors on request; repair and replacement are not possible.
- After a period of 3 years (after the delivery of the original machine), it is only possible to repair these machines (depending on the availability of the spare parts required).
- For up to 5 years after the delivery of the original motor, spare parts will be available and for a further 5 years, Siemens will provide information about spare parts and will supply documents when required.

## 10.9 Ordering example

Table 10- 1 Ordering example

End shield, drive end	1.40 End shield
Machine type *	1MB1543-2BB03-4AA4
Ident: No. *	UC 1706/218923701

\* corresponding to the rating plate

Take the type and serial number from the rating plate and the machine documentation.

When replacing rolling-contact bearings, in addition to the bearing identification code, the replacement code for the bearing version is required. Both of these codes are specified on the rating plate and in the machine documentation. They are also shown on the installed bearings.

The graphical representations in this chapter show schematic diagrams of the basic versions. They are used for spare part definitions. The supplied version may differ in details from these representations.

## 10.10 Machine parts

### 10.10.1 Part lists










 

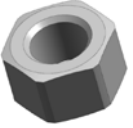

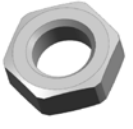

Part	Description	Part	Description
<b>1.00</b>	<b>DE bearings</b>		<b>Terminal box, complete</b>
1.30	Bolt	5.37	Spring lock washer
1.31	Spring lock washer	5.42	Terminal box housing, including seal
1.32	Bolt	5.43	Entry plate
1.33	Nut	5.44	Terminal box upper section
1.40	End shield	5.45	Enclosure
1.43	Shaft sealing ring	5.46	Screw
1.44	Bearing cover DE, inner	5.47	Screw
1.45	Screw (bearing cover)	5.48	Spring lock washer
1.46	Cover ring	5.49	Screw
1.47	O ring	5.51	Flanged nut
1.48	Bolt	5.52	Cable entry
1.49	Bolt	5.53	Screw plugs
1.50	Flanged nut	5.54	O ring
1.56	Spacer washer	5.55	Nut
1.58	Spring washer	5.60	Screw
1.60	Roller bearing	5.61	Screw
1.61	Spring band for end shield hub	5.62	Spring lock washer
1.63	Condensation drain plug	5.63	Mounting rail
1.65	Grease nipple	5.64	Spring lock washer
1.67	Bearing cover NDE, outer	5.65	Bolt
1.68	Grease slinger (optional)	5.68	Screw plugs
1.69	Compression spring	5.69	O ring
<b>3.00</b>	<b>Rotor, complete</b>	5.70	Terminal clamp
3.02	Locking ring	5.72	Contact bracket
3.03	Locking ring	5.76	Terminal plate / contact bracket
3.38	Featherkey	5.78	Spring lock washer
3.88	Featherkey for fan	5.79	Screw
<b>4.00</b>	<b>Stator, complete</b>	5.81	Screw
4.04	Eyebolt	5.82	O ring
4.05	Disk	5.83	Seal
4.07	Housing foot	5.84	Terminal box cover
4.08	Housing foot, left	5.85	Terminal box cover including seal (optional screw)
4.09	Housing foot, right	5.88	Spring lock washer
4.10	Spring lock washer	5.89	Screw
4.11	Bolt	5.90	Upper terminal box section can be rotated 4 x 90 degrees, complete (for subsequent mounting)

Part	Description	Part	Description
4.12	Nut	5.91	Screw
4.18	Rating plate	5.92	Terminal box cover
4.19	Self tapping screw or slotted pin	5.93	Seal
4.20	Cover	5.94	Screw
4.30	Contact bracket	5.95	Terminal box upper section
4.31	Grounding bracket	5.96	Screw plugs
4.35	Disk	5.97	Locknut
4.37	Terminal board	5.98	Sheet metal nut
4.38	Spring lock washer	5.99	Adapter plate
4.39	Grounding stud	<b>6.00</b>	<b>Bearings, NDE</b>
4.40	Disk	6.02	Locking ring
<b>5.00</b>	<b>Terminal box, complete</b>	6.03	Bearing cover NDE, inner
5.02	spacer	6.10	Rolling bearings
5.03	Seal (upper terminal box section)	6.11	Spring band for end shield hub
5.04	Seal (adapter plate)	6.12	Locking ring
5.06	Mounting rail	6.20	End shield
5.08	Spacer sleeve	6.23	Shaft sealing ring
5.09	Bolt	6.25	Lubrication sleeve
5.10	Complete terminal board	6.26	Cover
5.11	Terminal block	6.27	Bearing cover NDE, outer
5.13	Link rail	6.29	Screw
5.15	Plug	6.31	Nut
5.16	Spring locking ring for busbar	6.65	Grease nipple
5.17	Screw	6.67	Rubber bushing
5.18	Spring lock washer	6.66	Screw (bearing cover)
5.19	Bolt	6.72	Grease slinger
5.21	Screw (drilled)	6.74	Sleeve
5.24	Bolt	6.75	Bolt
5.27	Clamp	<b>7.00</b>	<b>Ventilation system, complete</b>
5.28	Upper saddle terminal	7.04	Fan
5.29	Lower saddle terminal	7.12	Locking ring
5.30	Rubber plug	7.40	Fan cover
5.31	Terminal clamp	7.41	bracket
5.32	Bracket	7.47	Sleeve
5.33	Disk	7.48	Disk
5.35	Cable entry	7.49	Bolt
5.36	Spring lock washer		

Tools for mounting and withdrawing roller bearings; fans and output transmission elements cannot be supplied.


## 10.11 Standardized parts

Table 10-2 Purchase standard parts according to dimensions, material and surface properties through normal commercial channels.

No	Standard	Picture	No	Standard	Picture
3.02 6.02 7.12	DIN 471		1.32	DIN 939	
6.12	DIN 472		5.17	EN ISO 4014	
4.04	DIN 580		1.49 4.11 4.39 5.60 5.61 5.65 5.89 7.49	EN ISO 4017	
	DIN 582				
1.60 6.10	DIN 625		1.30 1.45 4.11 5.19 5.46 5.47 5.49 5.60 6.29 6.66	EN ISO 4762	
3.38	DIN 6885		4.19 5.09 5.91 5.94	EN ISO 7045	
1.33 4.12 4.14 5.55	EN ISO 4032		5.24	EN ISO 7049	
5.51	EN ISO 4035		4.05 7.48	EN ISO 7089	


## 10.12 Exploded drawings

### 10.12.1 1LA,1MA shaft heights 63 ... 90L, 1MB shaft heights 63 ... 71

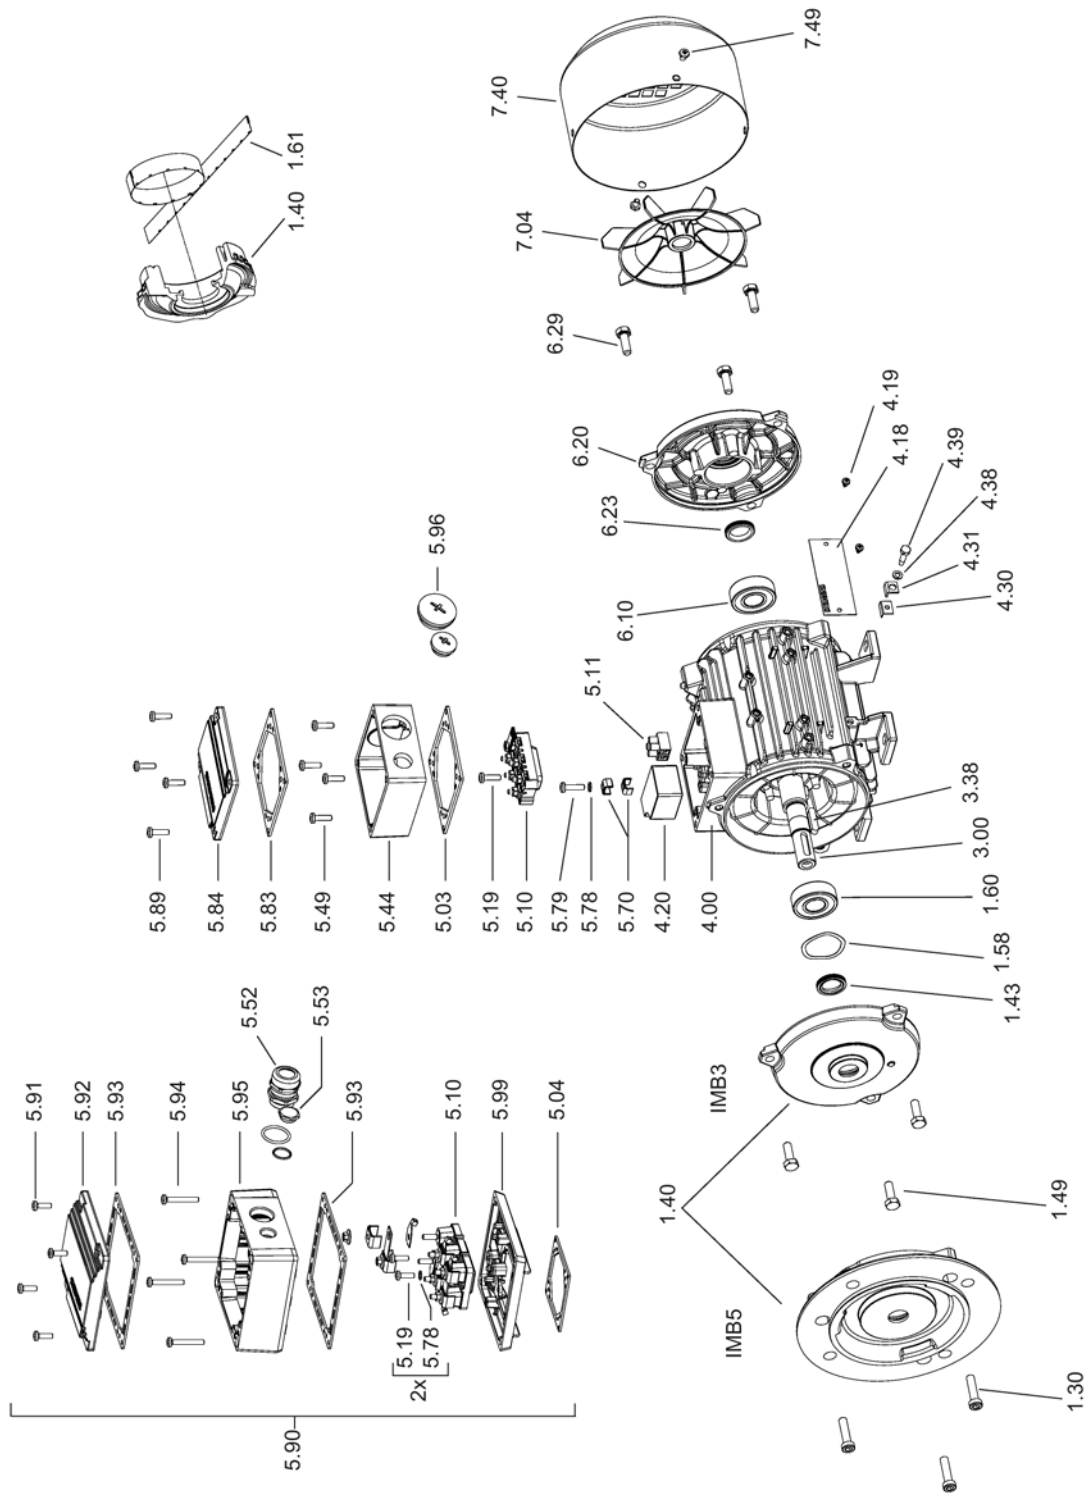





10.12.2 1LA,1MA shaft heights 100 ... 160

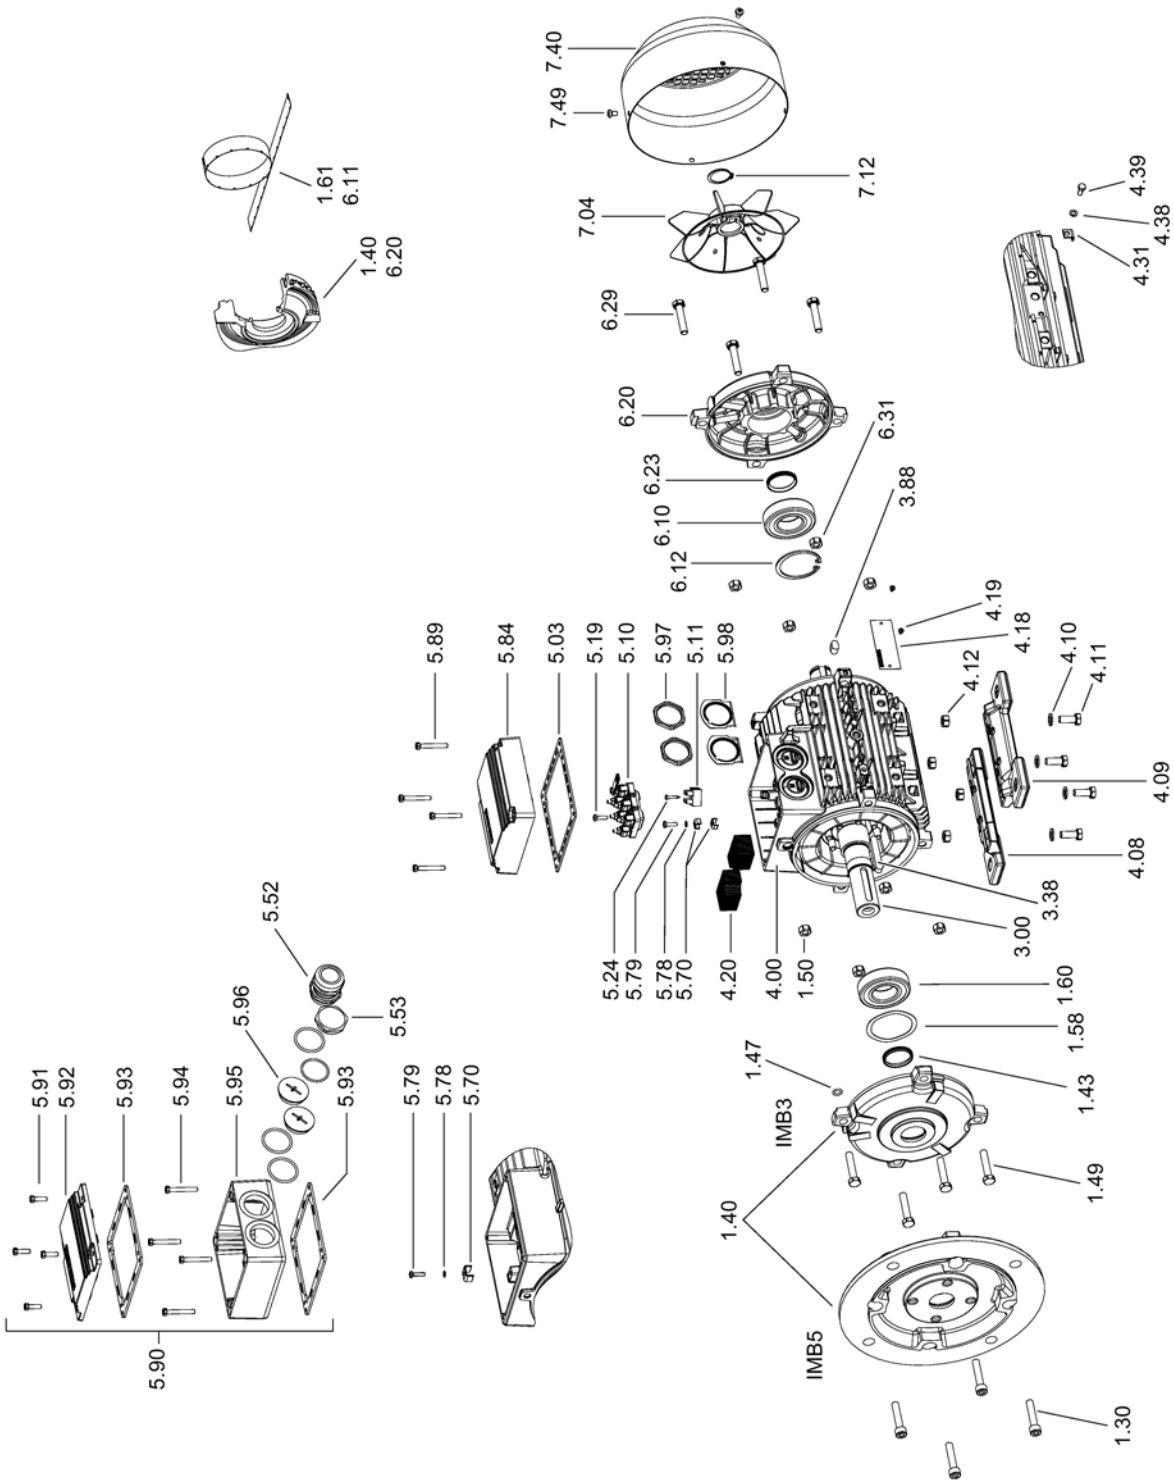


10.12.3 1LA5180 ... 225

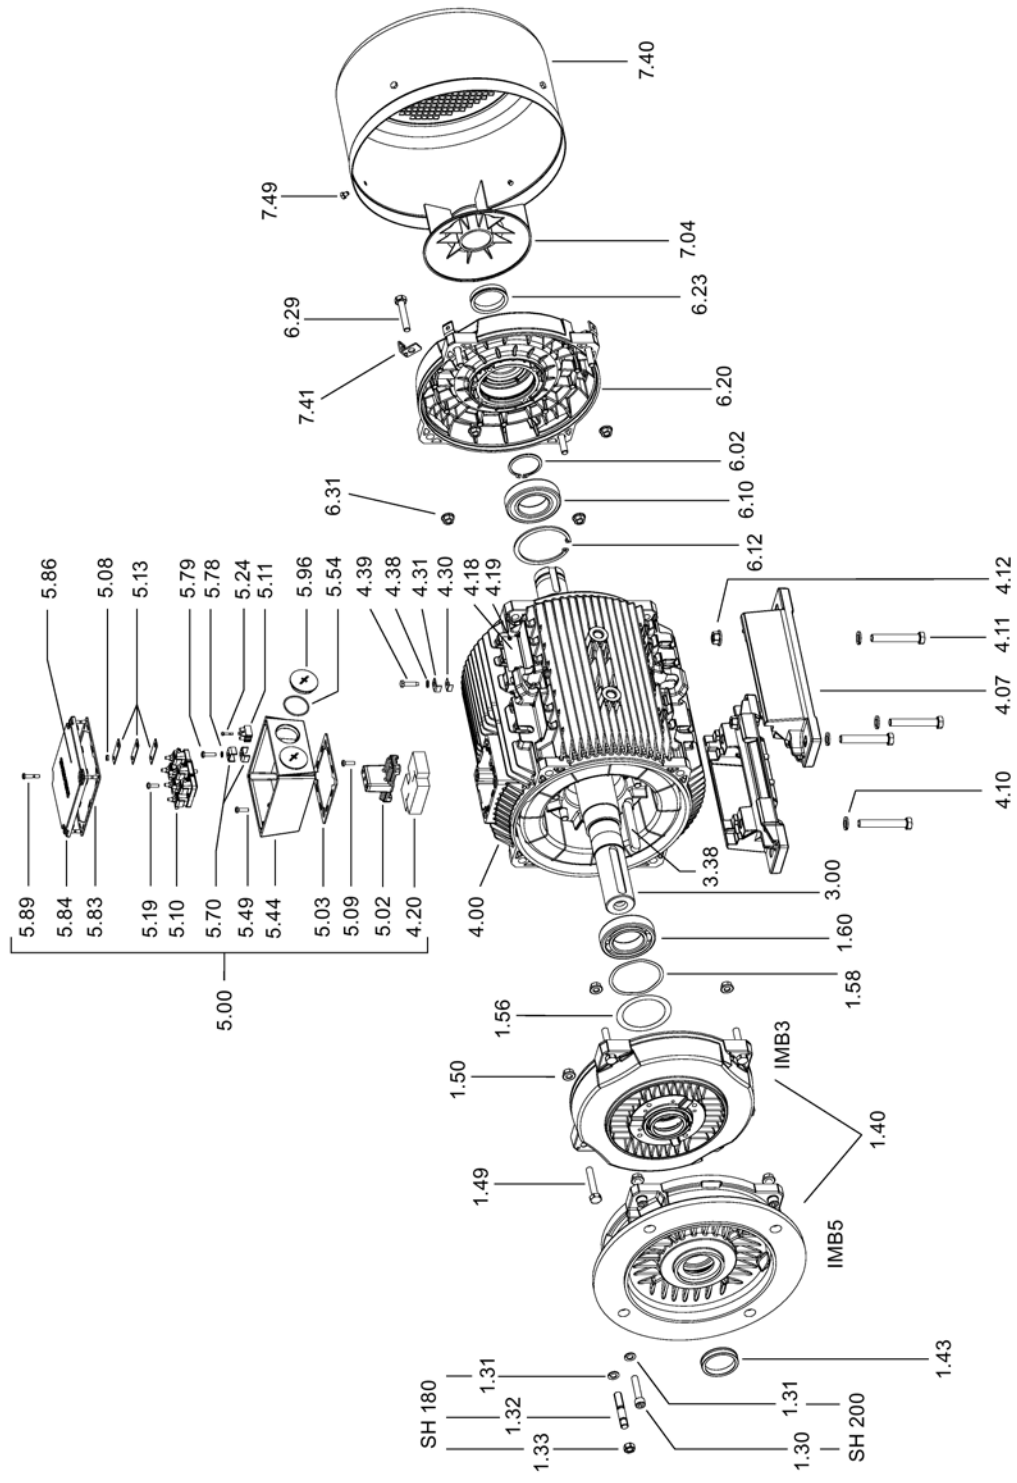


10.12.4 1MA6180 ... 200

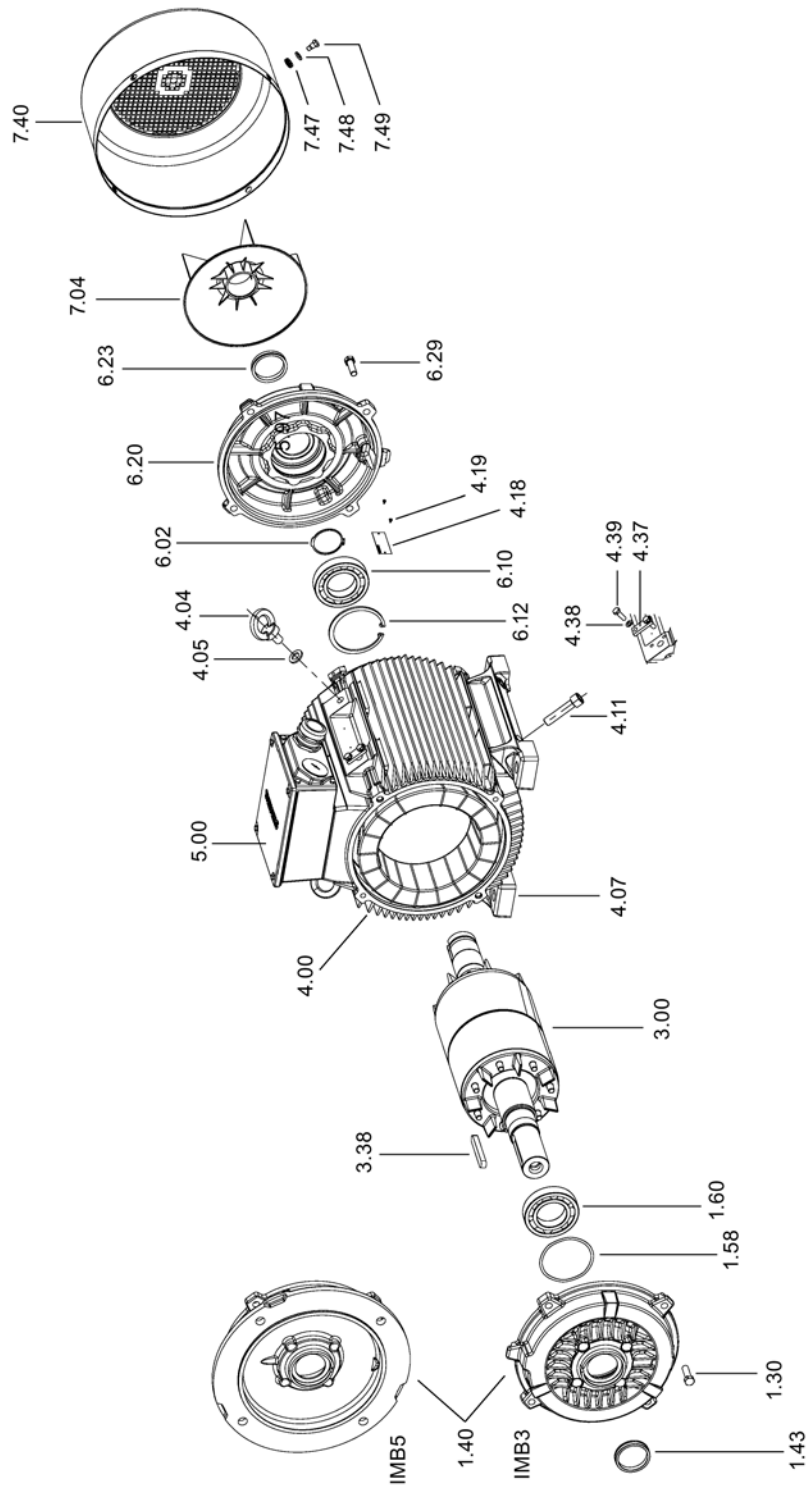


10.12.5 Terminal boxes 1MA6180 ... 200

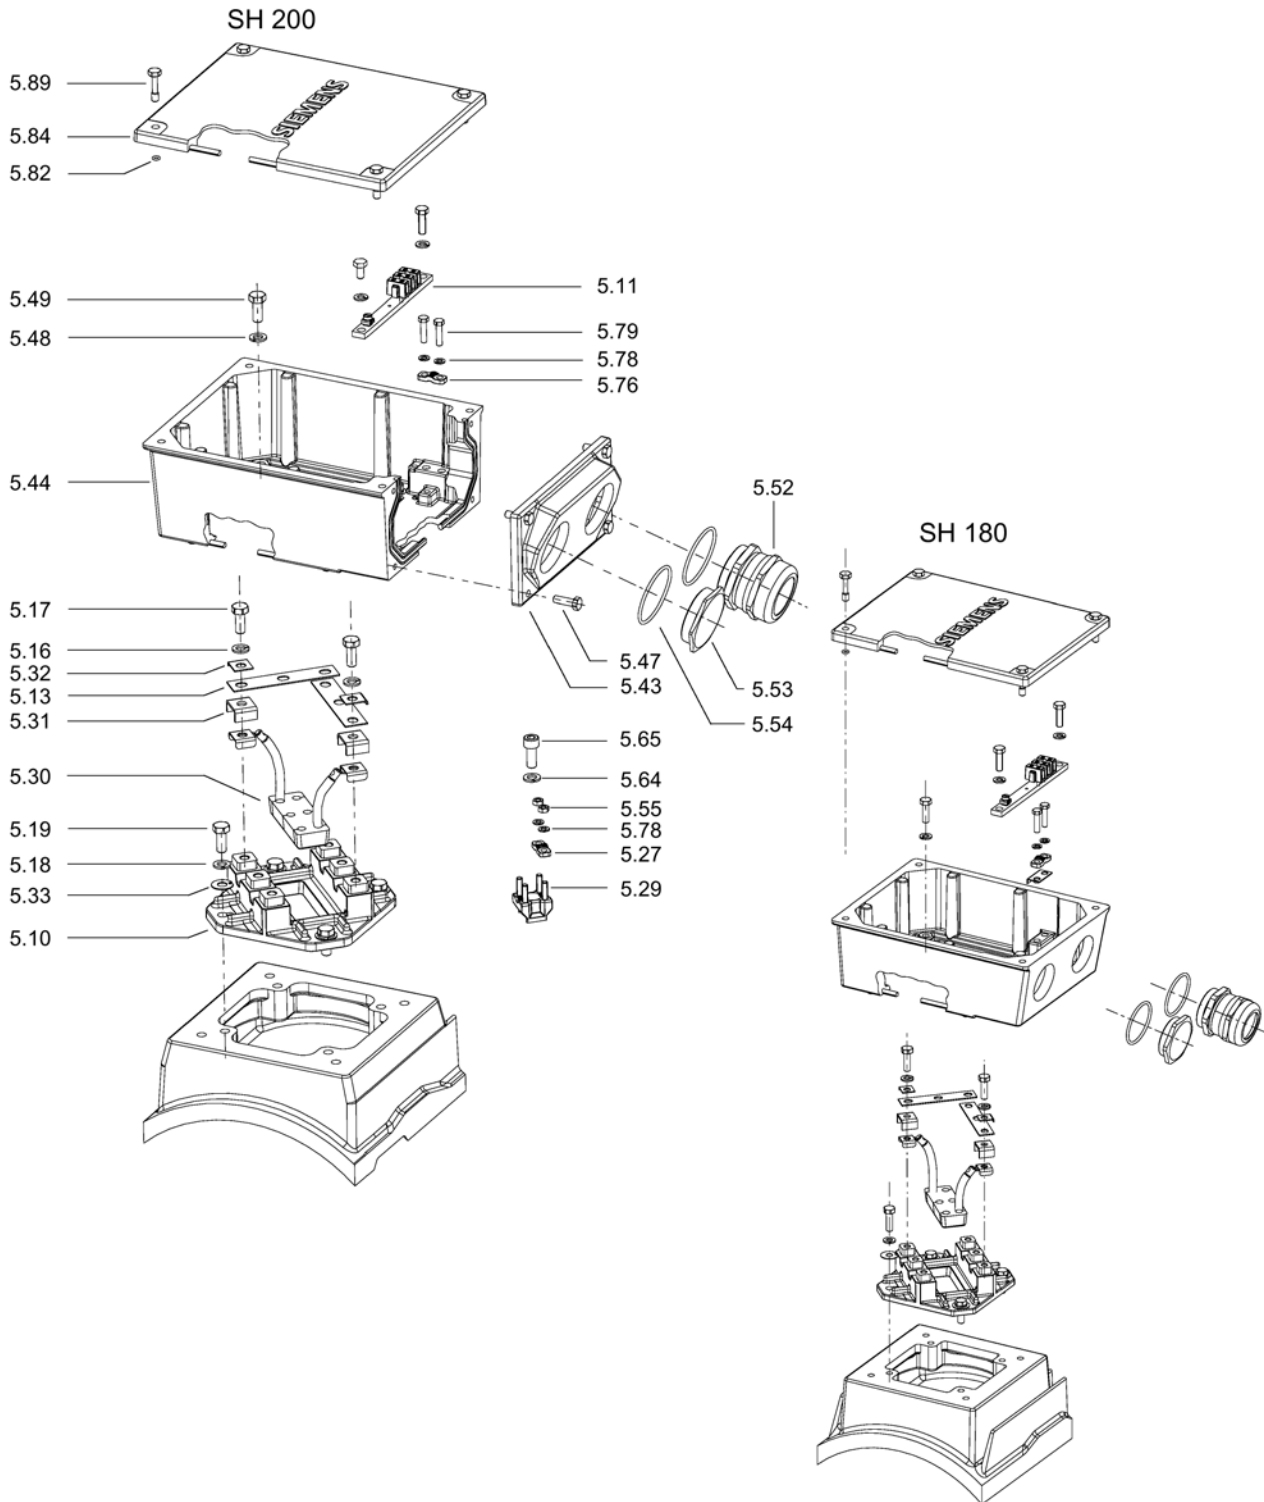


10.12.6 1MB1 SH80 ... 160 aluminum

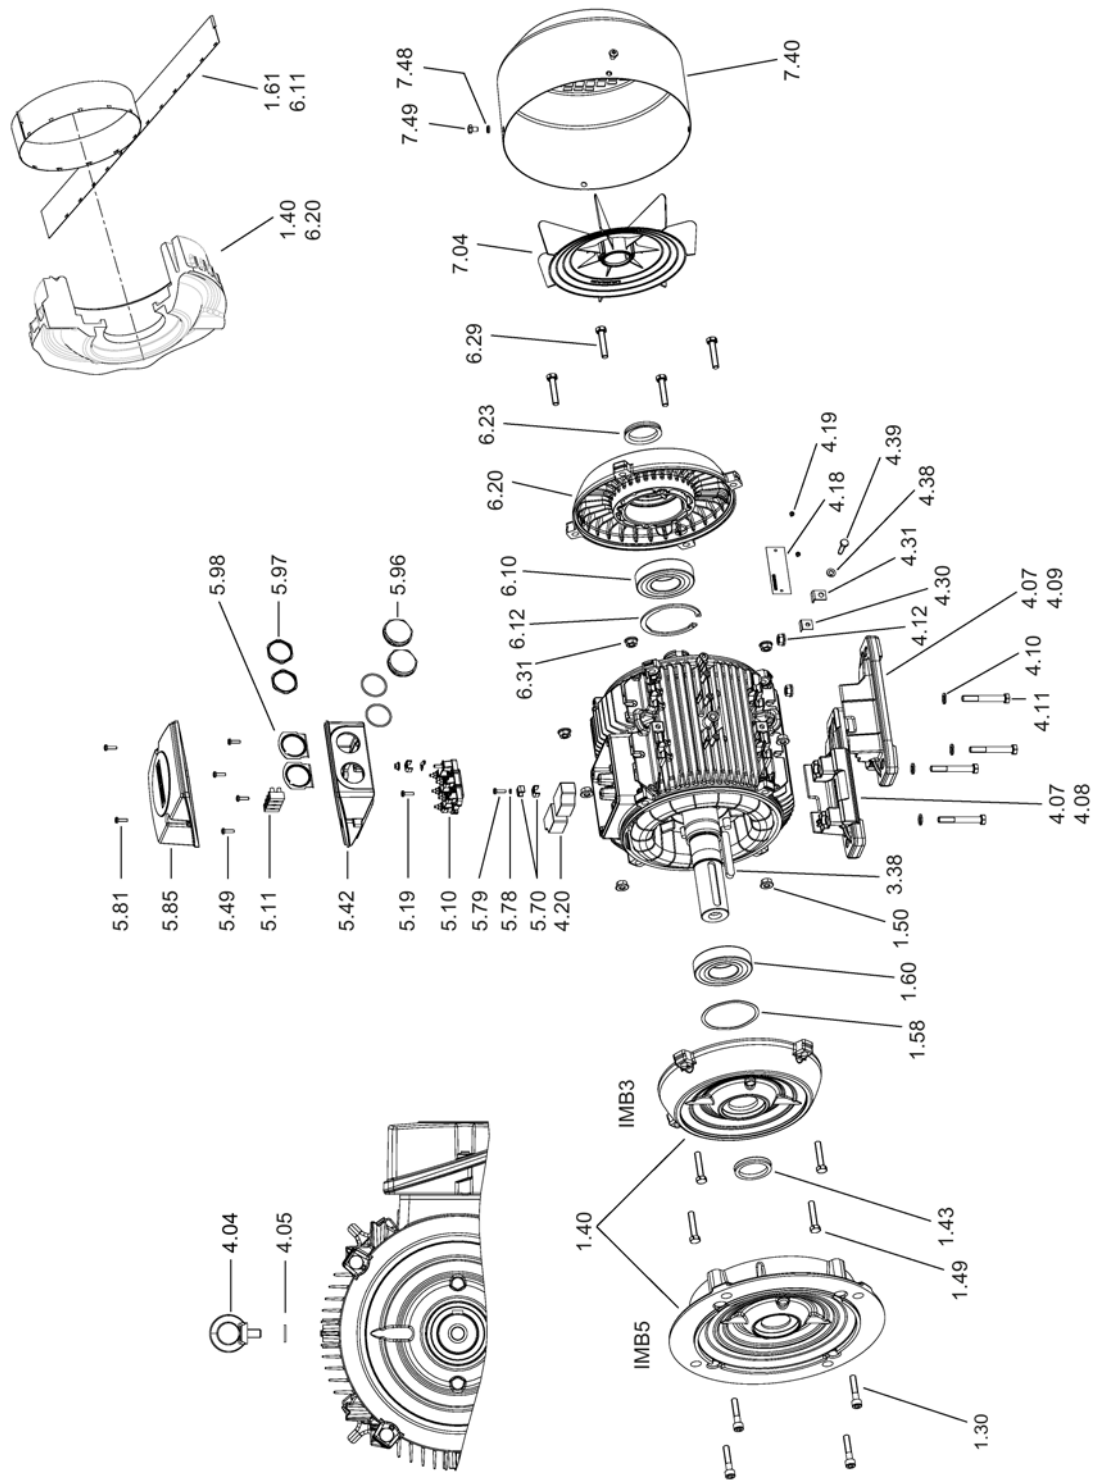


10.12.7 1MB1 shaft heights 71 ... 90 cast iron

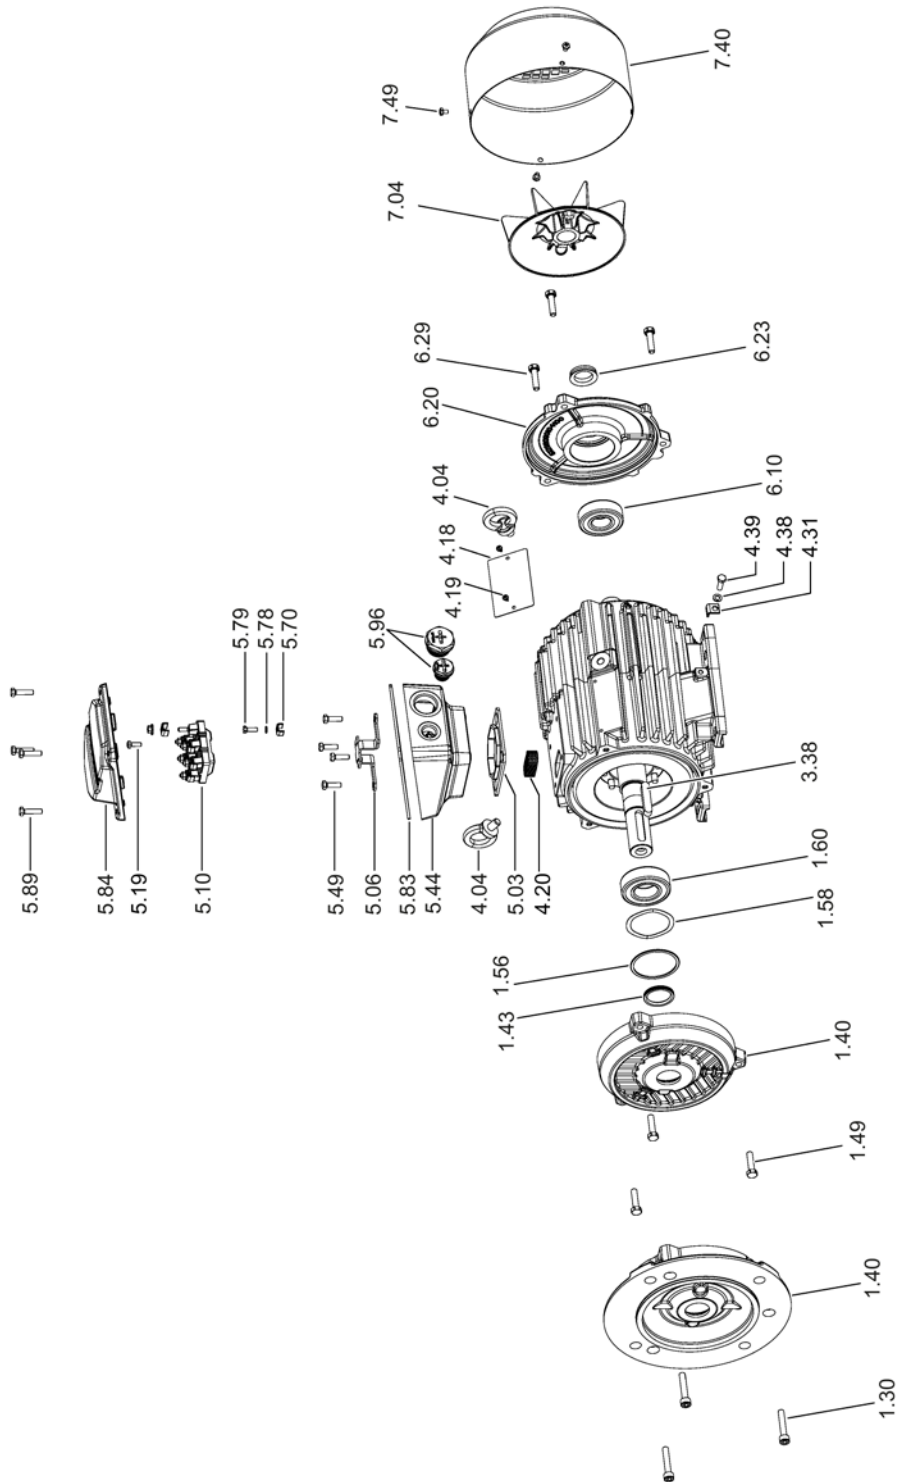

10.12.8 1MB1 shaft heights 100 ... 200 cast iron

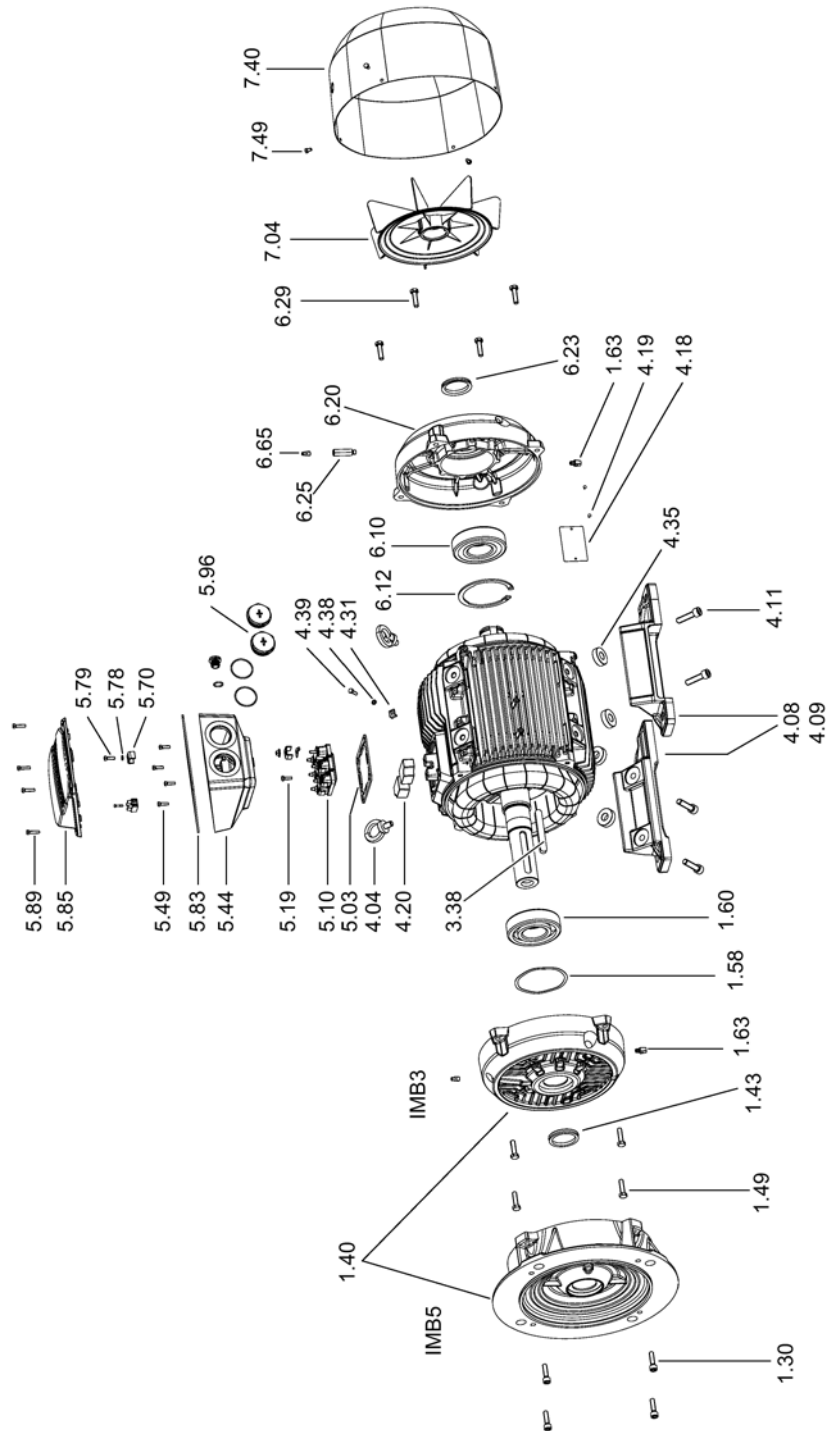


10.12.9 1MB1 shaft heights 225 ... 315 cast iron

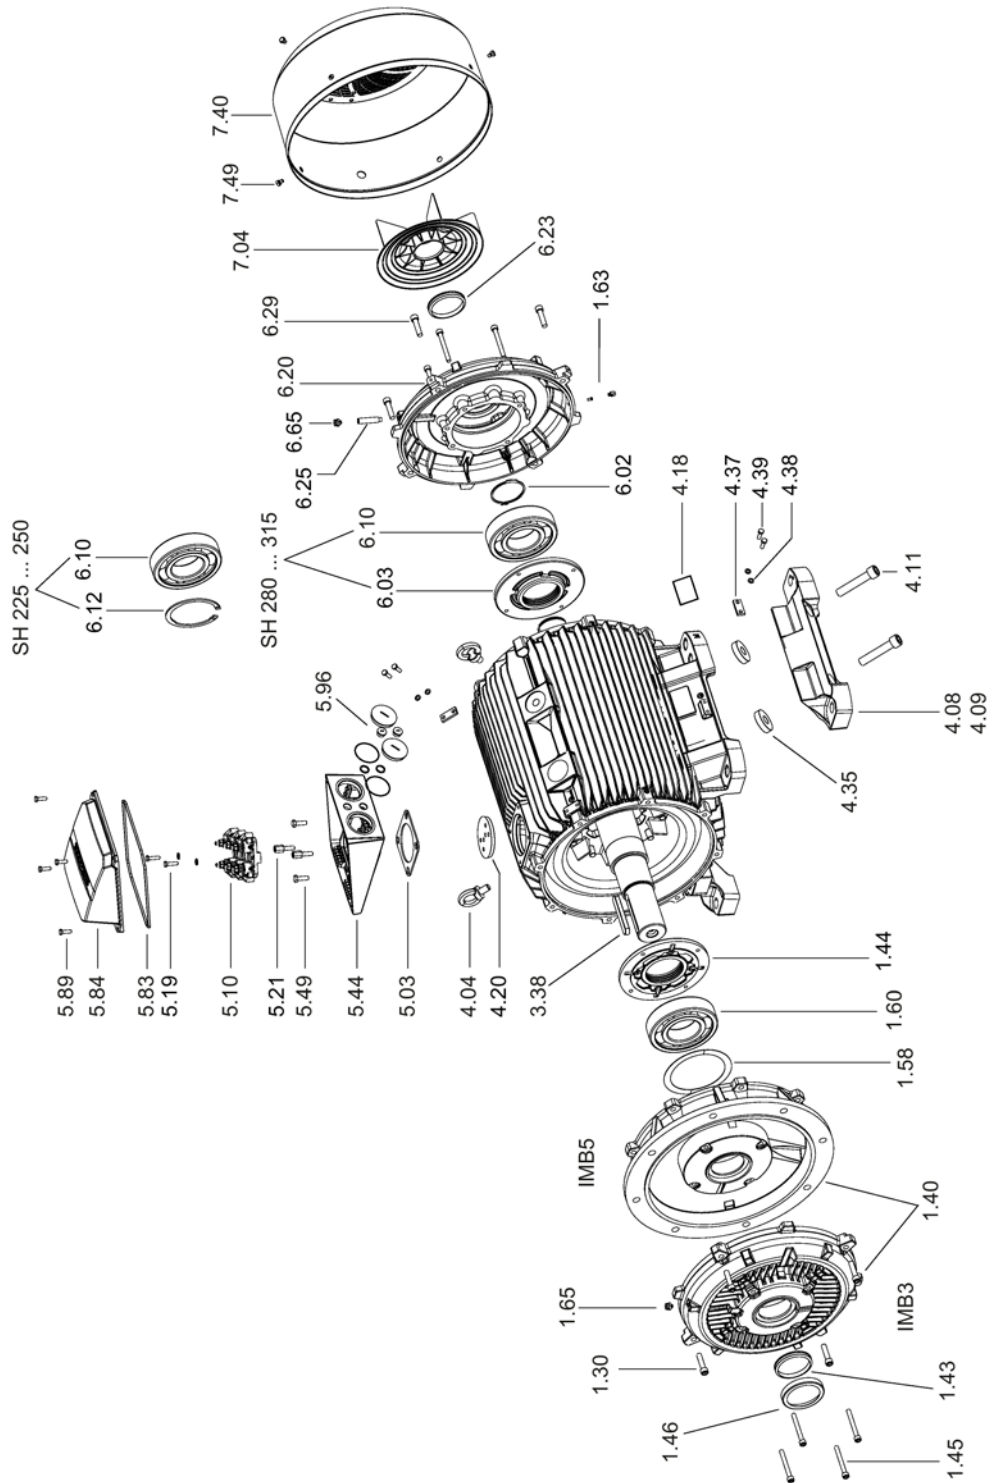







10.12.11 1MB5 terminal box shaft height 315 cast iron

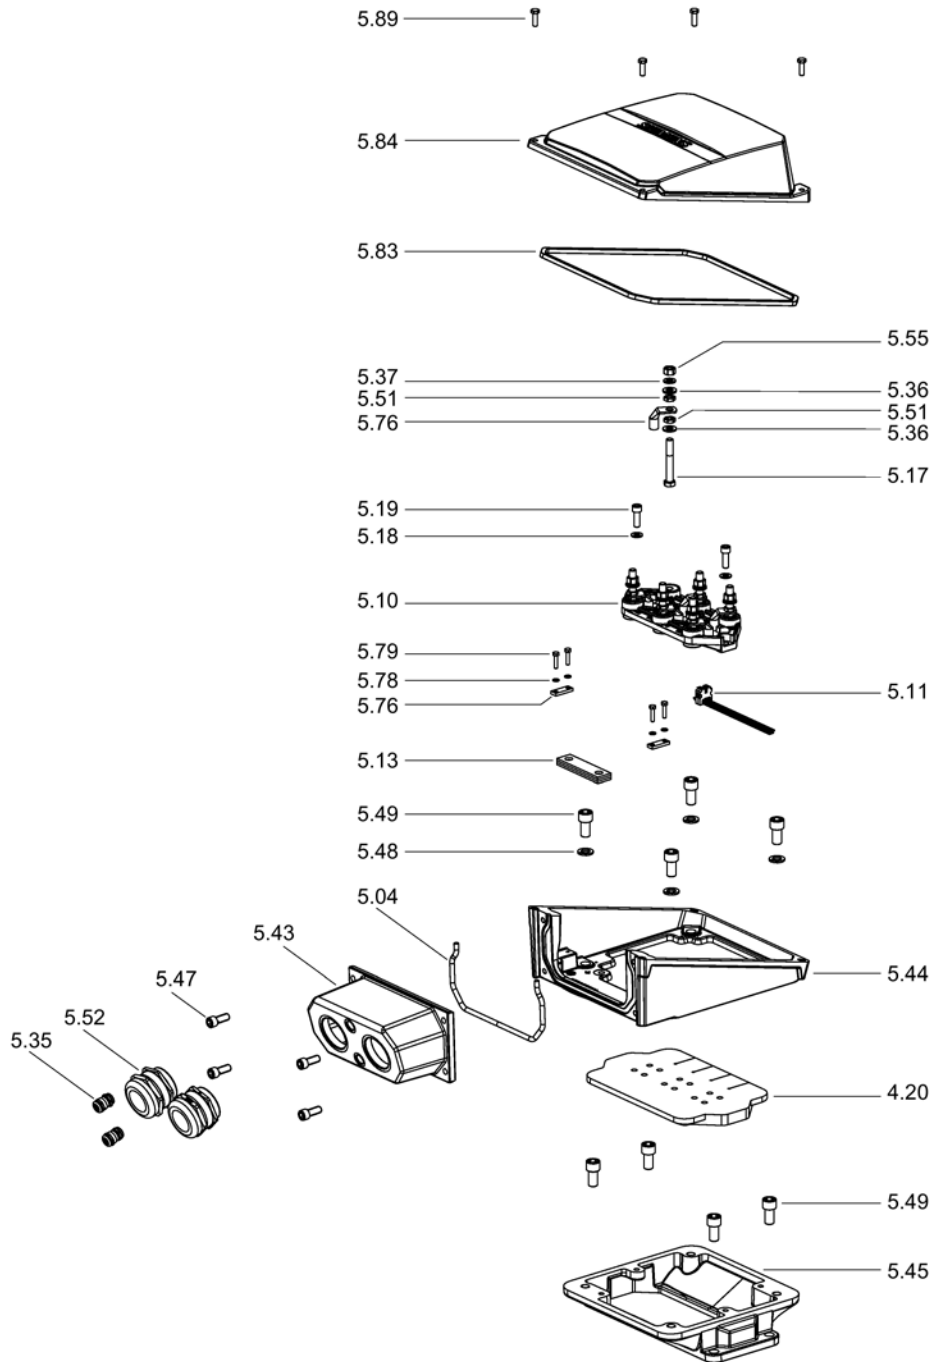


10.12.12 1MB5 shaft height. 355 cast iron

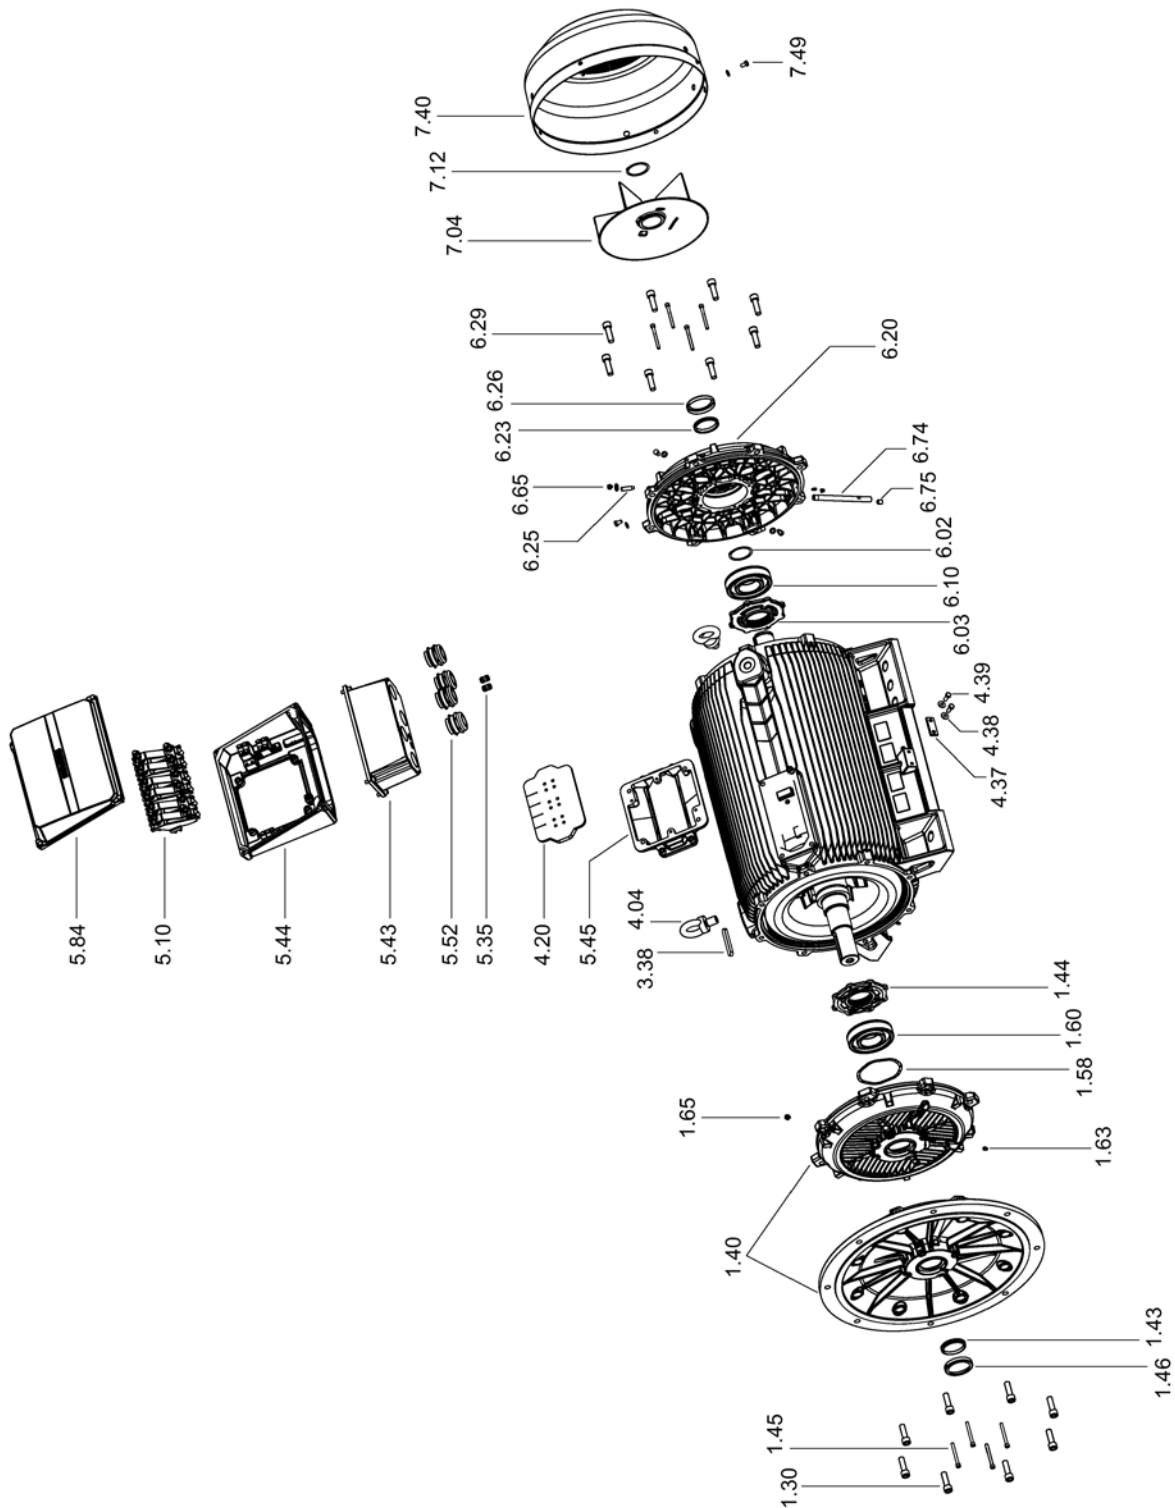





### 10.12.13 1MB5 terminal box shaft height 355 cast iron

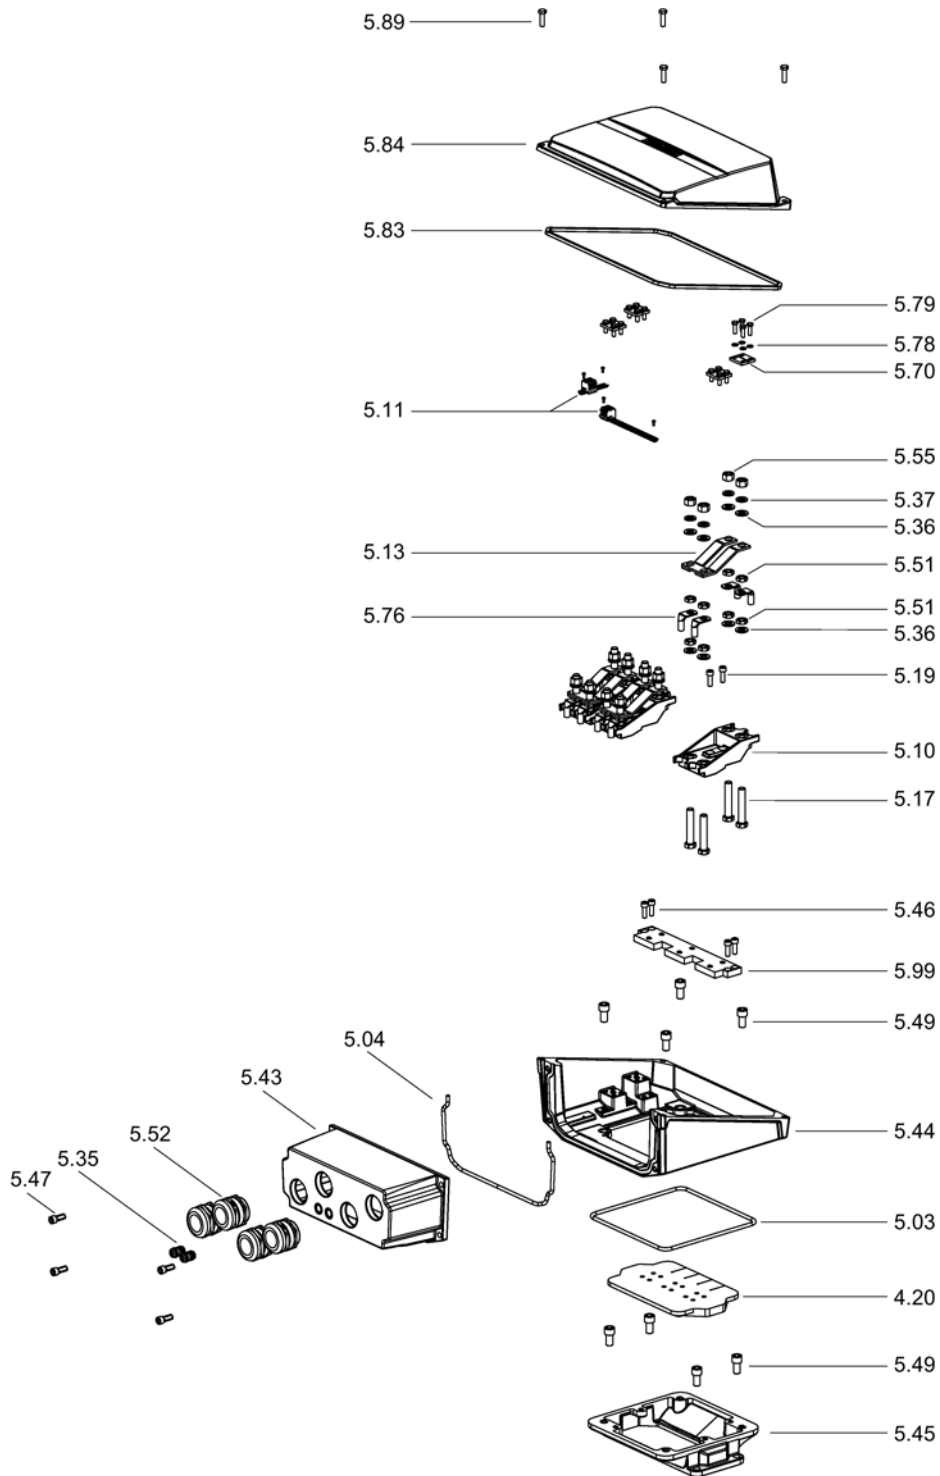





10.12.14 1LG4/6 SH180 ... 315

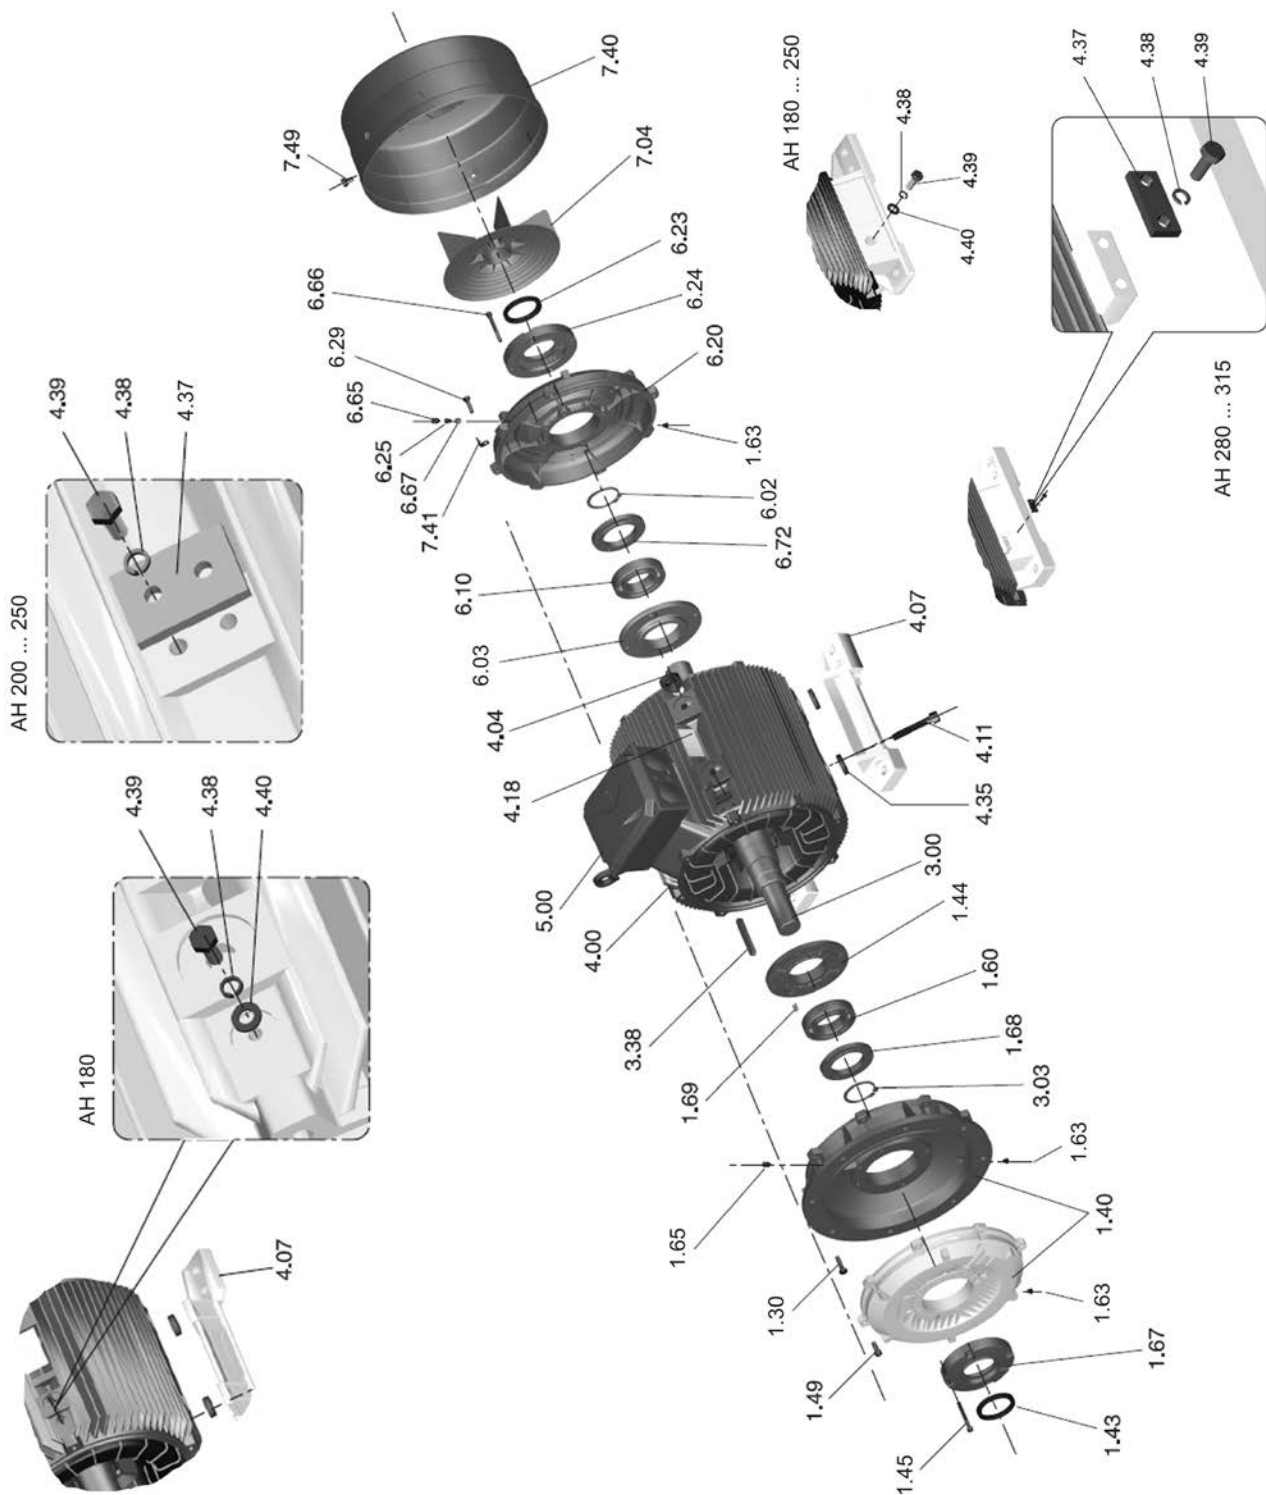





10.12.15 Terminal box gk330, gt320, gk430, gt420

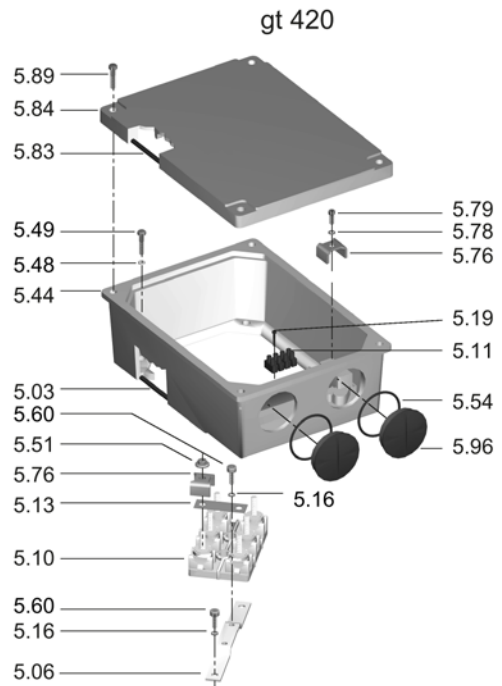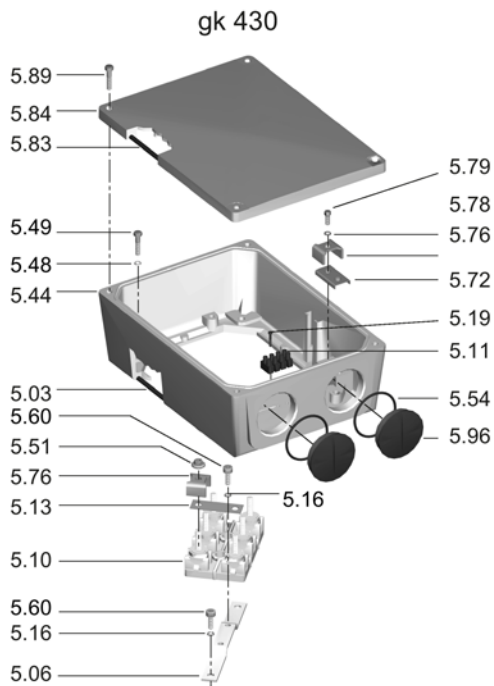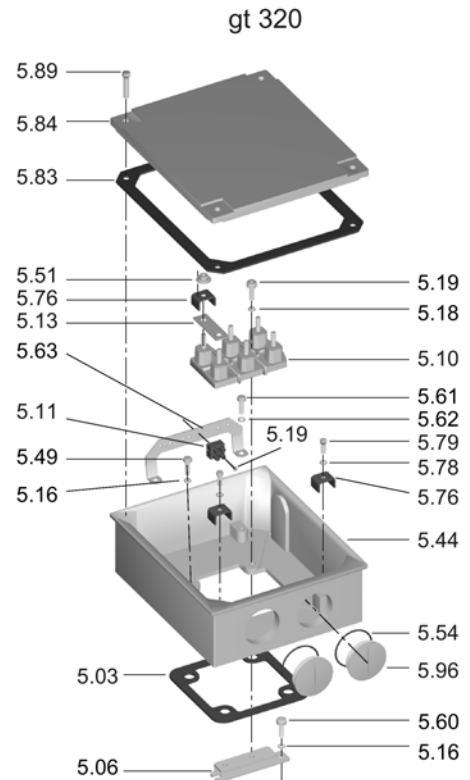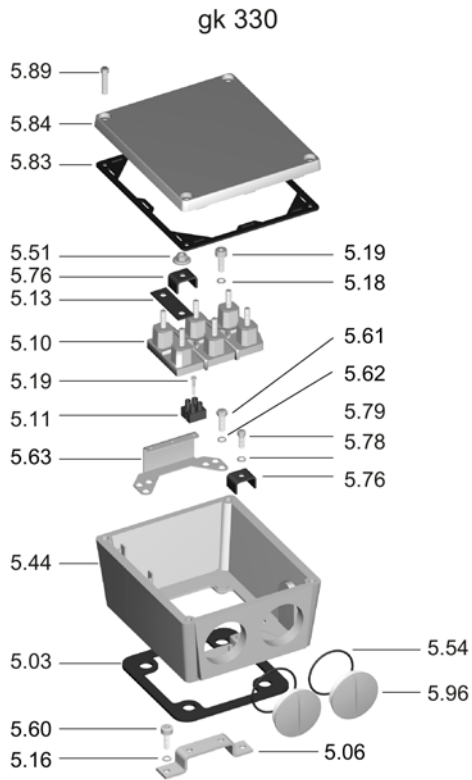

## 10.12.16 Terminal box gt431, gt421, gt520, gt540

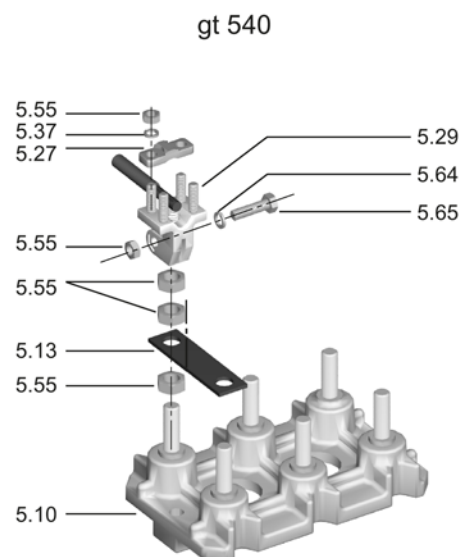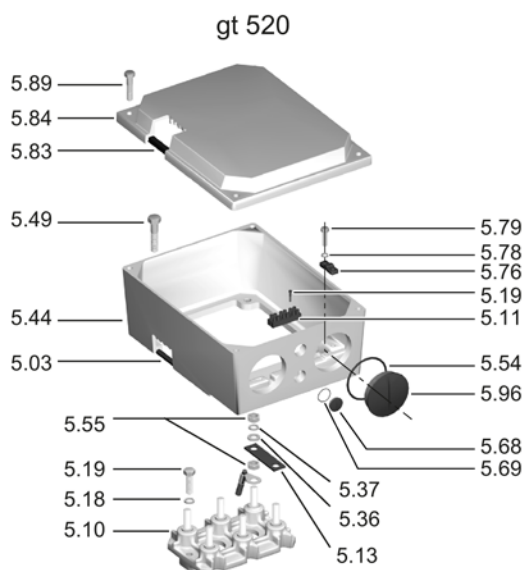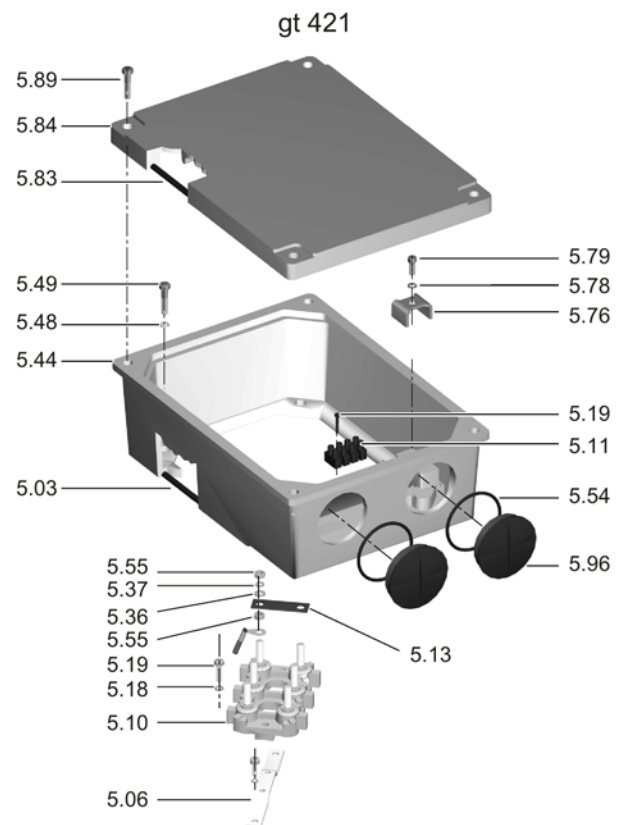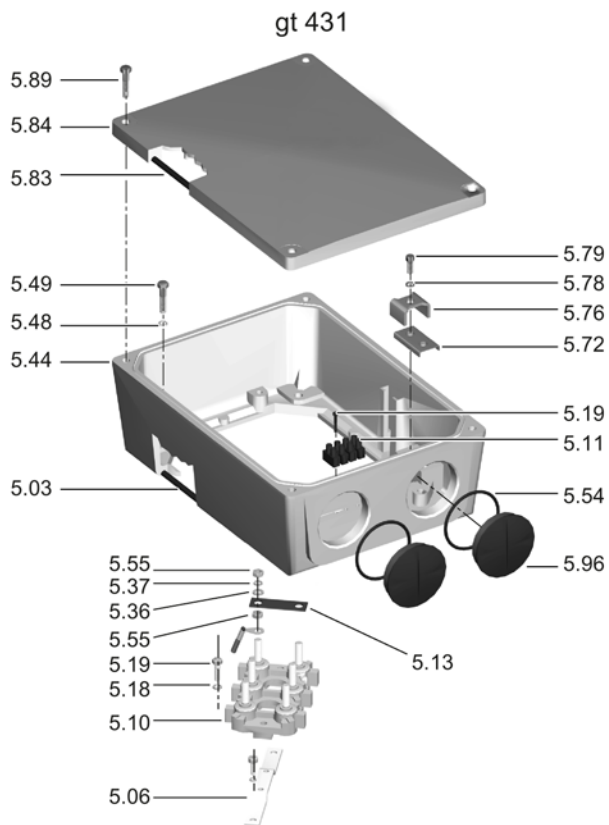

10.12.17 Terminal box 1LG4/6, 1MB1, gt620, gt640, gt791

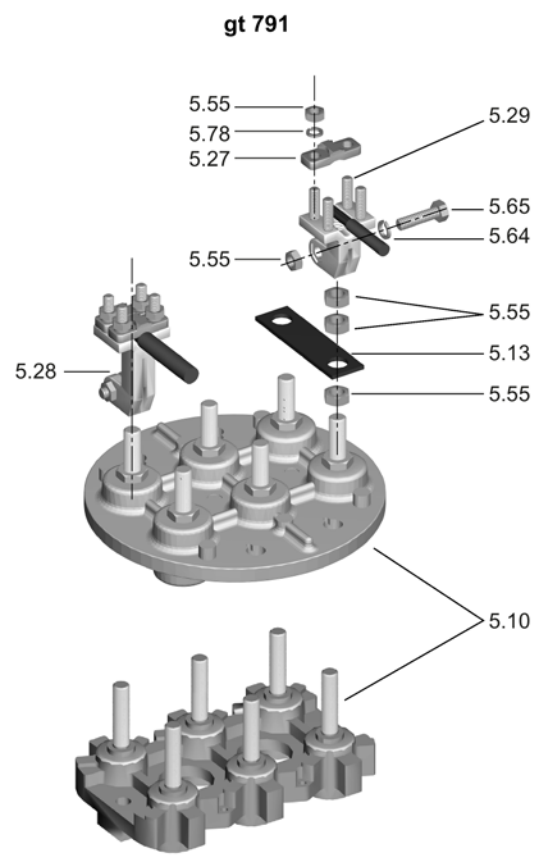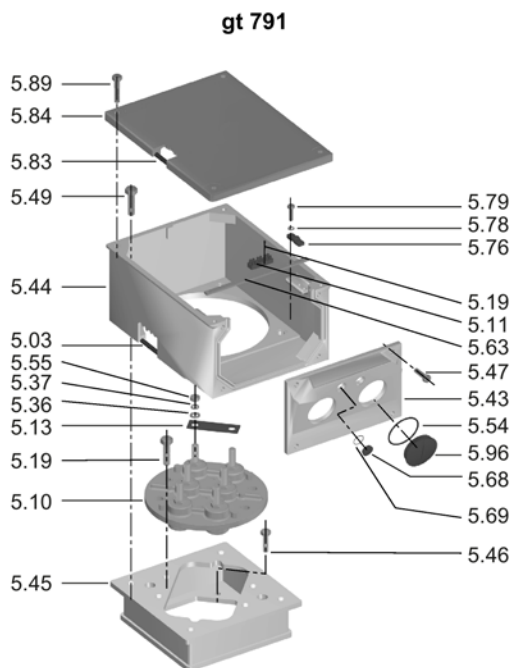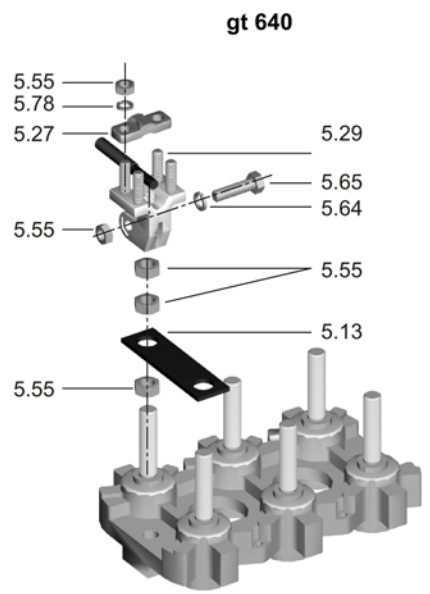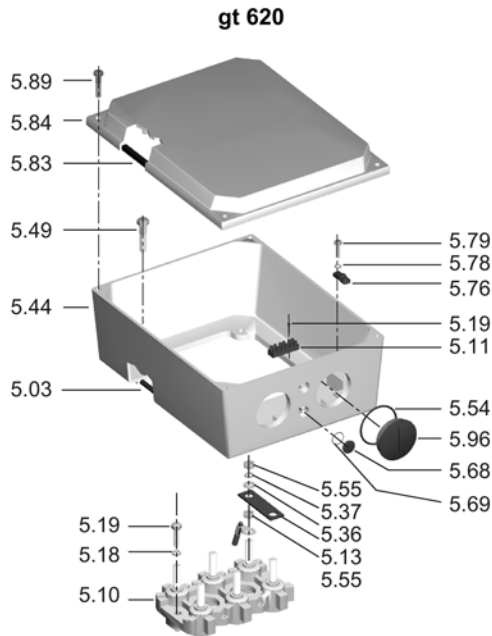



# Disposal

## 11.1 Introduction

Protecting the environment and preserving its resources are corporate goals of the highest priority for us. Our worldwide environmental management system to ISO 14001 ensures compliance with legislation and sets high standards in this regard. Environmentally friendly design, technical safety and health protection are always firm goals even at the product development stage.

Recommendations for the environmentally friendly disposal of the machine and its components are given in the following section. Be sure to comply with local disposal regulations.

## 11.2 RoHS - restricting the use of certain hazardous substances

In compliance with RoHS ("Restriction of certain Hazardous Substances" ) we replace substances that are damaging to the environment by those that are not based on state-of-the-art technology. In doing so, safety in operation and handling will take priority at all times.

## 11.3 Country-specific legislation

### Country-specific legislation



The machine uses materials that can be recovered or recycled. Correctly separating materials helps to simply recycle important materials.

- When disposing of the machine or of waste that is created during the individual phases of its life cycle, please observe the statutory requirements applicable in the country of use.
- Please contact your local authorities for more information about disposal.

## 11.4 Preparing for disassembly

Disassembly of the machine must be carried out and/or supervised by qualified personnel with appropriate expert knowledge.

1. Contact a certified waste disposal organization in your vicinity. Clarify what is expected in terms of the quality of dismantling the machine and provision of the components.
2. Follow the five safety rules (Page 12).
3. Disconnect all electrical connections and remove all cables.
4. Remove all liquids such as oil and cooling liquids. Collect the liquids separately and dispose of them in a professional manner.
5. Detach the machine fixings.
6. Transport the machine to a suitable location for disassembly.

### See also

Corrective maintenance (Page 124)

## 11.5 Dismantling the machine

Dismantle the machine using the general procedures commonly used in mechanical engineering.

 **WARNING**

**Machine parts can fall**

The machine is made up of heavy parts. These parts are liable to fall during dismantling. This can result in death, serious injury or material damage.

- Before you release any machine parts, secure them so that they cannot fall.

## 11.6 Disposal of components

### Components

The machines consist mainly of steel and various proportions of copper and aluminum. Metals are generally considered to be unlimitedly recyclable.

Sort the components for recycling according to whether they are:

- Iron and steel
- Aluminum

- Non-ferrous metal, e.g. windings  
The winding insulation is incinerated during copper recycling.
- Insulating materials
- Cables and wires
- Electronic waste

### **Process materials and chemicals**

Sort the process materials and chemicals for recycling according to whether they are for example:

- Oil
- Grease
- Cleaning substances and solvents
- Paint residues
- Anti-corrosion agent
- Coolant additives such as inhibitors, antifreeze or biocides

Dispose of the separated components according to local regulations or via a specialist disposal company. The same applies for cloths and cleaning substances which have been used while working on the machine.

### **Packaging material**

- If necessary, contact a suitable specialist disposal company.
- Wooden packaging for sea transport consists of impregnated wood. Observe the local regulations.
- The foil used for water-proof packaging is an aluminum composite foil. It can be recycled thermally. Dirty foil must be disposed of via waste incineration.



## Service and support

### A.1 Siemens Industry Online Support

#### Technical questions or additional information



If you have any technical questions or require additional information, please contact Technical Support (<https://support.industry.siemens.com/cs/ww/en/sc/2090>).

Please have the following data ready:

- Type
- Serial number

You can find this data on the rating plate.

#### Contact person



If you wish to request on-site service or order spare parts, please contact your local office. This office will contact the responsible service center on your behalf. You can find your contact person in the relevant contact database:

[www.siemens.com/your contact](http://www.siemens.com/your contact) ([www.siemens.com/your contact](http://www.siemens.com/your contact))

#### Siemens Support for on the move



You can obtain optimum support anywhere you go using the "Siemens Industry Online Support" app. The app is available for Apple iOS, Android and Windows Phone.

### A.2 Further documents

These operating instructions can also be obtained at the following Internet site:

<http://support.industry.siemens.com> (Page 163)



## Technical data

### B.1 Tightening torques

#### B.1.1 Tightening torques for screw and bolt connections

##### Bolt locking devices

- Refit nuts or bolts that are mounted together with locking, resilient, and/or force-distributing elements with identical, fully-functional elements when re-assembling. Always renew keyed elements.
- When screwing together threads secured with a liquid adhesive, use a suitable medium such as Loctite 243.
- Always use suitable securing devices or removable adhesives (e.g., Loctite 243) when installing fixing bolts with a clamping length of less than 25 mm. The clamping length is taken as the distance between the head of the bolt and the point at which the bolt is screwed in.

##### Tightening torques

The bolted connections with metal contact surfaces, such as end shields, bearing cartridge parts, terminal box parts bolted onto the stator frame, should be tightened to the following torques, depending on the thread size:

Table B- 1 Tightening torques for bolted connections with a tolerance of  $\pm 10\%$ .

Thread $\varnothing$	M5	M6	M8	M10	M12	M16	M20
Nm	5	8	20	40	70	170	340

The tightening torques stated above apply to screws with property class 8.8, A4-70 or A4-80 according to ISO 898-1, however only to bolts screwed into components made from materials with the same or higher property class, e.g. cast iron, steel or cast steel.

##### Non-standard tightening torques

Different tightening torques for electrical connections and bolted connections for parts with flat seals or insulating parts are specified in the relevant sections and drawings.

### B.1.2 Stud-type bushings

Table B- 2 Tightening torques for stud-type bushings

Thread Ø		M 4	M 5	M 6	M 8	M 10	M 12	M 16	M 20
Nm	Min.	1	1.6	2.5	5	8	13	25	42
	Max.	1.2	2	3	6	10	15.5	30	52

### B.1.3 Terminal boxes, end shields, grounding conductors, sheet metal fan covers

If no other tightening torques are specified, then the values in the following table apply.

Table B- 3 Tightening torques for screws on the terminal box, end shields, screw-type grounding conductor connections

Thread Ø		M 3.5	M 4	M 5	M 6	M 8	M 10	M 12	M 16	M20
Nm	min	0.8	2	3.5	6	16	28	46	110	225
	max	1.2	3	5	9	24	42	70	165	340

#### Tightening torque for the condensation drain plug

Tighten the condensation drain plug M6x0.75 with a torque between 1.5 and 2.0 Nm.

#### B.1.3.1 Terminal board and grounding

Table B- 4 Tightening torques for electrical connections on the terminal board and grounding

Thread Ø		M 3.5	M 4	M 5	M 6	M 8	M 10	M 12	M 16
Nm	min	0.8	0.8	1.8	2.7	5.5	9	14	27
	Max.	1.2	1.2	2.5	4	8	13	20	40

### B.1.4 Additional connecting terminals for monitoring equipment and anti-condensation heating

Table B- 5 Tightening torques for monitoring equipment and anti-condensation heating

Main terminal box EN 60999-1: 2000 table 4 III	0.4 Nm	
Auxiliary terminal box	min 0.6 Nm	max 0.8 Nm



# Quality documents

## C.1 Quality documents SIMOTICS in SIOS



You can find the quality documents here:

<https://support.industry.siemens.com/cs/ww/de/ps/13310/cert>  
(<https://support.industry.siemens.com/cs/ww/en/ps/13310/cert>)



# Index

## 5

5 safety rules, 12

## A

Aligning, 62, 62  
Alignment accuracy, 63  
Aluminum conductors, 83  
Anti-condensation heating, 44, 103, 125  
    Insulation resistance, 55, 92  
    Repairs, 126, 137  
Assembly  
    Rolling bearings, 130  
Axial force, 66  
Axial gap, 62

## B

Balance quality, 64  
Balancing type, 56  
Bearing currents  
    Reduction, 48  
Bearing insulation, 49  
Bearing shipping brace, 40  
Bearing temperature  
    Monitoring, 94  
    Set values, 94  
Blocked speed ranges, 45  
Bolt locking device, 165

## C

Cable entries  
    certified, 72  
Centering flange, 62, 62  
Circuit diagram, 71  
Common-mode filters, 49  
Connecting cables  
    Selection of, 67  
Cooling system  
    faults, 109  
Correct usage, 21  
Coupling, 50

## D

Damping cores, 49  
Data matrix code, 135  
Disassembly  
    Disposal, 160  
Disposal  
    Chemicals, 161  
    Components, 160

## E

Electrical faults, 107  
Electromagnetic compatibility, 16  
Electromagnetic fields, 14  
Emergency off, 104  
Emitted interference, 14  
Equipotential bonding conductor, 48  
ESD guidelines, 15  
Explosion hazard, 37, 113, 125, 126, 137  
    Bearing temperature, 102  
    Bridging the insulated bearing, 103  
    Dust deposits, 101  
    Electrostatic discharge, 16  
    Layer of dust, 101  
    Spare parts, 136  
External fan  
    Commissioning, 93  
    Maintenance, 121  
    Test run, 93

## F

faults  
    Mechanical, 108  
Faults  
    Cooling system, 109  
    Electric, 107  
    Inspection, 107, 114  
    Rolling bearings, 109  
Faults in operation, 98  
Feather key, 65  
Flammable substances, 13  
Foundation forces, 61

## G

General inspection, 115  
Grounding system  
  Meshed, 49

## H

Hazardous substances, 13  
Hearing damage, 14  
Hot surfaces, 13  
Hybrid mixtures, 20, 100

## I

Ignition hazard, 15  
Inspection  
  Faults, 107, 114  
Installation  
  Initial inspection, 115  
Insulated bearings, 49, 103  
Insulated coupling, 50  
Insulation resistance, 40, 52, 89, 120  
  Anti-condensation heating, 55, 92  
  measure, 53, 90  
Interference immunity, 16  
Interference voltages, 17  
Interlocking circuit  
  Anti-condensation heating, 44

## L

Limit speed, 47  
Live parts, 13  
Low-Voltage Directive, 11

## M

Machine  
  Aligning to the driven machine, 61  
  Securing, 61  
Machine expansion, 62  
Machine marking, 124  
Maintenance  
  Maintenance intervals, 111  
Mechanical faults, 108  
Minimum air clearances, 75  
More information, 163

## N

Noise emissions, 14

## O

On-site service, 163  
Operating mode, 33  
O-ring seals, 134  
Output element, 65  
Overall flatness, 64  
Over-critical machine, 45  
Overspeed, 33

## P

Paint finish, 32  
Paint system, 122  
Paintwork damage, 122  
Polarization index, 40, 52, 54, 89, 92, 120  
Positioning, 61  
Precision alignment, 62  
Preload  
  Rotor bracing, 39  
Preparations for assembly, 51  
Property class, 61

## Q

Qualified personnel, 12

## R

Radial force, 66  
Rating plate, 21  
Re-commissioning, 106  
Regreasing system, 40  
Repainting, 123  
Repair  
  Initial inspection, 115  
Residual risks, 33  
Restriction of certain Hazardous Substances, 159  
RF grounding point, 48  
Risk of explosion, 125  
  Bearing temperature, 114  
  Cleaning, 114  
  Layer of dust, 114  
RoHS, 159  
Rolling bearings  
  Assembly, 130

- faults, 109
  - Inspection, 116
- Rotating parts, 13
- Rotor shipping brace, 38
  - Remove, 63

## S

- Safety instructions
  - Flammable substances, 13
  - Hazardous substances, 13
  - Hot surfaces, 13
  - Live parts, 13
  - Maintenance work, 112
  - Rotating parts, 13
- Sealing plugs
  - certified, 72
- Selection of bolts, 61
- Spare parts, 136, 163
- Spares on Web, 136
- Standard flange, 62, 62
- Stoppages, 104
  - Rolling bearings, 106
- Supplementary devices, 28
- Switching on, 95, 95, 104
- System resonances, 46

## T

- Tandem operation, 50
- Technical Support, 163
- Temperature class, 103, 106
- Temperature limits, 37
- Terminal marking, 70
- Test run, 95
- Tightening torques, 67
  - Bolted connection, 165
- Type of balancing, 64
- Type of protection, 136

## V

- Vibration values, 46, 46, 96

[www.siemens.com/drives/...](http://www.siemens.com/drives/...)

Siemens AG  
Process Industries and Drives  
Large Drives  
Postfach 48 48  
90026 NÜRNBERG  
Germany

